


## USE AND MAINTENANCE MANUAL

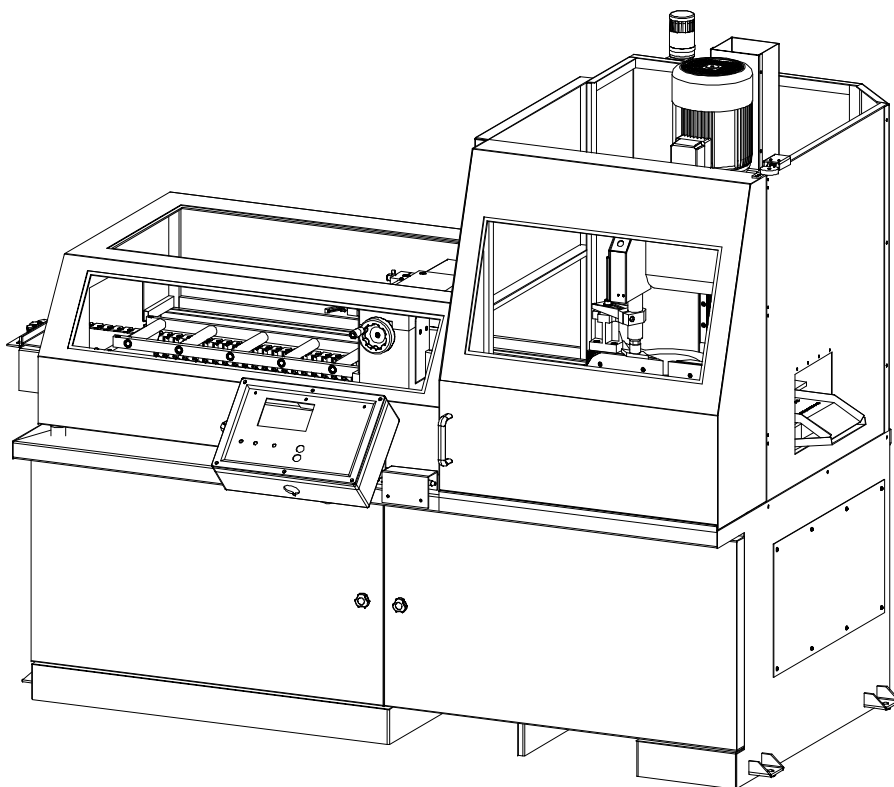

YEAR OF MANUFACTURE: \_\_\_\_\_






<b>Introduction and technical specifications .....</b>	<b>1-1</b>
Foreword .....	1-1
Machine presentation .....	1-1
Machine specification .....	1-2
Technical Data .....	1-2
Technical Data .....	1-4
Dimensions .....	1-4
<b>Functional parts .....</b>	<b>2-1</b>
CNF 400 CNC model .....	2-1
Cutting head .....	2-2
Cutting vice .....	2-2
Control Panel .....	2-3
Feeder .....	2-3
Base .....	2-4
<b>Safety and accident prevention .....</b>	<b>3-1</b>
Use of the machine .....	3-1
General recommendations .....	3-1
Recommendations to the operator .....	3-2
Machine safety devices .....	3-4
Reference standards .....	3-4
Protection against accidental contact with the blade .....	3-5
Electrical equipment .....	3-5
Emergency devices .....	3-5
Noise level of the machine .....	3-6
Noise level measurement .....	3-6
Noise level values .....	3-7
Vibration emission .....	3-7
Electromagnetic compatibility .....	3-7
<b>Machine installation .....</b>	<b>4-1</b>
Packaging and storage .....	4-1
Anchoring the machine .....	4-4
Minimum requirements .....	4-4
Check list .....	4-4
Connection to the compressed air supply .....	4-6
Connection to the power supply .....	4-6
<b>Description of machine operation .....</b>	<b>5-1</b>
Description of the control panel .....	5-1
Key for control console keyboard .....	5-1
Basic instructions for carrying out a cutting cycle .....	5-4
Manoeuvring the cutting head .....	5-4
Access to the cutting head .....	5-4
Manoeuvring the feeder .....	5-4
Clamping the work piece in the vice .....	5-5
Lubricant/coolant fluid supply .....	5-6
Preliminary check list for cutting operation .....	5-6
Starting up the machine .....	5-7
Semi-automatic operating cycle .....	5-8
Automatic operating cycle .....	5-12
Single program .....	5-15
Multiple programming .....	5-22

Multiple programming cuts .....	5–29
Automatic loop operating cycle .....	5–30
<b>Diagrams, exploded views and replacement parts .....</b>	<b>6–1</b>
Pneumatic diagram CNF 400 CNC .....	6–1
APS/P drive for step motors .....	6–2
MEANING OF THE PARAMETERS IN THE TABLE .....	6–2
SCHEMATIC CONFIGURATION OF INPUTS / OUTPUTS .....	6–5
LAYOUT OF APS/P DRIVE COMPONENTS .....	6–6
How to read the wiring diagrams .....	6–7
D2–Letter codes used to designate the type of component .....	6–9
Standardised Wiring Diagrams CNF 400 CNC (IEC 750 EN 60204–1 Standard) .....	6–12
List of IUD–IUV Card Inputs and Outputs .....	6–25
IUD: Digital Inputs and Outputs .....	6–25
IUV card: Miscellaneous Inputs and Outputs .....	6–25
CN 1 VICE .....	6–26
CNSL card: Console Inputs and Outputs .....	6–27
Exploded views .....	6–28
Base .....	6–28
Fixed worktable .....	6–30
Turntable .....	6–32
Vice assembly .....	6–34
Head unit .....	6–36
Motor assembly .....	6–38
Blade guard unit .....	6–40
Electro–cylinder unit .....	6–42
Supply carriage unit .....	6–44
Supply roller unit .....	6–46
Control panel .....	6–48
Guard rail .....	6–50
<b>Adjustments .....</b>	<b>7–1</b>
Displaying and editing the set–up parameters .....	7–1
Set language parameter .....	7–1
Set parameter for machine type .....	7–2
Set parameter for step motor .....	7–2
Setting blade characteristics, head downstroke speed and bar initializing .....	7–5
Blade motor and supply unit setting .....	7–5
Set minimum blade tension threshold .....	7–6
Optional settings .....	7–6
Cutting head setting .....	7–7
Head transducer calibration Set–up .....	7–7
Electronic systems .....	7–9
Replacing the microchip C8 on the control console .....	7–9
Machine parameters Eeprom memory .....	7–9
Replacing the M24 controller Eprom .....	7–10
Adjusting the display brightness .....	7–11
Mechanical systems .....	7–12
Cutting head stroke .....	7–12
Adjusting the position of the blade–cleaning brush .....	7–12
Replacing tool .....	7–14
Feeder .....	7–15
Vice .....	7–17
Adjusting the vice play .....	7–17

Adjusting the anti-chip device .....	7-18
<b>Maintenance and choice of consumables .....</b>	<b>8-1</b>
The role of the operator .....	8-1
Maintenance requirements .....	8-2
General maintenance .....	8-2
Daily .....	8-2
Weekly .....	8-2
Monthly .....	8-3
Maintenance of working parts .....	8-3
Transmission box .....	8-3
Consumable materials .....	8-4
Oils for transmission box .....	8-4
Oils for lubrication/coolant liquid .....	8-4
<b>Cutting speed and choice of tools .....</b>	<b>9-1</b>
Cutting speed .....	9-1
Basic version .....	9-1
Choice of blade .....	9-1
Tooth pitch .....	9-1
Types of swarf: .....	9-2
Cutting and feeding speed .....	9-2
Lubricant/coolant .....	9-3
Blade structure .....	9-3
Types of blades .....	9-4
Tooth shape .....	9-4
Blade selection table with respect to cutting speed and downstroke speed ...	9-7
Classification of steels .....	9-8
Classification of steels .....	9-9
<b>Troubleshooting .....</b>	<b>10-1</b>
Troubleshooting blade and cutting problems .....	10-1
Troubleshooting (control console diagnostics) .....	10-4
Displaying the diagnostics menu .....	10-4
Diagnostics .....	10-4
Error messages, alarm and emergency .....	10-7
<b>Optional .....</b>	<b>11-1</b>
Accessories available on request .....	11-1
Chute type bar loader CB 6001 .....	11-1
Optional .....	11-3
Blade .....	11-3
Roller table .....	11-3
Can of emulsible oil .....	11-3
Adattatore pianale a rulli lato scarico .....	11-3
Feed side roller table support .....	11-4
Minimal lubrication system .....	11-4



# Introduction and technical specifications

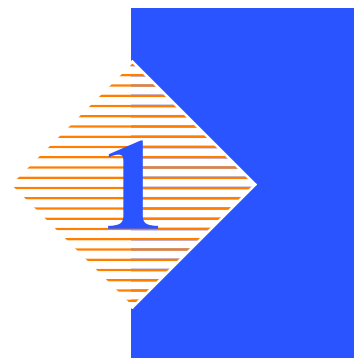

## Foreword

We have decades of experience in the construction of the best metal–cutting machines. Our experience, our knowledge of our customers and constant technological development of design and production equipment allow us to offer a specific solution for every type of cutting need. This work tool has been designed as a simple and reliable answer to the wide range of cutting needs of the modern workshop. **CNF 400 CNC** is rugged, quiet and safe. It cuts various kinds of material, with very little scrap and great applicative flexibility.


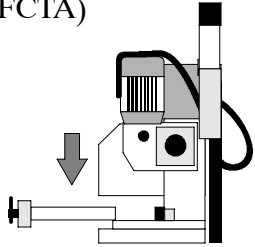
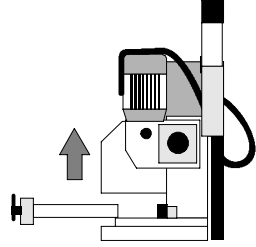

Congratulations for having chosen this product which, by following the instructions contained in this user and maintenance handbook, will guarantee you years of dependable service.

### Warning


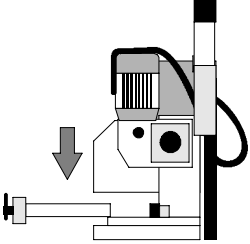
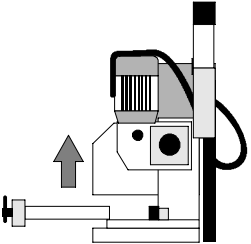





This band saw has been exclusively designed to cut metals.

## Machine presentation

**CNF 400 CNC** is an electromechanical pneumatic saw, which cuts metal profiles and solids. It can operate in SEMIAUTOMATIC or AUTOMATIC mode. In Semiautomatic mode, after setting the cutting head stroke and the head downstroke speed on the control panel, position the vice 2÷3 mm from the material being processed and press the start button on the control panel to activate the disk (or foot pedal if supplied);

1. The cutter vice closes	2. The head lowers until the cut is made (FCTA)	3. The head returns to start position (FCTI)	4. The cutter vice opens
			

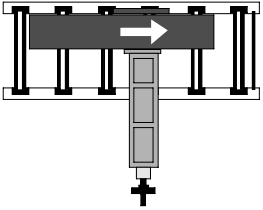In Automatic mode, after setting the cutting head stroke and the head downstroke speed on the control panel, position the vice 2÷3 mm from the material being processed and press the start button on the control panel to activate the disk (or foot pedal if supplied):

1. The cutter vice closes	2. The head lowers until the cut is made (FCTA)	3. The head returns to start position (FCTI)	4. The feed vice closes
			
5. The cutter vice opens	6. The cutting material is fed	7. The cutting vice closes	8. The feed vice opens and the cutting cycle starts up
			

## Machine specification

The anodised aluminium name plate is riveted on the side of the machine; the same data are reproduced on the declaration of conformity included with this use and maintenance manual.

*The Rock Solid Solution*

model		HYD-MECH							
air pressure		bar		oil pressure		bar			
data code		- - - - -							
1 PH	V		A		3 PH	V		A	




**N.B.** When communicating with the Technical Service department, the model, serial number and year of manufacture of the machine must be quoted.


## Technical Data

WORKING PRESSURE		
Max. working pressure for opening/closing vice	Bar	6
Air consumption for a complete cycle	Nl/min	5,74

**N.B.** The "air consumption" value refers to standard conditions (temperature 0° and pressure 1.013 bar, i.e. density  $1.3 \times 10^{-3}$  Kg/l) where 1 Kg/min. = 772 Nl/min.



ELECTROPUMP MOTOR					
Voltage (Volts)	Absorption (Amps)	Power (Kw)	rpm	Delivery rate lt/min	Head (mt.)
230	0,30	0,09	2.800	24	1,5
400	0,18	0,09	2.800	24	1,5
Conforming to CEI norms, publication: IEC 34 of 01/07/1985.					
IP 55.					
LUBRICANT/COOLANT FLUID AND OIL					
Lubricant/coolant fluid (oil concentration 5–6%)				capacità Lt.	105
Oil for transmission box				capacità Lt.	10
VICE					
Vice max. opening				mm	185
CUTTING CAPABILITY					
Model	Blade diameter				
0°	400	130	120	180 x 100	
45° ↗	400	115	100	120 x 100	
45° ↘	400	115	100	120 x 100	
60° ↘	400	115	90	90 x 90	
PACKED WEIGHT					
Wooden cage and pallet				Kg	250
Wooden pallet				Kg	100

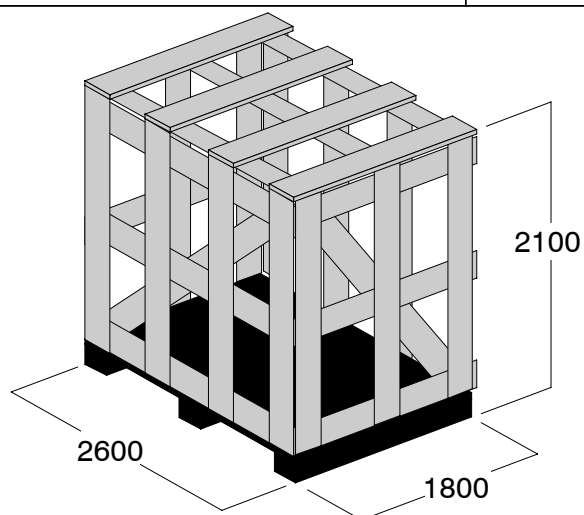

## Technical Data

### CUTTING SPEEDS

Speed 1/2	rpm	1400/2800
-----------	-----	-----------

### Disk blade (HSS type)

External disc diameter	mm	400
Internal hole diameter	mm	30
Blade thickness	mm	3,8

### RATED ELECTRICAL POWER

Head spindle motor	Kw	4,4
Feed step motor	Kw	0,44
Step head motor	Kw	0,048
Max installed power	Kw	4,888

### SPINDLE MOTOR

No.of poles	Current (Volts)	Absorption (Amps)	Power (Kw)	rpm
2	380	9,2	4,4	2890

Stator wound with enamelled copper wire, class H 200°C.

Class F insulation (limit temperature TL 155°C).


IP 54 protection rating (total against contact with live parts, water sprayed from all directions, with shaft oil seal).

Conforming to CEI norms, publication: IEC 34 of 01/07/1985.

## Dimensions

### MACHINE INSTALLED

Work table height	mm	1000
Weight	Kg	1060

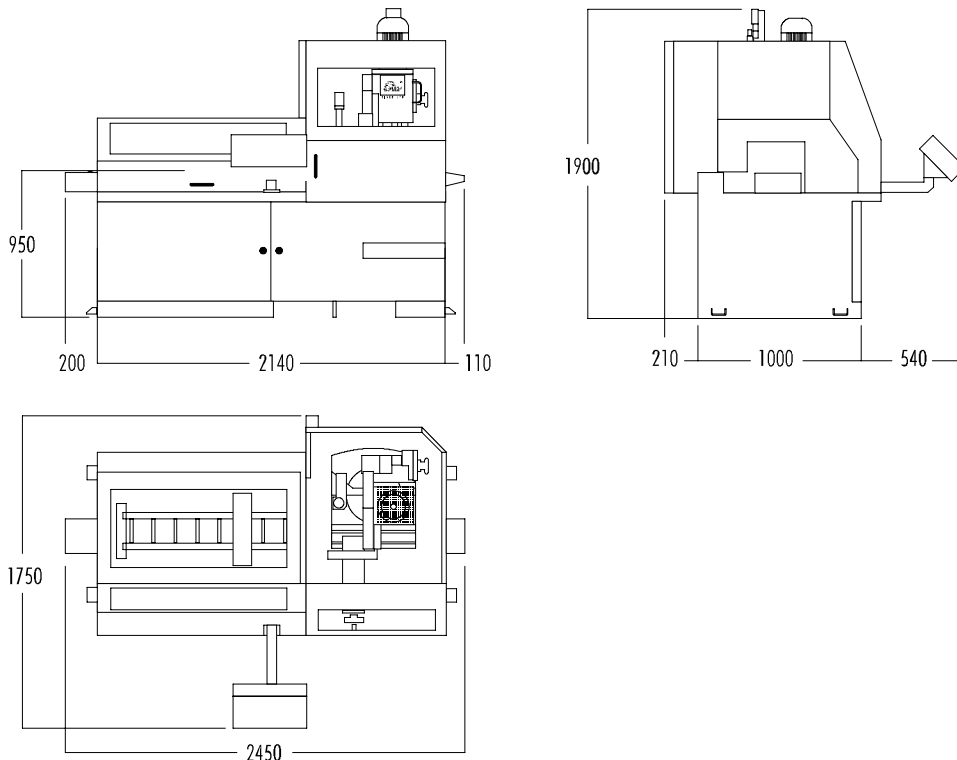

---


# Functional parts



2


## CNF 400 CNC model

In order for the user to move towards a full understanding of how the machine works, which is described in detail in the chapter 5, this chapter deals with the main units and their locations.

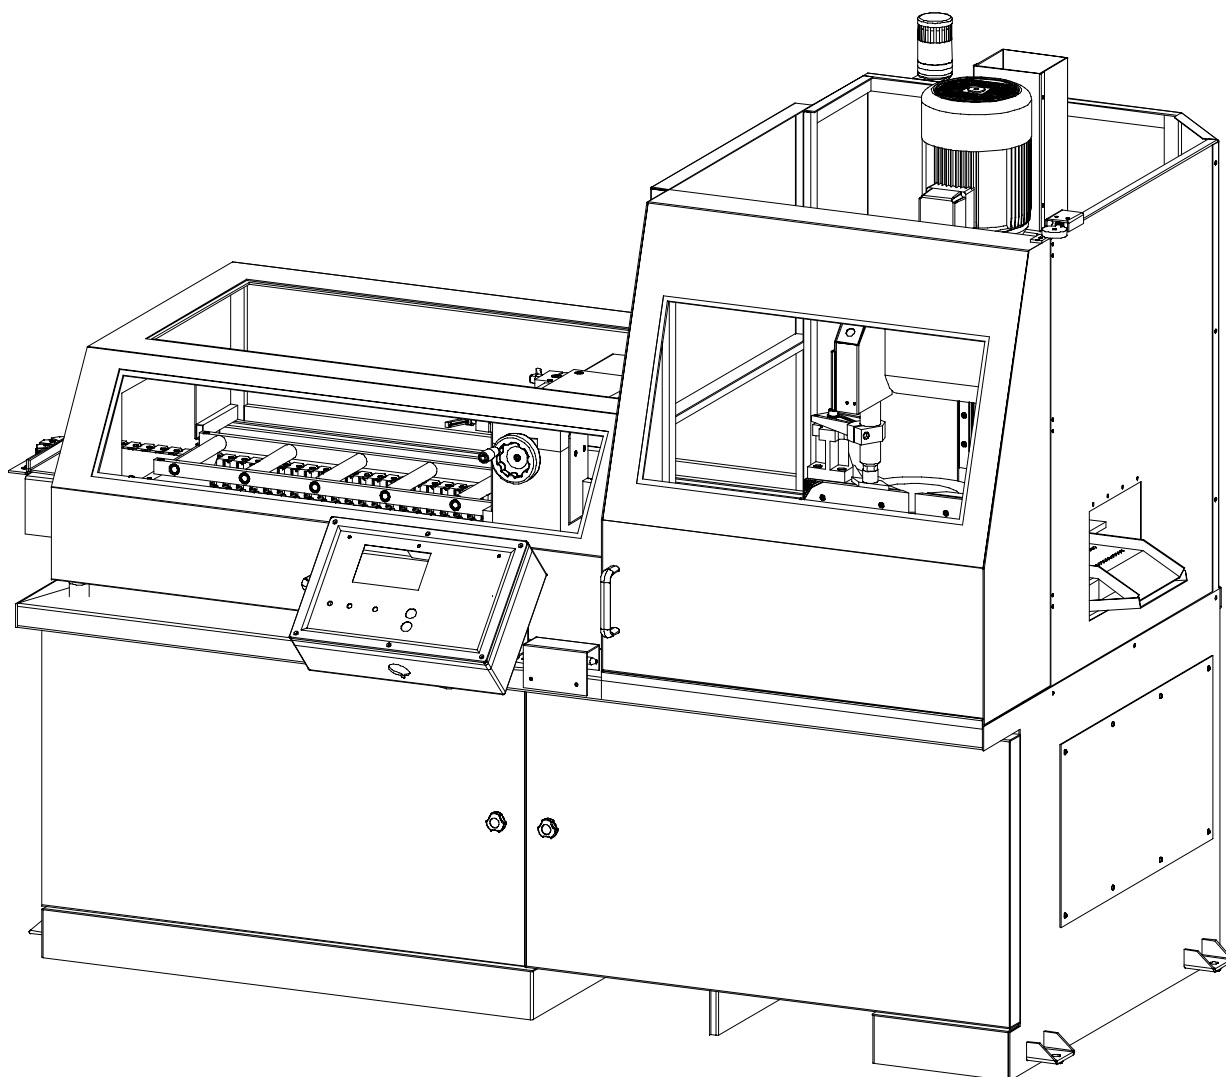


## Cutting head

The cutter head makes the cut. It is contained inside guards preventing accidental contact with the tool and moving parts. It is moved by an electro-mechanical cylinder (step motor), and runs on a twin linear guide with ball-bushing sliding blocks. This system makes the structure highly rigid, providing a better cutting finish with less vibration and noise.

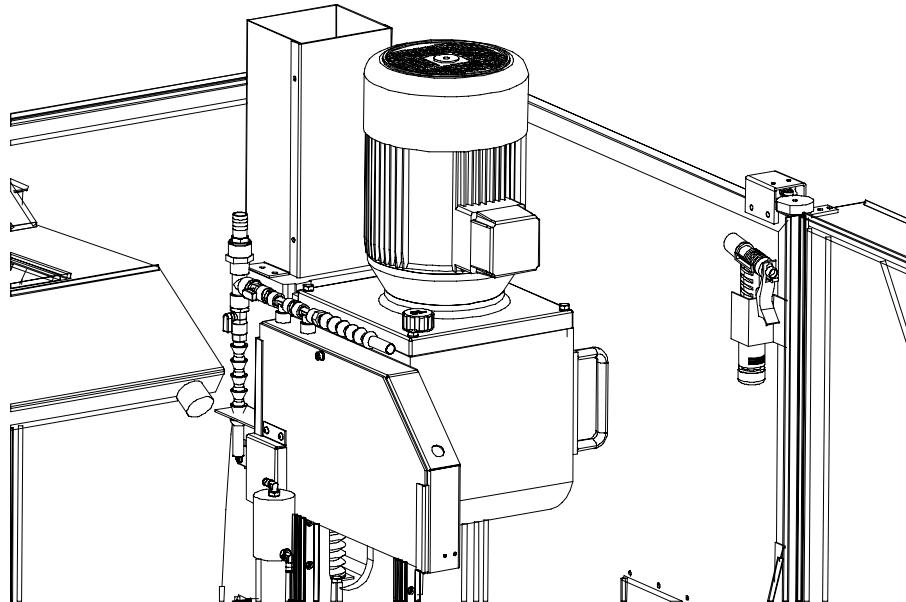

## Cutting vice


The vice is the unit that clamps the workpiece during cutting; it consists of a vice support, commonly known as a “lead nut” fixed to the work table on which a mobile jaw is mounted. The vice is operated manually by a handwheel and locked by a Pneumatic cylinder.

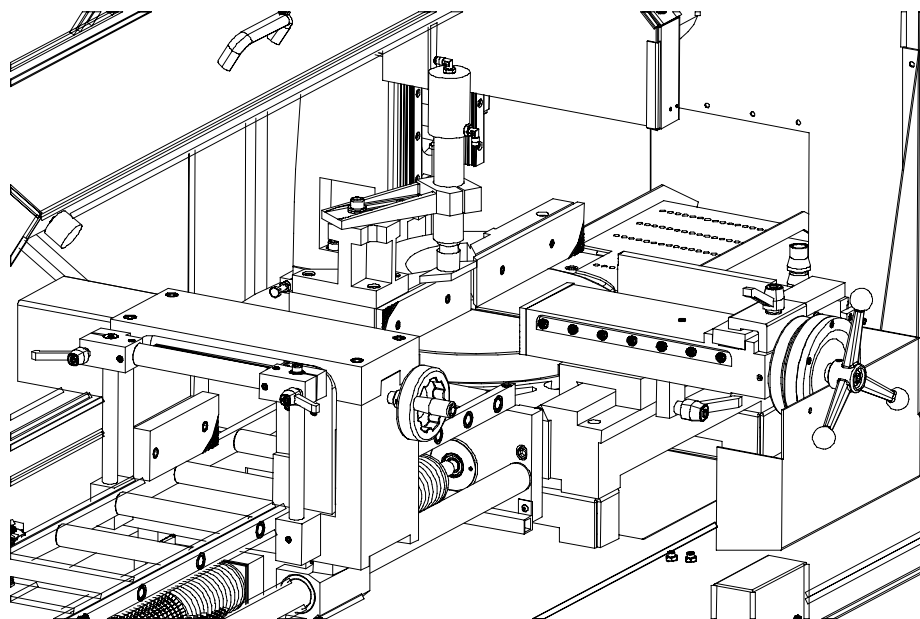

---


## Control Panel

The control panel has a protection rating of IP 54 and contains the electronic equipment. Access to the control panel is protected by a safety panel mounted on hinges and fastened with screws, specially designed to prevent tampering. The control panel swivels on two articulated joints so that it can be positioned by the operator for greater ease—of—use and safety.

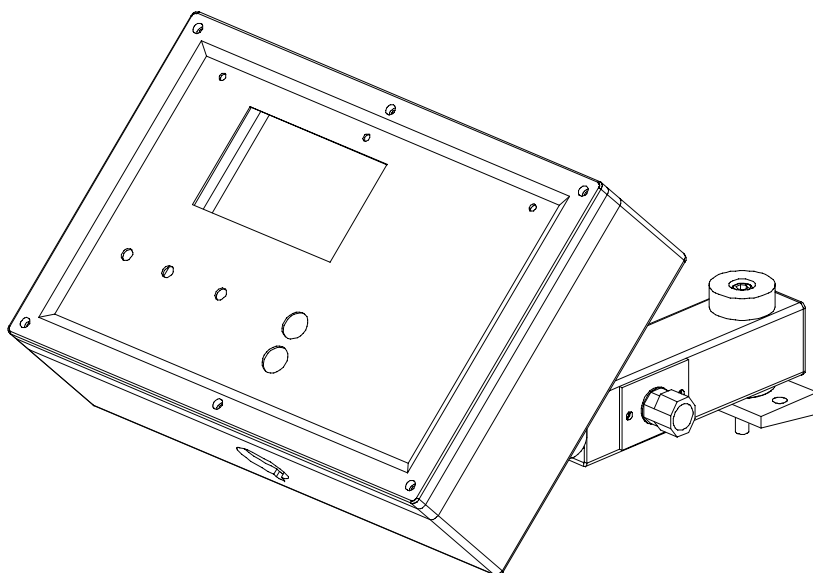


## Feeder

The material, locked by means of the pneumatic vice, is delivered by a carriage which conveys it along ground guides. The numeric check controls, with great precision, the step motor of the infeed carriage, enabling the operator to set, on the same bar, 32 batches of pieces to be cut, each with different amounts and lengths. The material, locked by means of the pneumatic vice, is delivered by a carriage which conveys it along ground guides. The numeric check controls, with great precision, the step motor of the infeed carriage, enabling the operator to set, on the same bar, 32 batches of pieces to be cut, each with different amounts and lengths.

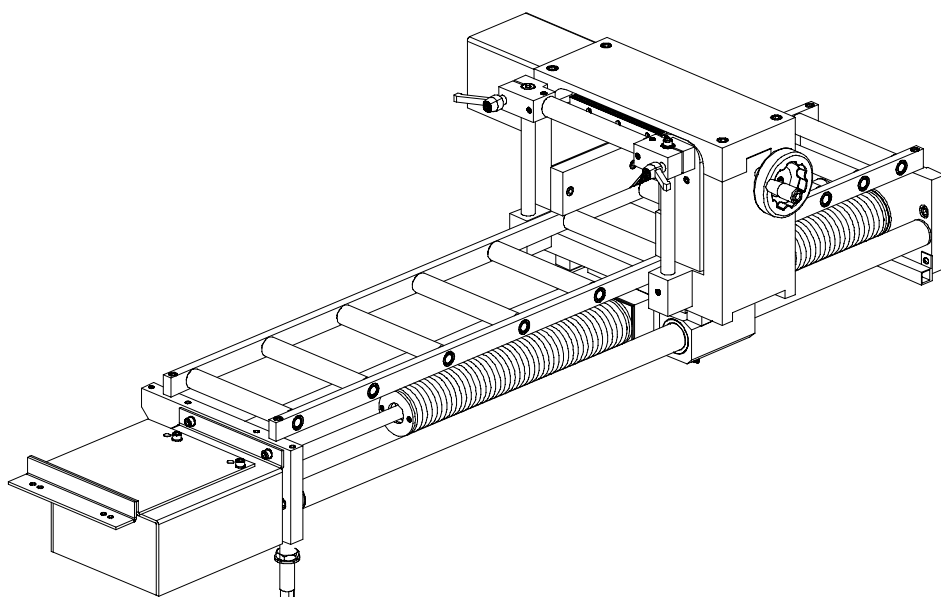


## Base

This unit features a large coolant collection surface which conveys the coolant to the rear tank via the tank cover, and a swarf collection drawer. An electric pump is housed inside the tank which draws the clean fluid from the filter system.

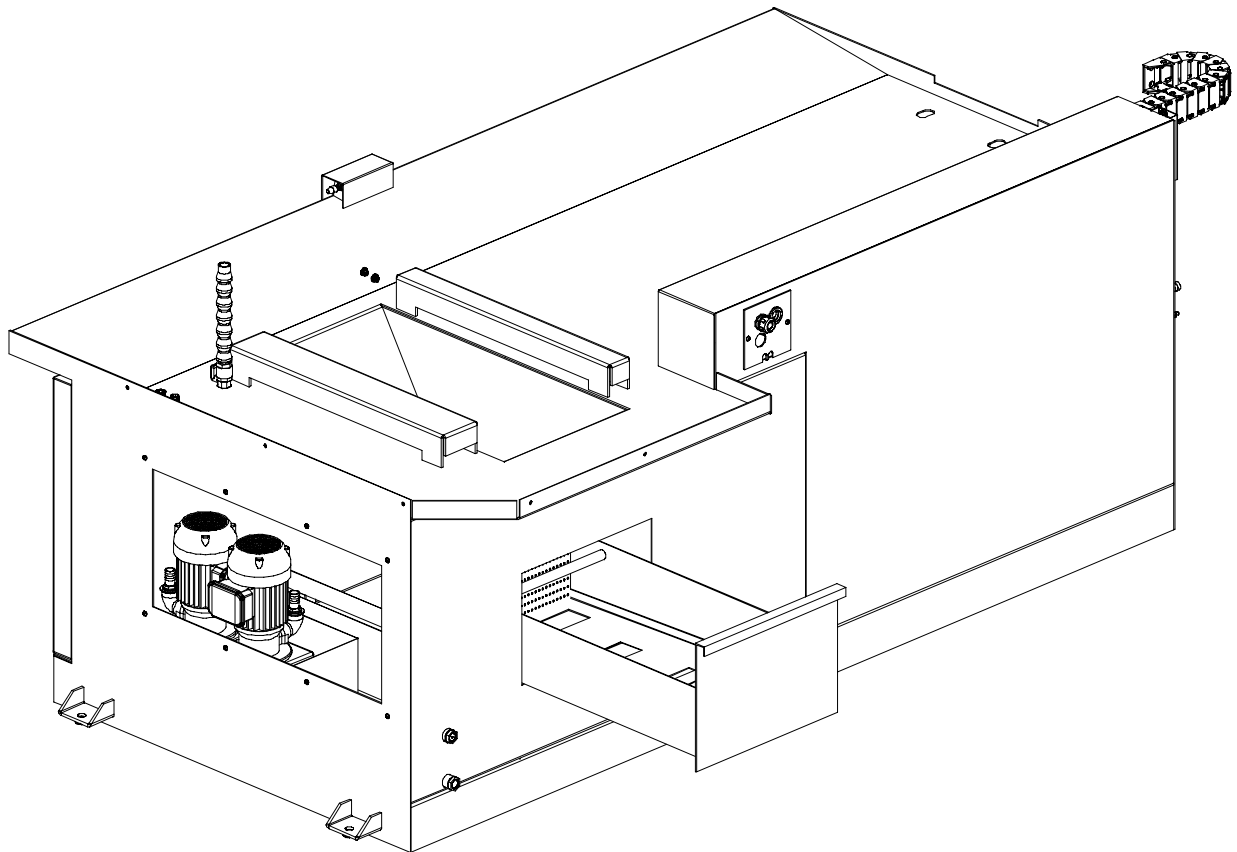

---

# Safety and accident prevention

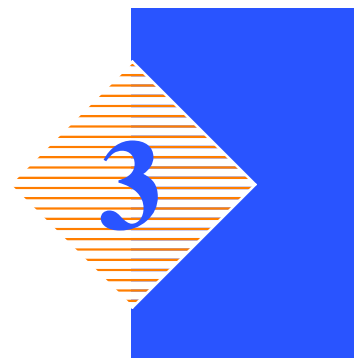

The **CNF 400 CNC** has been designed and produced in accordance with European standards. For the correct use of the machine we recommend that the instructions contained in this chapter are carefully followed.

## Use of the machine

The **CNF 400 CNC** circular saw is designed to cut exclusively for cutting aluminium and light alloy profiles and solid metal sections. Other types of material and machining are not compatible with the specific characteristics of the saw. The employer is responsible for instructing the personnel who, in turn, are obliged to inform the operator of any accident risks, safety devices, noise emission and accident prevention regulations provided for by international standards and national laws regarding the use of the machine. The operator must be perfectly aware of the position and function of all the machine's controls. The instructions, warnings and accident prevention standards in this manual must be respected without question by all those concerned. The following definitions are those provided for by **EEC MACHINES DIRECTIVE 98/37/CE** :

- “Danger zone”: any zone in and/or around a machine in which the presence of a person constitutes a risk for the safety and health of that person.
- “Person exposed”: any person finding himself either completely or partly in a danger zone.
- “Operator”: the person or persons given the responsibility of installing, operating, adjusting, maintaining, cleaning, repairing or transporting the machine.

### Attention

The manufacturer declines any responsibility whatsoever, either civil or criminal, should there be unauthorised interference or replacement of one or more parts or assemblies on the machine, or if accessories, tools and consumable materials are used that are different from those recommended by the manufacturer itself or if the machine is employed in a plant system and its proper function is thereby altered.

## General recommendations

### **LIGHTING**

Insufficient lighting for the types of operation envisaged could constitute a safety hazard for the persons concerned. For this reason, the machine user must provide lighting in the working area sufficient to eliminate all shadowy areas while also avoiding any blinding light concentrations. (Reference standard ISO 8995–89 “Lighting in work environments”).

### **CONNECTIONS**


Check that the power supply cables and pneumatic feed systems comply with the maximum machine absorption values listed in the “Machine Specification” tables; replace if necessary.

## **EARTHING**


The installation of the earthing system must comply with the requirements set out in IEC STANDARD 204.

## **OPERATOR POSITION**

The position of the operator controlling machine operations must be as shown in the diagram below.

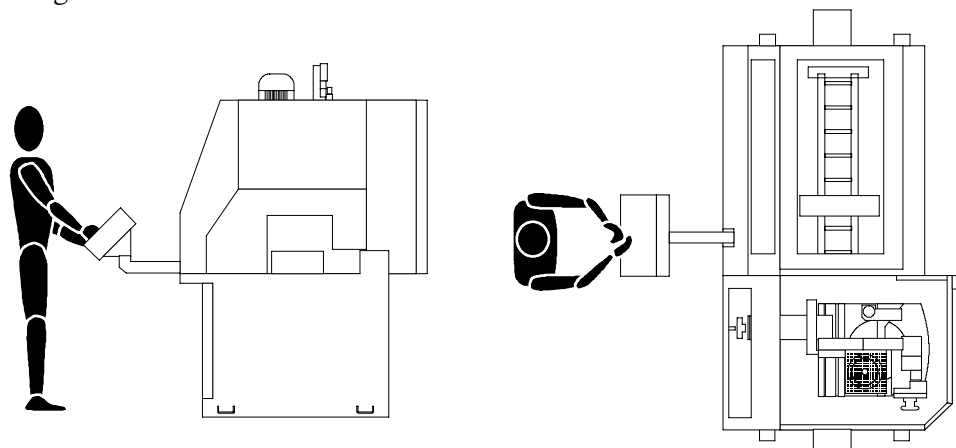

## **Recommendations to the operator**

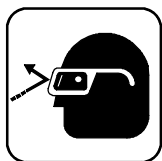

Always wear proper goggles or protective glasses.



Do not use the machine without the guards in position. Replace the polycarbonate windows, if subject to corrosion.



Do not allow hands or arms to encroach on the cutting zone while the machine is in operation.



Do not wear oversize clothing with long sleeves, oversize gloves, bracelets, necklaces or any other object that may become entangled in the machine during working; long hair must be tied back and bunched.




Always disconnect the power supply to the machine before carrying out any maintenance work whatsoever, including in the case of abnormal operation of the machine.



Before starting cutting operations, support the material at both ends of the machine using the support arm – standard, or OPTIONAL accessories such as the feed and discharge roller tables shown in the diagram below.



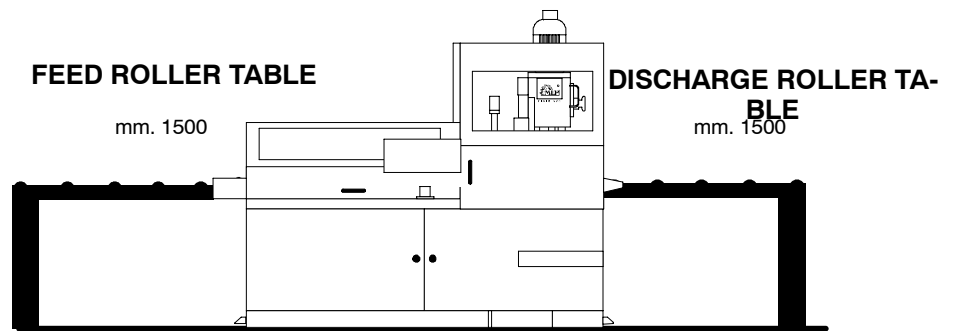

Any maintenance work on the hydraulic or pneumatic systems must be carried out only after the pressure in the system has been released.



The operator **MUST NOT** perform any risky operations or those not required for the machining in course (e.g. remove swarf or metal shavings from the machine while cutting).



Remove equipment, tools or any other objects from the cutting zone; always keep the working area as clean as possible.



Do not use the machine for cutting pieces which exceed the cutting capacity described in the technical specifications or are less than 5 mm



Before starting any cutting operations, ensure that the workpiece is securely held in the vice and the machine has been set correctly. A number of examples of how to clamp the different profiles correctly in our machines are shown below.



Never move the machine while it is cutting.



Do not use blades of different sizes to those recommended in the machine's specifications.



When cutting very short pieces, make sure that they are not dragged behind the support shoulder, where they could jam in the blade.



When using the pneumatic vice (version MA) check that the jaws actually move right up to and effectively block the piece, as the maximum travel is only 8 mm, and check that the clamping pressure is correct.



When working on the bandsaw, only wear gloves when handling materials and tool change or adjustment operations. Only carry out one operation at a time and do not hold more than one item or operate more than one device simultaneously. Keep hands as clean as possible.



Warning: if the blade jams in the cut, press the emergency stop pushbutton immediately. If this does not free the blade, slowly release the vice, remove the piece and check that the blade or its teeth for damage, if need be replace the blade.



Before carrying out any repair works on the machine, consult the Technical Service; this can also be done through an agency in the country in which the machine is being used.

## Machine safety devices

This use and maintenance manual is not intended as purely a guide for the use of the machine in a strictly productive environment, it is instead an instrument providing information on how to use the machine correctly and safely. The following standards are those specified by the EEC Committee in the directives regarding safety of machinery, health and safety at work, personal protection and safeguarding of the environment. These standards have been applied to the **CNF 400 CNC** band saw.

### Reference standards

#### **MACHINE SAFETY**

- EEC MACHINES DIRECTIVE 98/37/CE ;
- EEC Directive No. 73/23 known as “Low voltage directive”.

#### **HEALTH AND SAFETY AT WORK**

- EEC Directive No. 80/1107; 83/477; 86/188; 88/188; 88/642 for the protection of workers against risks caused by exposure to physical, chemical and biological agents during working;
- EEC Directive No. 89/391 and Special EEC Directives No. 89/654 and No. 89/655 for improvements in health and safety at work;
- EEC Directive No. 90/394 for the protection of workers against risks deriving from exposure at work to carcinogenic substances;
- EEC Directive No. 77/576 and No. 79/640 on safety signs at work.

#### **PERSONAL PROTECTION**


- EEC Directive No. 89/656 and No. 89/686 on the use of personal protection devices.

#### **ENVIRONMENTAL PROTECTION**

- EEC Directive No. 75/442 on waste disposal.
- EEC Directive No. 75/439 on the disposal of used oil.
- Directive 2002/95/EC on the restriction of the use of certain hazardous substances in electrical and electronic equipment (RoHS).

## Protection against accidental contact with the blade

1. Metal disc cover fixed to the cutting head;
2. mobile protection of the disc attached to the guard, in order to guarantee cover of the blade and to leave only the part of the disc used for cutting free as required by President's Decree 547/55 article 108;
3. vice with double-blocking anti-burr device to securely grip the workpiece;
4. the cutting and infeed vice is controlled by pneumatic devices, with maximum 8 mm stroke; the jaw which clamps the piece must be aligned to the part to be processed at a distance of  $2 \div 3$  mm;
5. Access to the cutting zone is bounded by a door fitted with a timed lock, which allows it to be opened only 5 or 10 seconds after the processing cycle has stopped;
6. the cutting material supply is protected by a sheet-metal casing, which can be opened, that is fitted with a Perspex window to check the cutting operations.

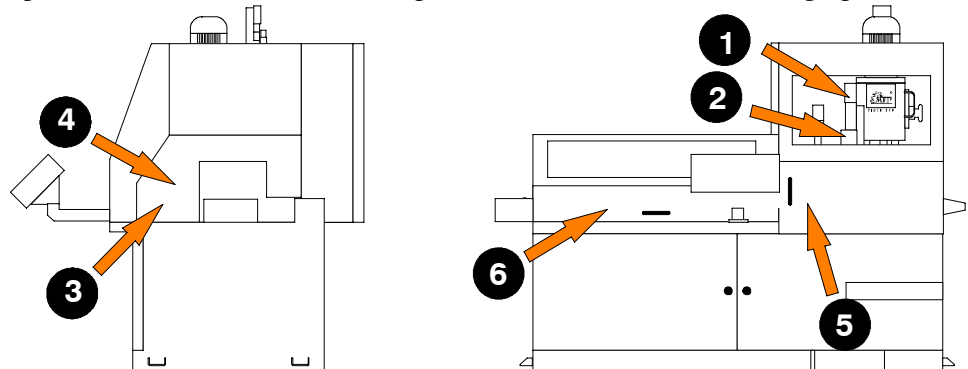

## Electrical equipment

In accordance with Italian standard CEI 60204–1, April 1998, derived from European Standard EN 60204–1 publication IEC 204–1, 1997:

- 24 Vac Control voltage for actuators, in accordance with chapter 6 of European Standard “Control and indication circuits” paragraph 2 “Control Circuits” sub-section 1 “Preferential voltage values for control circuits”;
- plant protected against short circuits by quick blowing fuses and earthing of all work and accidental contact parts;
- Protection from accidental start-up by a minimum voltage relay in the case of power failure.

## Emergency devices


In accordance with Standard CEI 204–1:

- **Chapter 5 Section 6 Sub-section 1 “Emergency stop device”:** “the emergency stop device immediately stops all the dangerous and other functions of the machine”.
- **Chapter 6 Section 2 Subsection 4 point 7 “Safety guards”:** “the removal of safety guards protecting dangerous parts or zones of the machine causes the machine to shut down immediately. When the guards are returned to their original position the machine must be reset in order to resume work”.

### ...Emergency devices applicable to the CNF 400 CNC:

1. **Emergency stop:** a non-return mushroom-head pushbutton, colour red on yellow background, is located on the control panel of the machine. To release the pushbutton, the actuator must be rotated  $45^\circ$ . After the emergency situation has been resolved, the machine must be reset.

2. **Thermal–magnetic circuit breaker:** this device incorporates two power failure protection systems. In fact, in the event of a power failure, it disconnects all the electrical components, causing the machine to shut down immediately and prevents it from automatically starting up again when power is restored. The device also resets the thermal relay fitted to protect against current overloads.
3. **Head casing safety switch:** to access the cutting zone it is necessary to open the front door, pressing the relevant button on the control console. This device cannot be removed and has timed opening; therefore, it can only be opened 5 or 10 seconds after the processing cycle has stopped.
4. **Feeder casing safety switch:** to access the cutting material feeder, it is necessary to open the casing, with a safety limit switch that stops all machine operations that must be reset to continue processing.

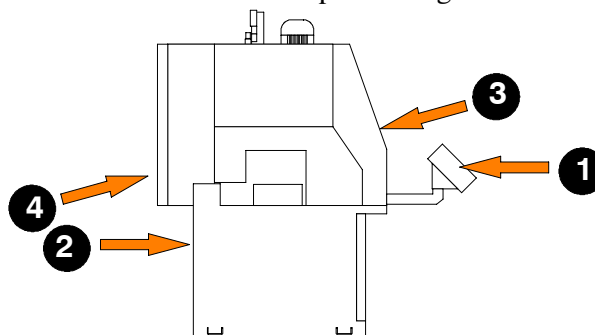

## Noise level of the machine

Noise can cause hearing damage and represents one of the problems faced by many countries who adopt their own standards. In accordance with the **EEC MACHINES DIRECTIVE 98/37/CE**, we are listing the standards that specify noise levels for machine tools. This chapter also reports the noise levels produced by the **CNF 400 CNC** during its various operating phases and the methods used for measuring these levels. The Italian standard governing this aspect is D.M.n.277/91 drawn from EEC Directives 80/1107, 82/605, 83/477, 86/188, 88/642, UNI EN ISO 4871 (1998).

### Noise level measurement

Noise levels are measured using an instrument known as an Integrator noise–meter which registers the equivalent continuous acoustic pressure level at the work station. The damage caused by noise depends on three parameters: level, frequency and duration. The equivalent level concept  $Leq$  combines the three parameters and supplies just one indication. The  $Leq$  is based on the principle of equal energy, and represents the continuous stationary level containing the same amount of energy, expressed in dBA, as that actually fluctuating over the same period of time. This calculation is made automatically by the integrator noise–meter. The measurements are taken every 60 seconds, in order to obtain a stabilised value. The reading stays on the display for a sufficient time to enable a reading to be taken by the operator. Measurements are taken by holding the instrument at approximately 1 metre from the machine at a height of 1.60 metres above the platform at the operator's work station. Two measurements are taken: the first while the machine operates without cutting anything, the second while cutting in manual mode.

## Noise level values

Identification		
Machine type	Band saw for metal applications	
Model	CNF 400 CNC	
Reference standard	ISO 3746	
Results		
Test 1st	Description	Aluminum cutting – thickness pipe 60x40 mm Disc blade HSS 400 x 3,8 x 30
	Results	Mean sound level (Leq) 67,7 dB (A) Environmental correction (K) 0,6 dB(A) Peak sound power (Lw) 85,0 dB(A)
Test 2nd	Descripiron	Aluminum cutting – thickness pipe ø 80 mm Disc blade HSS 400 x 3,8 x 30
	Results	Mean sound level (Leq) 65,2 dB(A) Environmental correction (K) 0,6 dB(A) Peak sound power (Lw) 82,6 dB(A)
Test 3rd	Description	Aluminum cutting – solid pipe 50x40 mm Disc blade HSS – 400 x 3,8 x 30
	Results	Mean sound level (Leq) 68,8 dB(A) Environmental correction (K) 0,6 dB(A) Peak sound power (Lw) 86,2 dB(A)

## Vibration emission

This sawing machine complies with the norms EN1299 and EN1033, as the machine vibration emission on the devices controlled by the operator does not exceed the threshold of  $2.5 \text{ m/s}^2$

## Electromagnetic compatibility

As from 1 January 1996 all electrical and electronic appliances bearing the CE marking that are sold on the European market must conform to Directive 89/336/EEC and 70/23/CEE and 98/37/CEE. The prescriptions regard two specific aspects in particular:

1. “EMISSIONS: during its operation, the appliance or system must not emit spurious electromagnetic signals of such magnitude as to contaminate the surrounding electromagnetic environment beyond clearly prescribed limits”;
2. “IMMUNITY: the appliance or system must be able to operate correctly even when it is placed in an electromagnetic environment that is contaminated by disturbances of defined magnitude”.

The following text contains a list of the applied standards and the results of the electromagnetic compatibility testing of machine model **CNF 400 CNC**; Test report no. 120101.

### Emissions

- CEI EN 61000-6-4 (2002) Electromagnetic Compatibility (EMC) - Generic standard regarding emissions. Part 6-4: Industrial Environment.
- EN 55011 (1999) Industrial, scientific, and medical radio frequency appliances (ISM). Characteristics of radio frequency disturbance - Limits and methods of measurement.
- EN 55014-1 (2002) Electromagnetic Compatibility - Prescriptions for domestic appliances, electric power tools, and similar equipment. Part 1: Standard Emission in relation to product family.

CONDUCTED EMISSIONS				
Gate A	Freq. (MHz)	Q – peak limit (dBuV)	Mean value limit (dBuV)	Result
A.C. power supply input	0.15 – 0.5	79 – 73 (linear reduction with log of frequency)	66 – 60 (linear reduction with log of frequency)	Complies
	0.5 – 5	73	60	
	5 – 30	73	60	

CONDUCTED EMISSIONS – ANALYSIS OF INTERMITTENT DISTURBANCES	
Gate	Result
A.C. power supply input	Not applicable

IRRADIATED EMISSIONS			
Gate	Freq. (MHz)	Q – peak limit (10 m) (dBuV/m)	Result
Enclosure	30 – 230	40	Complies
	230 – 1000	47	

### Immunity

- CEI EN 61000-6-2 (2000) Electromagnetic Compatibility (EMC) - Generic standard on immunity. Part 6-2: Industrial Environment.
- EN 61000-4-2 + A1 (1996-1999) Electromagnetic Compatibility (EMC) - Part 4: Test and measurement techniques - Section 2: Electrostatic discharge immunity tests - Basic publication.
- EN 61000-4-3 Electromagnetic Compatibility (EMC) - Part 4: Test and measurement techniques - Section 3: Radiated, radio- frequency, electromagnetic field immunity test.
- EN 61000-4-4 (1996) Electromagnetic Compatibility (EMC) - Part 4: Test and measurement techniques - Section 4: Fast transients/bursts immunity tests - Basic publication.
- EN 61000-4-5 (1997) Electromagnetic Compatibility (EMC) - Part 4: Test and measurement techniques - Section 5: Surge immunity test.
- EN 61000-4-6 (1995) Electromagnetic Compatibility (EMC) - Part 4: Test and measurement techniques - Section 6: Immunity to conducted interference, induced by radio frequency fields.
- EN 61000-4-11 (1977) Electromagnetic Compatibility (EMC) - Part 4: Test and measurement techniques - Section 11: Voltage dips, short interruptions and voltage variations immunity tests.

IMMUNITY TO ELECTROSTATIC DISCHARGES			
Gate	Test levels	Evaluation criterion	Result
Enclosure	contact 4 kV steel plate 4 kV in air 8 kV	B	Complies

IMMUNITY TO VOLTAGE (BURSTS)			
Gate	Test levels	Evaluation criterion	Result
A.C. power supply input	2 kV	B	Complies

IMMUNITY TO CONDUCTED ELECTROMAGNETIC FIELDS			
Gate	Test levels	Evaluation criterion	Result
A.C. power supply input	10V	A	Complies

IMMUNITY TO IRRADIATED ELECTROMAGNETIC FIELDS			
Gate	Test levels	Evaluation criterion	Result
Enclosure	10 V/m	A	Complies


# Machine installation

4

## Packaging and storage

Hyd–Mech use packing materials that guarantee the integrity and protection of the machine during its transport to the customer.

The type of packing differs according to the size, weight and destination. Therefore the customer will receive the machine in one of two following ways:

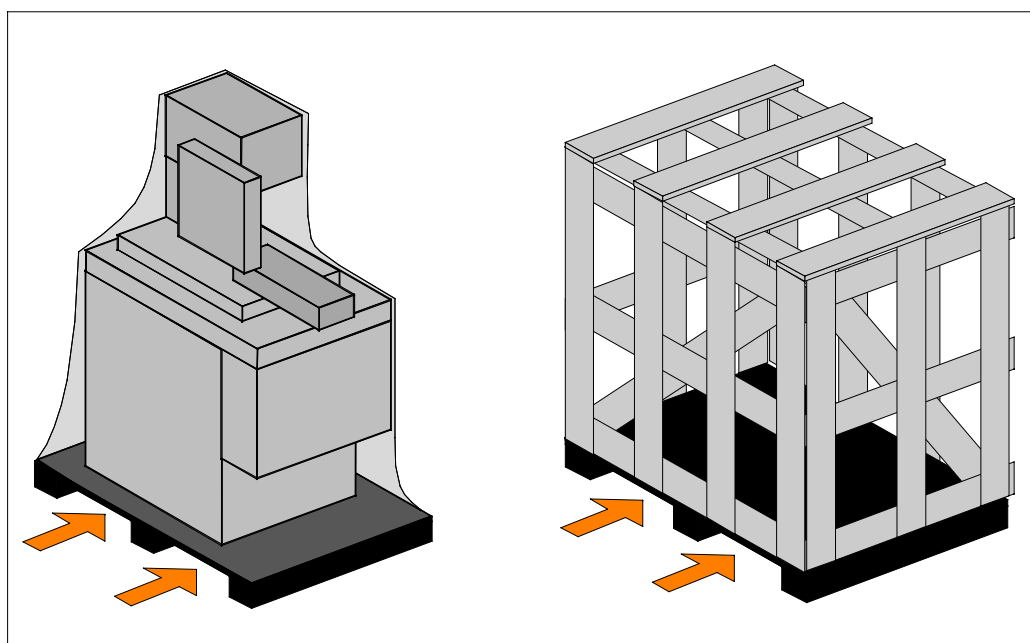

1. on a pallet with straps and heat–shrink plastic;
2. on a pallet with straps, heat–shrink plastic and a wooden crate.

### Warning


In both cases, for correct balancing the machine must be handled using a fork–lift truck, inserting the tines at the points indicated by the arrows, using the reference marks on the crate itself.

### Attention


Before carrying out lifting operations, make sure that the weight of the machine, as indicated on the crating or other packaging, is within the forklift truck load limit.

**Attention**

Do not handle the packed machine using slings.

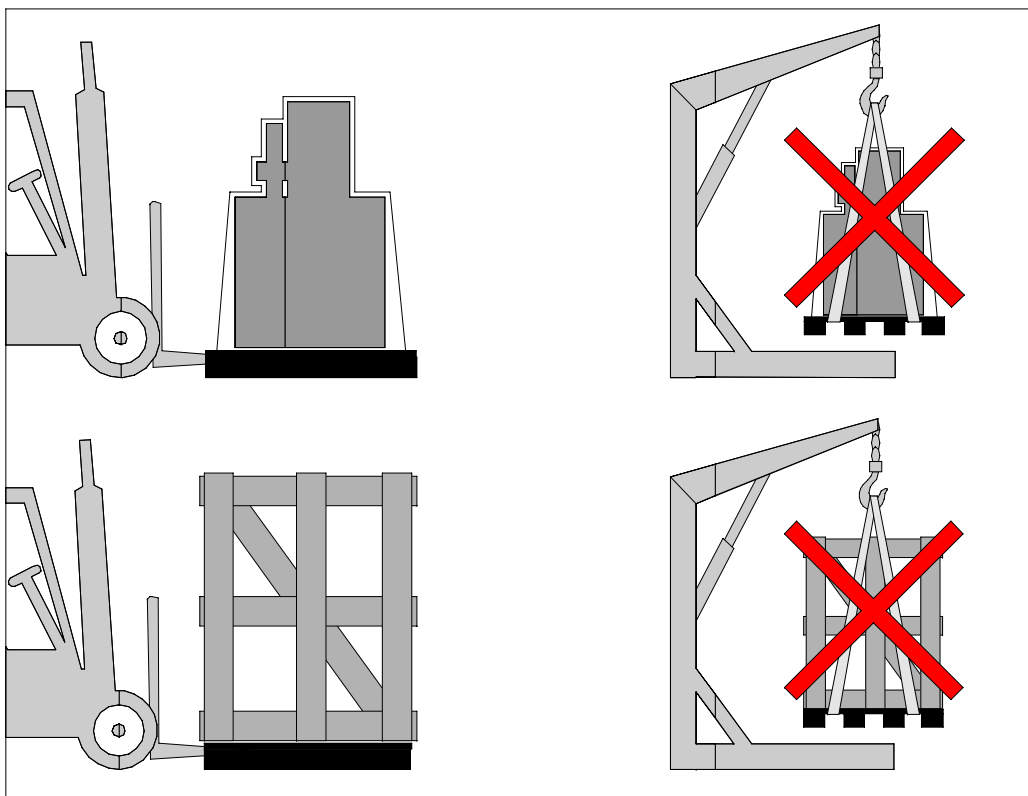**Attention**

When storing, machines palletized and shrink-wrapped must not be stacked two high, and machines palletized and crated must not be stacked three high.

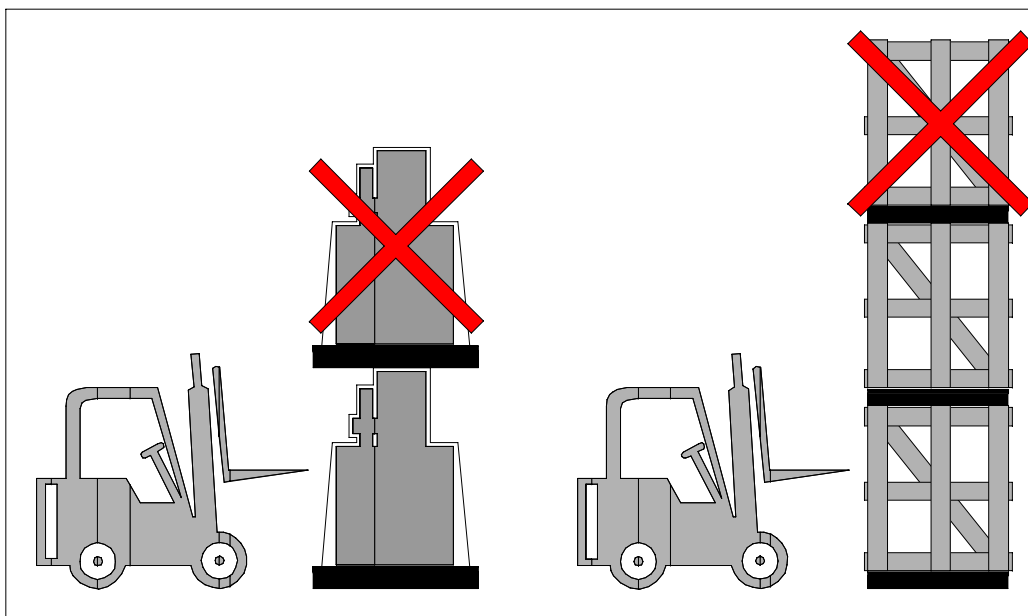


To install the machine, first remove the packing, paying particular attention not to cut any electric wires or hydraulic hoses; if necessary use pliers, a hammer and a cutter.


Open crate in the illustrated order:



1. remove nails and lift the top of the cage;
2. remove nails and lower walls;

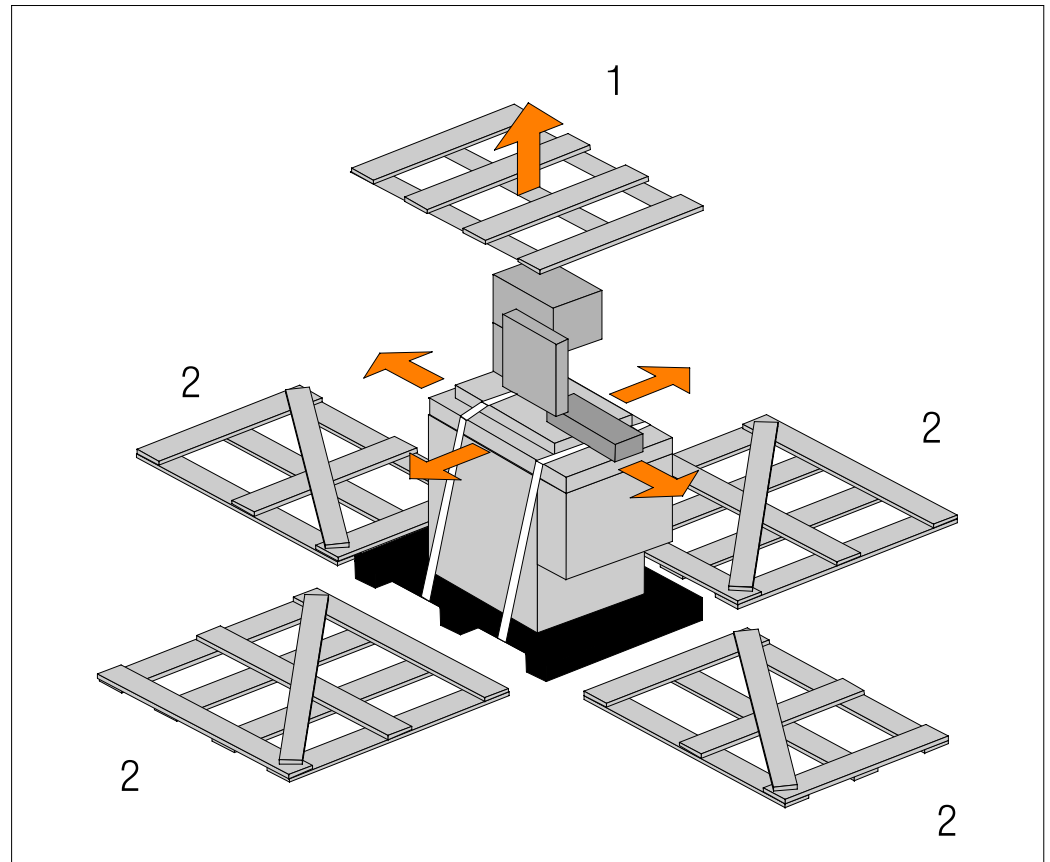


3. remove heat-shrink covering;
4. remove the straps;
5. remove nails from pallet securing planks and remove planks;
6. remove the front panel and insert fork tines.

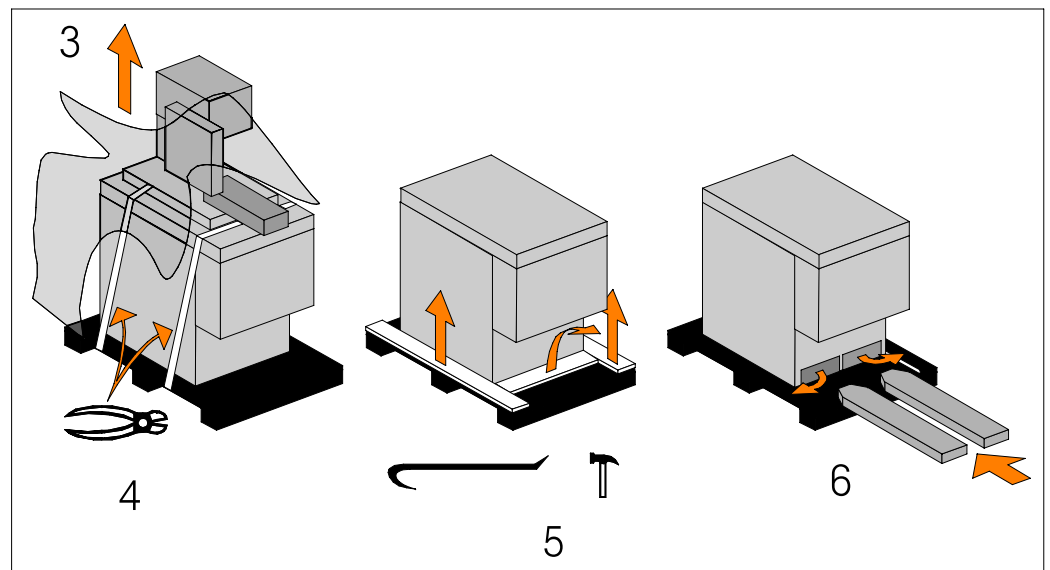

To locate the machine in the workplace, **the machine dimensions** and necessary operator working space, including **the spaces laid down in safety standards, must be taken into account.**

## Anchoring the machine

The base of the machine is anchored to the floor by two permanent studs located on the sides of the base. The studs are screwed into nuts previously sunk into the concrete, and tightened from above with lock nuts. The schematic specifications set out in Chapter 1 should be taken into account when positioning the machine.

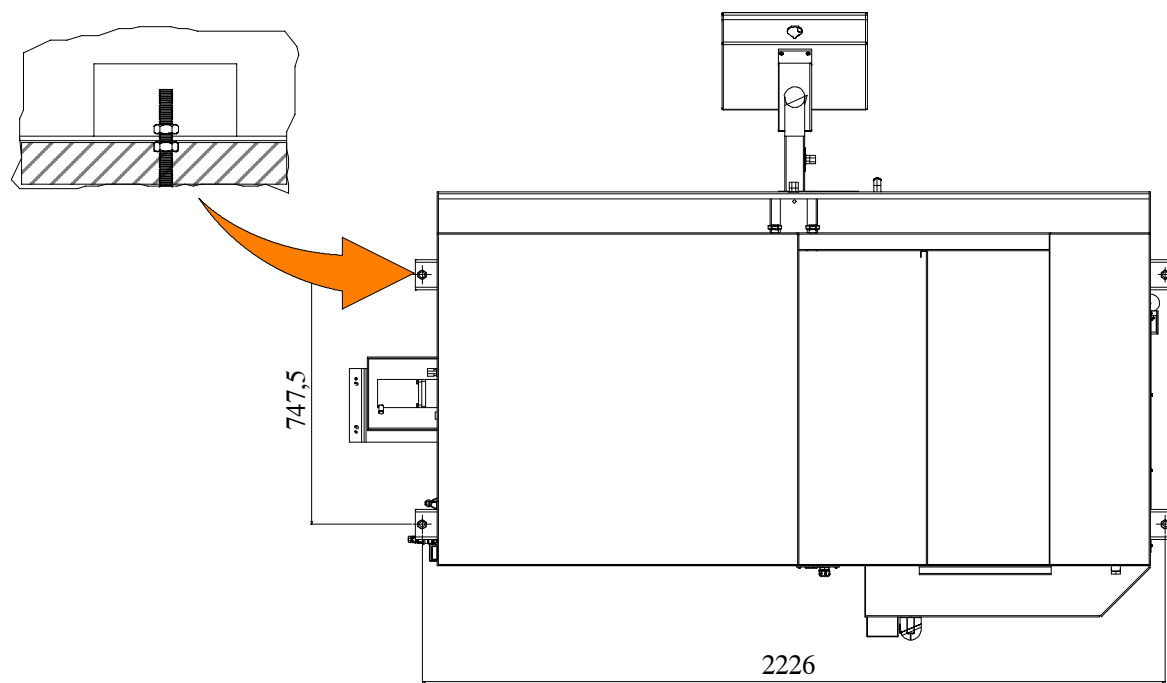

## Minimum requirements

For the machine to function correctly, the room in which it is to be installed must satisfy the following requirements:

- power supply voltage/frequency: refer to the values on the rating plate;
- working pressure not less than 6 Bar and not greater than 8 Bar;
- temperature of machine location: from -10 to +50° C;
- relative humidity: not more than 90%;
- lighting: not less than 500 Lux.

### Warning

The machine is already protected against voltage variations, but will only run trouble-free if the variations do not exceed  $\pm 10\%$ .

## Check list

Before starting installation, check that all the accessories, whether standard or optional, supplied with the machine are present. The basic version of the **CNF 400 CNC** is supplied complete with:

CHARACTERISTICS	Di serie	Optional
Multi-microprocessor with two controlled axes that permits programming 32 batches of workpieces with different lengths and quantities on the same bar	✓	
Pulley and V-belt transmission system	✓	

CHARACTERISTICS	Di serie	Optional
Fully encased model to provide operator safety, sound insulation and the possibility of working with large quantities of liquid	✓	
HM disk ø 400 x 32 x 3.6 for aluminium and light alloys	✓	
Cabinet for electric and electronic equipment with fully identifiable wiring, door – locking switch with padlockable device, emergency device, motor overload cut – out, minimum voltage coil and protection against a missing phase	✓	
Activation and control systems protected by input and output electric and electronic devices	✓	
Low tension control panel: softkey polyester keypad with thermo – moulded touch sensitive buttons and acoustic signal when the machine is started	✓	
48 character x 16 line display showing technical parameters such as: number of cuts programmed and executed, blade thickness, single forward movement measure, cutting time, ammeter, display of diagnostic messages (approx. 80) and warnings in the language chosen	✓	
Four controls to program the cutting head stroke limits, according to the dimensions of the bars to be cut	✓	
Programming and control console with LCD display comprehensive of self – diagnosis messages	✓	
Two – speed blade rotation 1400/2800 rpm	✓	
Double pneumatic locking vice	✓	
Acoustic and flashing light signal in case of machine stop	✓	
Infeed unit with step motor; screw/nut with ball bushing (length 1000 mm)	✓	
Swing feeder vice to deliver even deformed bars	✓	
Coolant tank obtained in the pedestal	✓	
Chip conveyor preset for suction system (optional)	✓	
Electric pump to lubricate and cool the disk	✓	
Blade cleaning brush	✓	
Upright pneumatic vice	✓	
Cutting head moving on twin linear guide with pre – loaded double ball – bushing sliding blocks	✓	
Head feeding with pneumatic cylinder with coaxial hydraulic brake for the highest cutting stiffness	✓	
Rotation pin with radial bearing to guarantee accuracy and rotation stability	✓	
Machine set for handling with pallet truck	✓	
Keys, user manual and manual for ordering spare parts in the language used	✓	
Turbo 2500 aspirator		✓
Roller plane adapter, unloading side, with support		✓
GSM module for SMS sending*		✓
Double suction kit*		✓
Aspirator electric connection*		✓
Additional pedal control with emergency device*		✓
Set of comb jaws max. 70x70 mm to reduce scrap (max. 160), automatic cut only 0°, 45° and 60° on the left*		✓
Presetting for CB6001*		✓
Minimal lubrication system		✓
Emulsifiable oil 5 l		✓
Slide bar loader for high production (CB6001)*		✓

\*ACCESSORIES AVAILABLE ON REQUEST

Accessory kit is placed before the packaging inside the machine; it contains the following items:


- 3, 4, 5, 6, 8 and 10 mm Allen keys;
- open 19 mm wrench;
- this Use and Maintenance Manual.

## Connection to the compressed air supply

To ensure perfect operation and a long service life, it is recommended that the machine is connected to a compressed air system having the characteristics reported in the diagram below.

### KEY

- 1 - DOWN PIPE
- 2 - CONDENSATE COLLECTOR
- 3 - DRAIN COCK
- 4 - AIR FILTER
- 5 - DRAIN COCK
- 6 - CONNECTING HOSE

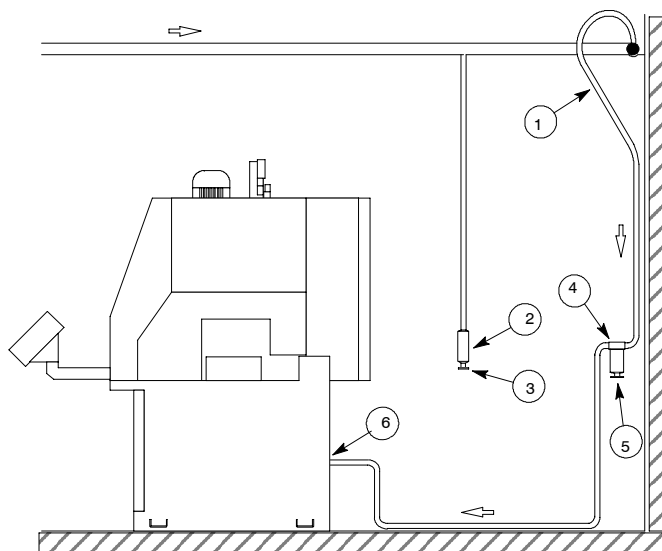


## Connection to the power supply


Before connecting the machine to the power supply, check that the socket is not connected in series with other machines. This requirement is fundamental for the good operation of the machine. To connect the machine to the power supply, proceed as follows:

- connect the power supply cable of the machine to a plug which matches the socket to be used. (EN 60204-1; par. 5.3.2).

CONNECTION FOR "5-CORE" WIRE SYSTEMS WITH NEUTRAL

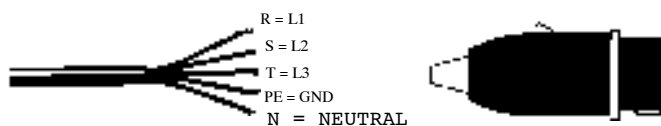

 CONNECTION FOR "4-CORE" WIRE SYSTEMS WITH NEUTRAL




### Attention

When using systems with a neutral wire, special care must be taken when connecting the **blue** neutral wire, in that if it is connected to a phase wire it will discharge the **phase voltage** to the equipment connected for **voltage: phase-neutral**.


- ▶ Insert the plug in the socket, ensuring that the mains voltage is the same as that for which the machine has been setup.



- ▶ To switch on the machine, turn the main switch located at the rear, on the right-hand side of the electric cabinet;

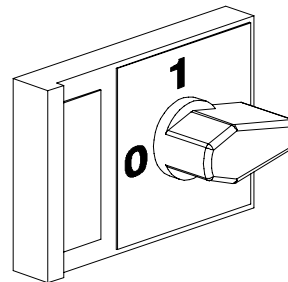


- ▶ press the ON button on the control console;
- ▶ press RESET twice.

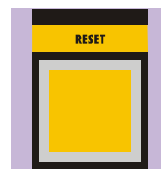



The above sequence (ON and RESET buttons) must be performed each time the machine is switched on.

Make sure that the disk rotates properly. To do this, proceed as follows:



- ▶ make sure the machine is not in emergency status (red mushroom head button released); otherwise, release the emergency stop button and press RESET;
- ▶ set the cutting head downstroke adjuster by means of the specific selector;

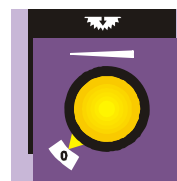

- ▶ select the disk speed pressing the turtle key (first speed) or the hare key (second speed);

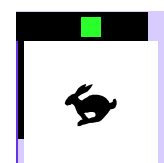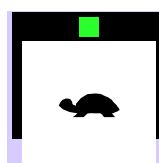


- ▶ start disc rotation using the start pushbutton on the control panel or the pedal control (if machine is equipped);

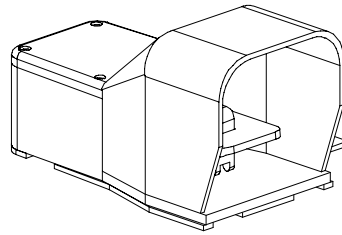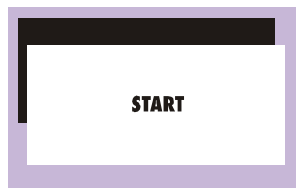

- ▶ if all the above operations have been carried out correctly, the disc motor will start up and the disc will start to turn.

**Attention**

**Ensure that the blade moves in the correct direction as shown in the above figure.** If it does not, simply reverse two of the phase wires on the machine's power supply input.

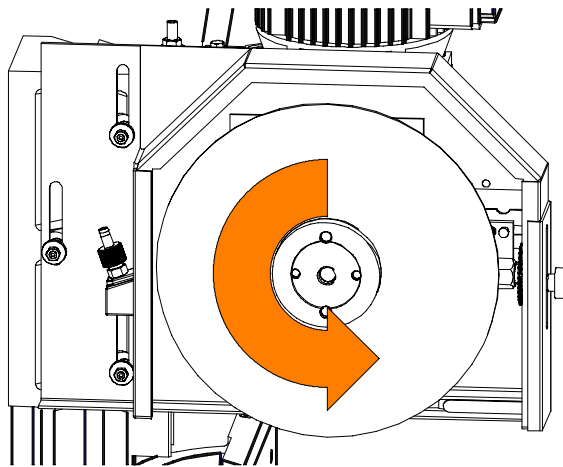

The sawing machine is now ready to start the work for which it was designed. Chapter 5 provides a detailed description of the various functions of the machine and its operating cycles.


# Description of machine operation




This chapter analyses all the machine functions. We begin with a description of the pushbuttons and other components on the control panel.

## Description of the control panel

The control console is housed inside the control panel in an IP 54 rated housing which is tamperproof and resistant to dust and moisture. The control panel swivels on two articulated joints so that it can be positioned by the operator for greater ease of use and safety. The figure below shows the control panel of **CNF 400 CNC**:

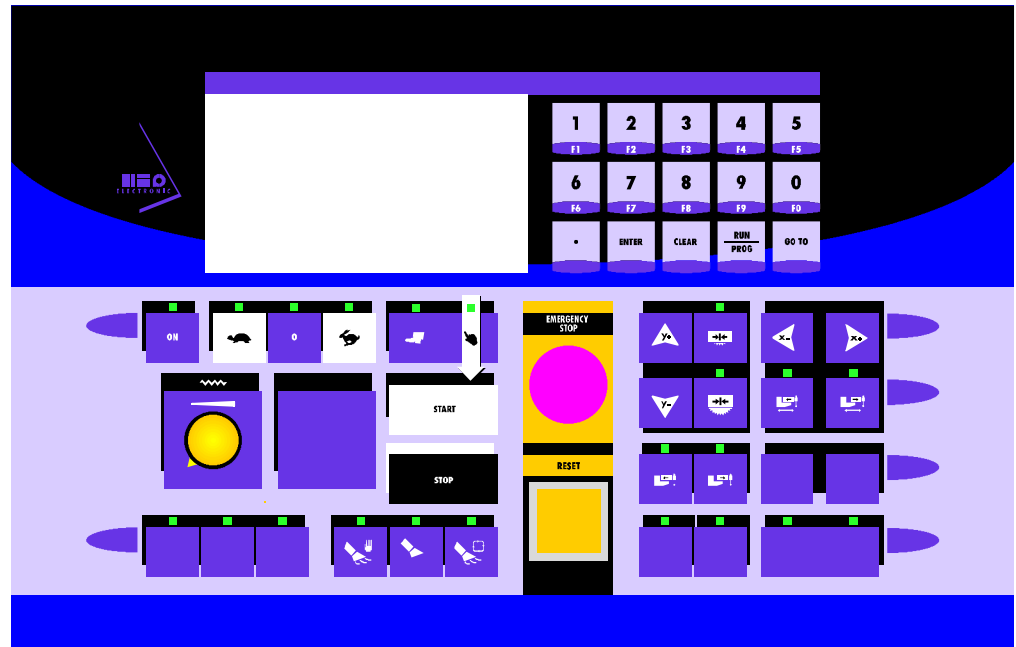


### Key for control console keyboard

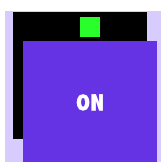


On key: enables machine operation




Cutting vice closure

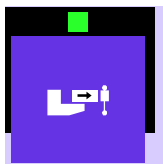

Cutting vice opening

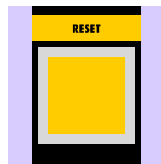

RESET key: resets the machine after an emergency condition or conflicting commands.

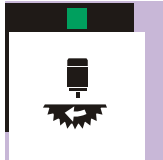


Blade motor selector: during normal operation of the machine, this enables or disables the cutting cycle start button (START)




Start button: starts the cutting cycle




STOP button: stops the machine in the automatic cycle only

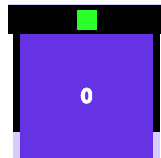


Speed de-selection key (zero)

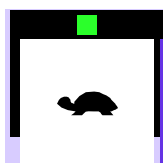


In the LR models selects the low speed (tortoise)

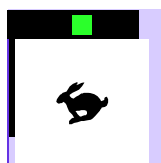


In the LR models selects the high speed (hare)

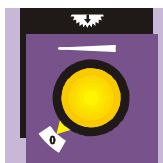

Head lowering speed potentiometer

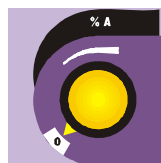

Cutting force control potentiometer

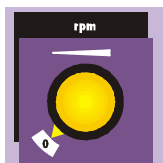

Not operational



Function key:

In automatic work mode, allows you to enter programming and return to execution

In programming work mode, allows you to switch between the program cuts and select program displays



Function Key:

Calling up program No.

Scrolling the cursor

Storing data

Storing programs

Selecting programs

Storing parameters




Function Key:


In automatic work mode, allows you to delete the last program carried out by loading the new one to be carried out

In programming work mode, allows you to delete existing or incorrect data


When entering cutting or machine parameters, allows you to delete existing or incorrect data

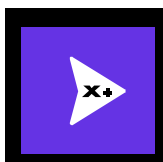

Manual movement of feed carriage forward

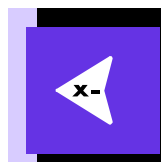


Manual movement of feed carriage backward

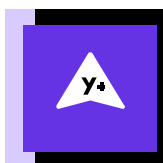


Head up key



Head down key

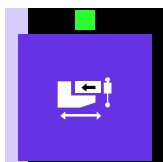

Main vice closure

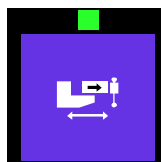

Main vice opening






**EMERGENCY** mushroom: pressing this button all the operations of the machine stop immediately. To reset the emergency, rotate the actuator by 45°




Gun sprays lubricant/coolant fluid even when the machine is stopped




Jet of lubricant/coolant fluid from taps, only when the cycle has started

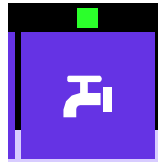

No lubricant/coolant fluid jet

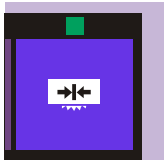

Button for memorizing the FCTI (Head Upstroke Limit)

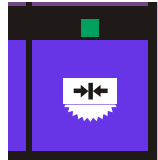

Button for memorizing the FCTA (Head Downstroke Limit)



Button to open and close the timed door of the cutting head




Chip discharger unit in manual mode




Chip discharger unit deactivated




Chip discharger unit in automatic mode

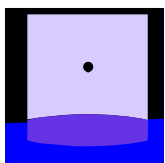

Decimal point for entering numerical values in tenths of a millimetre or thousandths of an inch when programming parameters and cutting lengths.

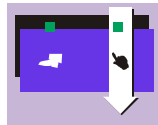

Selecting operating mode

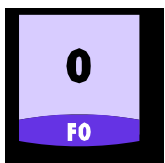

**F0: Function Key:**  
Takes you from single to multiple programming in automatic work mode



**F1: function key**  
At machine start up, it allows programming the setup parameters.



**F2: Function key not operational**



**F3: Function Key:**  
Selects semi-automatic work mode in the main menu



**F4: Function Key:**  
Selects Automatic work mode in the Main menu



**F5: Function Key:**  
Resets total cutting time counter in semi-automatic work mode



**F6: Function Key:**  
Selects diagnostic work mode in the main menu  
zeroing command  
Enables step=length check in automatic work mode



**F7: function key**  
in automatic mode it enables the selection of the single cycle i.e. the basket change cycle, or the continuous cycle



**F8: Function Key:**  
 – Allows operator to enter blade thickness value in automatic work mode



**F9: Function Key:**  
 Takes you from the first display to the zero–setting display  
 Takes you from the zero–setting display to the main menu  
 Takes you back to the main menu

## Basic instructions for carrying out a cutting cycle

### Manoeuvring the cutting head

In the **CNF 400 CNC** model, it is possible to move the cutting head with up and down buttons, shown in the key of the control panel in this chapter.

**Head up key Y+**



**Head down key Y-**



### Access to the cutting head

To ensure operator safety, the machine is entirely enclosed by safety guards that prevent accidental contact with the tool and moving parts. To access the cutting zone it is necessary to unlock the device closing the door.


**Button to open/close the door of the cutting head**



### Manoeuvring the feeder

The power supplier can be moved with the buttons reported on the diagram below, only after having reset the power supply (as explained in the “machine start up” paragraph).

**Forward key X+**

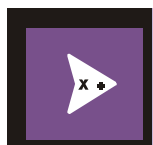


**Back key X-**



## Clamping the work piece in the vice

Vice opening and closure, for the cutting vice and the feeder vice, are controlled by the corresponding buttons on the control console.

**Cutting Vice close button**

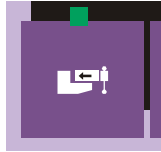

**Cutting vice open button**



**Feeder vice close button**




**Feeder vice open button**




However, to ensure that the workpiece is securely clamped in the vice, proceed as follows:

- ▶ make sure the workpiece dimensions do not exceed the machine's cutting capacity;
- ▶ make sure the piece is correctly supported on both sides of the machine;
- ▶ move the vice to within 2÷3 mm of the workpiece using the handwheel. Press the vice closure button on the console;

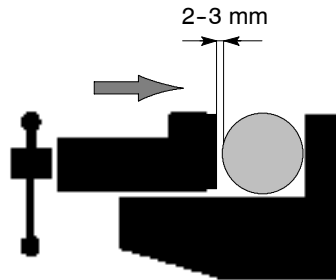


- ▶ make sure that the material is well blocked by trying to move it manually, as the vice cylinder has a stroke of 8 mm only.

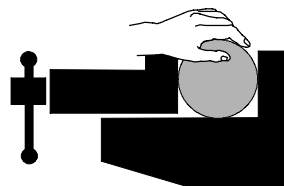

### Lubricant/coolant fluid supply

It is possible to select the operating mode of the coolant by means of the specific buttons on the control panel:

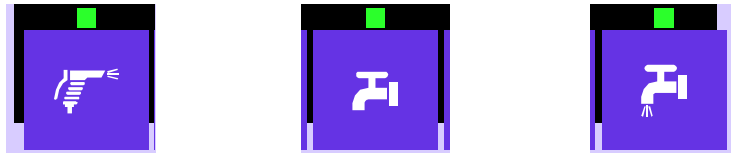

### Technological control parameters

The following table indicates the control parameters which are shown on the displays of the semi-automatic, automatic and Automatic Loop operating cycles.

X = 1000,5	X-axis dimension (position of feeder carriage)
$\theta = 00,00$	Nonoperating
W = 000.0	Nonoperating
F = 0	Cutting head descent speed potentiometer
S = 15	Disc rotation speed (rpm)
Kg = 000	Nonoperating
DL = 0	Nonoperating
SL = 3,8	Blade thickness (depends upon machine model)
AM = 5,8	Max. blade motor absorption
A = 0,7	Amperometer
T = 00,00	Partial cutting time
TT = 00,00	Total machine time for the cutting cycle
F1 = SMS	GSM module for SMS sending

### Preliminary check list for cutting operation

To guarantee complete safety during cutting cycles, the operator should work through a check list of the entire apparatus, checking:


- ▶ ensure that the disk guard completely surrounds the tool when it is not in use;
- ▶ that the work piece is properly clamped in place;
- ▶ ensure that the blade teeth are appropriate for the material being cut;
- ▶ that the speed selected is right for the kind of piece to be cut;
- ▶ that all protections are in place and correctly locked;
- ▶ lubricant/coolant level and activation of the electropump;
- ▶ the blade downstroke speed must be correct.

---


## Starting up the machine

When switching on the machine, proceed as follows:

- ▶ press the ON button.

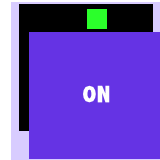

- ▶ Press RESET twice.

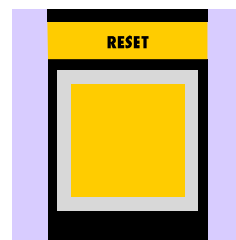

The display shows the introductory and starting SCREEN.

- ▶ To continue press F9.



- ▶ The display suggests ZERO SETTING the machine. To carry out this operation, press F6. To go to the main menu, press F9.




During zero setting, the display will read ZERO SETTING IN PROGRESS, which will continue to be displayed until the operation has been completed. While zero setting is taking place, only the EMERGENCY button is active.

- ▶ When ZERO SETTING has been completed, the display will show the COUNT STARTING VALUE for the X axis. Press F9 to continue.




## Semi-automatic operating cycle

- ▶ Starting from the main menu, press F3 to put the machine in SEMI-AUTOMATIC mode.

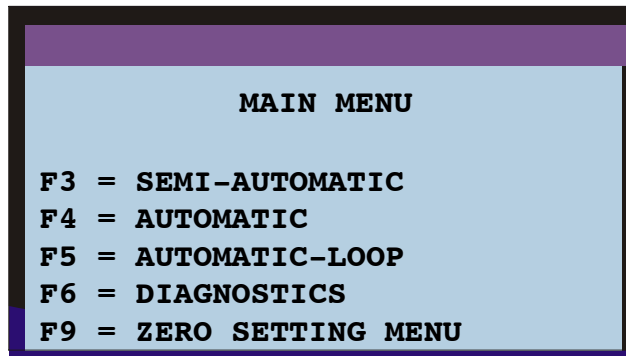

- ▶ The display will show the screen for the SEMI-AUTOMATIC cycle.

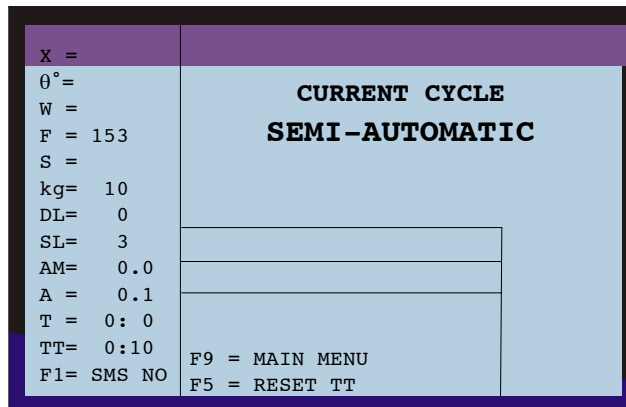

### Technological control parameters


X = 1000,5	Nonoperating
θ = 00,00	Nonoperating
W = 000.0	Nonoperating
F = 0	Cutting head descent speed potentiometer
S = 15	Disc rotation speed (rpm)
Kg = 000	Nonoperating
DL = 0	Nonoperating
SL = 3,8	Blade thickness
AM = 5,8	Assorbimento motore
A = 0,7	Amperometer
T = 00,00	Partial cutting time
TT = 00,00	Total machine time for the cutting cycle
F1 = SMS	GSM module for SMS sending

### Clamping the work piece in the vice


- ▶ Release the protection by pressing the relevant key;



- open the vice by rotating the handwheel anti-clockwise and position the workpiece between the jaws.

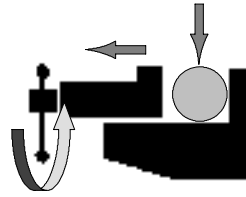


- Bring the moveable jaw to within 2÷3 mm of the workpiece by rotating the handwheel clockwise.

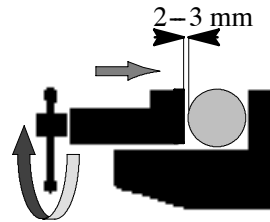

- Block the piece by means of the pneumatic cutting vice block, by pressing the close cutting vice button.



- Check that the workpiece is effectively locked in position!

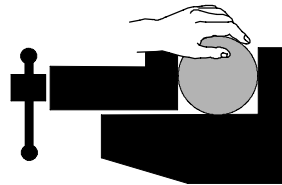


**N.B.** If the vice was already closed by the pneumatic piston, it may not block the piece. In this case it is necessary to repeat the operation, i.e.: open the vice by pressing the specific button, bring the moving jaw near to the piece and block it again with the closing button, bearing in mind that the stroke of the pneumatic piston is approx. 8 mm.

### **Cutting stroke adjustment**


- Once the workpiece is locked in position, the cutting stroke must be adjusted. When the head down button is pressed, the cutting head is automatically lowered.





- Keep the button pressed until the disk is at 5/10 mm from the material to be cut.

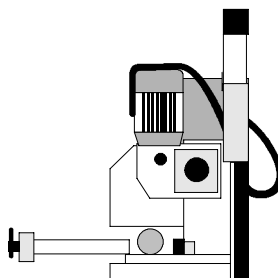

- Memorize the FCTI (Head Upstroke Limit) by pressing the specific button;

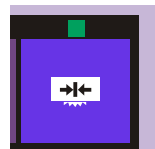


- after pressing the FCTA memorizing button, the display will indicate that it has been memorized.

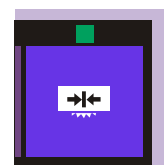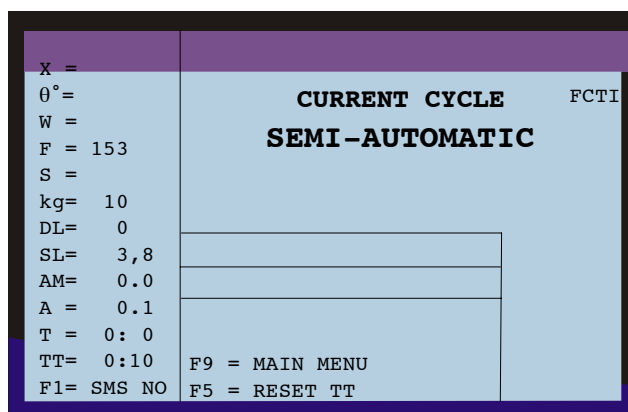

- The FCTI (Head Downstroke Limit) will be restored at the end of the cut.

### Preparing to cut



- Select the fluid for automatic operation by pressing the specific button. The led of the relative button will light up.

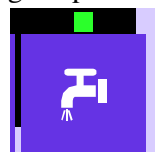

- Adjust the head descent speed potentiometer to 0 to avoid undesirable starting speeds.

### Cutting

- Close the protection and press the reset button;
- select the disk speed pressing the turtle key (first speed) or the hare key (second speed);

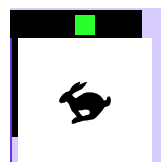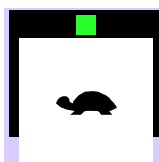



- start operation.




**N.B.** At this stage it is possible to adjust, according to the type of material, the 2 parameters which influence the cut: the disk rotation speed and the head downstroke speed, through the relative potentiometers on the control panel.  
Now the blade starts, the cutting cylinder is under pressure and the lubricant/coolant supply starts.


**N.B.** In this phase, pressing the head downstroke button, the FCTA spot is deleted.




- When the machine arrives at the end of the cut it is necessary to memorize the FCTA position, by pressing the relative button;

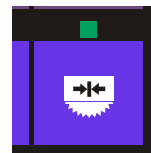

- when the machine reaches the position to start cutting again, the symbol to indicate the FCTA upstroke limit will re-appear on the display.

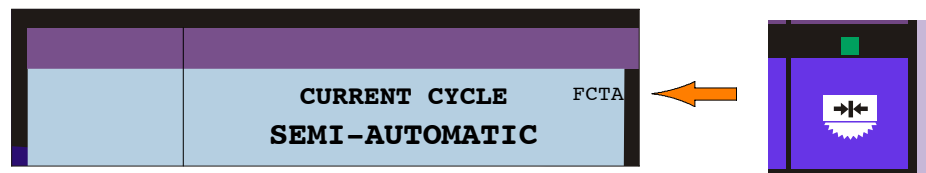


- At the same time, the disk will stop and the cutting head will return to the start of cut position (FCTI).
- When the head arrives at the start of cut position, the display will indicate the FCTI position.

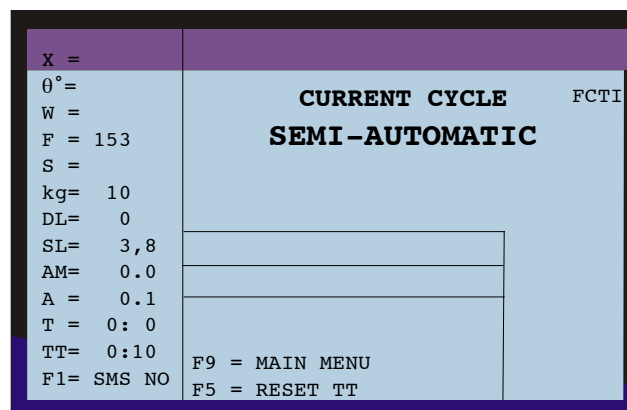


- Next, the machine automatically opens the cutting vice.  
The machine is ready to carry out a new cutting cycle.

## Automatic operating cycle

- Return to the main menu to change the operating mode. To return to the MAIN MENU press F9.

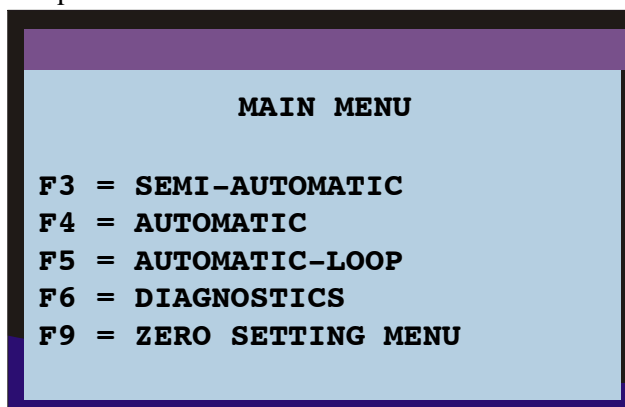

- Now press the F4 button to go to the AUTOMATIC cutting cycle.
- The AUTOMATIC screen shows the parameters inserted for the last operation completed.

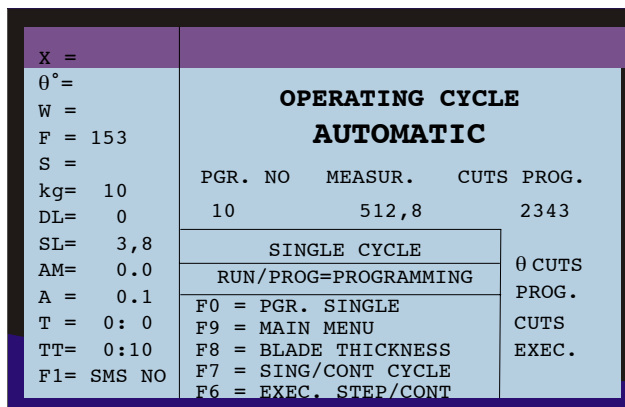

<b>PROGRAMME DATA</b>	PGR. NO. = When the AUTOMATIC cycle screen switches on, the programme number for the last programme memorised is displayed, irrespective of whether it was totally or partially completed or only saved. The control memory allows 32 programmes to be memorised as well as the single programme. The latter programme is indicated by the number 0.
	MEASUREMENT = As for the situation described above, the MEASUREMENT value displayed also relates to the last programme memorised. The control memory allows cutting lengths of up to 9999,9 mm. to be memorised. The cutting length can be programmed to an accuracy of a tenth of a millimeter. PRECISION $\pm 0.1$ mm. $0 \div 500$ mm
	CUTS PROG. = In the case of the number of CUTS PROGRAMMED, the same information as above applies. It is possible to set a maximum number of cuts of 9999 pieces for each programme.
	CUTS EXEC. = The number of CUTS EXECUTED displayed relates to those effectively completed before the machine was last switched off. These will remain in the memory until they are replaced by further cuts carried out using the same programme, or until they are zero set or modified by a new programme.
<b>OPERATING BUT-TONS ACTIVE DURING THE AUTOMATIC CYCLE</b>	F0 = SINGLE PROGRAMME: Press this button to access the single programme. Using this option, programming can be done directly on the work screen. The single programme allows 1 MEASUREMENT and 1 QUANTITY of cuts to be carried out. This possibility has been included to avoid multiple programming procedures when these are not necessary.

<b>OPERATING BUT-TONS ACTIVE DURING THE AUTOMATIC CYCLE</b>	F9 = MAIN MENU: press this button to return to the working mode selection menu.
	F8 = BLADE THICKNESS: this option gives access to programming of the BLADE THICKNESS. This parameter is very important because the bar infeed system operates in zero setting mode, therefore the value of the scrap produced by the disk must be added to the size of the piece to be processed. Adding and subsequent division by the number of runs necessary to obtain the required measurement, will be carried out independently on the control console.
	F7 = SING/CONT CYCLE: this operation is more easily understood if the SINGLE CYCLE is called the CHANGE TOTE–BOX cycle. In practice, when a number of measurements and pieces are programmed for the same bar, this option allows them to be kept separate, stopping the machine at the end of each programme.

### ***Inserting and locking the workpiece***

Initially the machine could be configured in any way, therefore the first series of operations to be carried out is to set the machine for the material to be cut.


- Bring the cutting head to the upstroke limit, using the manual head lift button;




- Release the protection by pressing the relevant key;



- open the cutting vice and the infeed vice by rotating the relative handwheels; then adjust the position of the anti–chip vice indicated by the arrow.

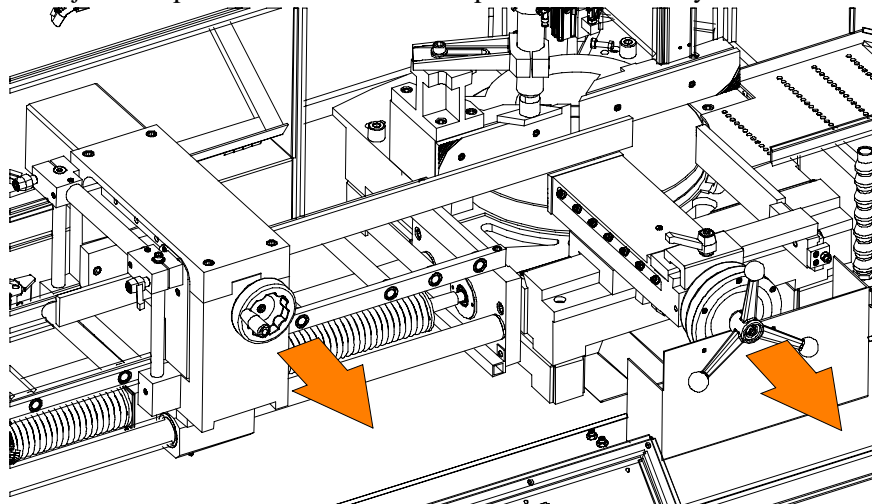


- After this second operation, check that the pneumatic piston is in open position. To do this, use the supply vice and cutting vice opening buttons.

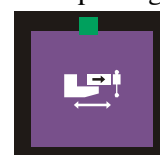


It is advisable to use the buttons a number of times, to be totally familiar with operation.

- The second series of operations are to fit the material to be cut: place the material between the vice jaws, and draw one end under the blade in order to perform an initial cut to initialize the cuts.
- After inserting the material, bring the moving jaws for the cutting and feeder vices to within 2÷3 mm of the workpiece;
- activate the automatic pneumatic vices to block the piece, using the two vice closing buttons;

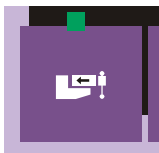


- check that the piece is well blocked;

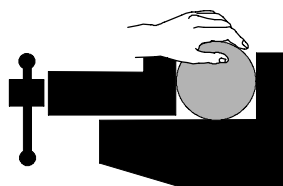

to avoid deformation when the tubes are thin walled, or the blocking force of the vices is not sufficient for materials which are particularly hard or with articulated sections, adjust the vice pressure by means of the regulator located inside the base.


### Preparing to cut

- Close the protection and press the reset button;
- adjust the cutting stroke by memorizing the head upstroke limit (FCTI): bring the cutting head near the material using the head downstroke button.

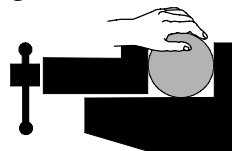

- Memorize the cutting start position by pressing the FCTI (Head Upstroke Limit) button. The FCTI indication will appear at the top of the display on the right hand side.

X =	<b>OPERATING CYCLE</b>			FCTI
θ° =	<b>AUTOMATIC</b>			
W =	PGR. NO	MEASUR.	CUTS	PROG.
F = 153	10	512,8	2343	
S =	SINGLE CYCLE			θ CUTS
kg= 10	RUN/PROG=PROGRAMMING			PROG.
DL= 0	F0 = PGR. SINGLE			CUTS
SL= 3,8	F9 = MAIN MENU			EXEC.
AM= 0.0	F8 = BLADE THICKNESS			
A = 0.1	F7 = SING/CONT CYCLE			
T = 0: 0	F6 = EXEC. STEP/CONT			
TT= 0:10				
F1= SMS NO				

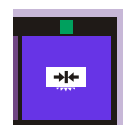

### Programming cuts

Once the material to be cut has been inserted and blocked, bring the cutting head to the FCTI (Head Upstroke Limit) position, set the cutting dimension indicated on the display as Measure, and the amount of pieces to be cut Prog. cuts.

X =	<b>OPERATING CYCLE</b>			FCTI
θ°=	<b>AUTOMATIC</b>			
W =	PGR. NO	MEASUR.	CUTS	PROG.
F = 153				
S =	10	512,8	2343	
kg= 10	SINGLE CYCLE			θ CUTS
DL= 0	RUN/PROG=PROGRAMMING			PROG.
SL= 3,8	F0 = PGR. SINGLE			CUTS
AM= 0.0	F9 = MAIN MENU			EXEC.
A = 0.1	F8 = BLADE THICKNESS			
T = 0: 0	F7 = SING/CONT CYCLE			
TT= 0:10	F6 = EXEC. STEP/CONT			
F1= SMS NO				

For the cutting program it is necessary to set the following parameters:

- **PGR. N. = PROGRAM NUMBER:** this value identifies all existing programs, therefore it is possible to select a program previously memorized by setting a number, or the number proposed by the controller can be accepted.
- **MEASUREMENT = MEASUREMENT OF PIECES:** This value is keyed in, using the numeric keys, in mm and tenths of a mm, or in inches and thousandths of an inch, relates to the selected programme.
- **PROGRAMMED CUTS = NUMBER OF PIECES TO BE CUT PER MEASURE:** set this value using the numeric keys in relation to the PGR. N. and MEASURE set.

The machine's control console allows cuts to be programmed in two ways:

- **SINGLE PROGRAMME:** This option enables programming on the work screen, setting the measurements and number of pieces to be obtained from the workpiece.
- **MULTIPLE PROGRAMMING:** With this programming system 32 cutting lengths can be set with relative number of pieces to be cut for each dimension. Furthermore, selecting the programs, it is possible to set cutting sequences with different measures on the same bar.

## Single program

- To set the measure and number of pieces in the single program, press F0.

X =	<b>OPERATING CYCLE</b>			FCTI
θ°=	<b>AUTOMATIC</b>			
W =	PGR. NO	MEASUR.	CUTS	PROG.
F = 153				
S =	0	512,8	2343	
kg= 10	SINGLE PROGRAM			θ CUTS
DL= 0	RUN/PROG=PROGRAMMING			PROG.
SL= 3,8	F0 = PGR. SINGLE			CUTS
AM= 0.0	F9 = MAIN MENU			EXEC.
A = 0.1	F8 = BLADE THICKNESS			
T = 0: 0	F7 = SING/CONT CYCLE			
TT= 0:10	F6 = EXEC. STEP/CONT			
F1= SMS NO				

- When the F0 button has been pressed, the display reads:
- |             |   |
|-------------|---|
| PGR. NO.    | 0   |
| MEASUREMENT | The last measurement programmed   |
| CUTS PROG.  | The last number of cuts programmed  |
| CUTS EXEC.  | The portion of the last job executed. The type of programme in use will appear in the first square: SINGLE PGR. To begin programming, press RUN/PROG. |

X =	<b>OPERATING CYCLE</b> FCTI		
θ°=	<b>AUTOMATIC</b>		
W =	PGR. NO	MEASUR.	CUTS PROG.
F = 153	0	512,8	2343
S =	SINGLE PROGRAM		θ CUTS
kg= 10	RUN/PROG=PROGRAMMING		PROG.
DL= 0	F0 = PGR. SINGLE		CUTS
SL= 3,8	F9 = MAIN MENU		EXEC.
AM= 0.0	F8 = BLADE THICKNESS		
A = 0.1	F7 = SING/CONT CYCLE		
T = 0: 0	F6 = EXEC. STEP/CONT		
TT= 0:10			
F1= SMS NO			

- When the RUN/PROG button has been pressed, the measurements will be reversed, indicating that they can be changed. To set new measurements, key in using the NUMERIC KEYS. Enter the measurement 905,7 (for example). To do so the following keys must be pressed: “9” “0” “5” “.” “7”

X =	<b>OPERATING CYCLE</b> FCTI		
θ°=	<b>AUTOMATIC</b>		
W =	PGR. NO	MEASUR.	CUTS PROG.
F = 153	0	905,7	2343
S =	SINGLE PROGRAM		θ CUTS
kg= 10	RUN/PROG=PROGRAMMING		PROG.
DL= 0	F0 = PGR. SINGLE		CUTS
SL= 3,8	F9 = MAIN MENU		EXEC.
AM= 0.0	F8 = BLADE THICKNESS		
A = 0.1	F7 = SING/CONT CYCLE		
T = 0: 0	F6 = EXEC. STEP/CONT		
TT= 0:10			
F1= SMS NO			

- Pressing the numeric keys, the numbers are displayed from right to left. If you make a mistake when writing the measure, press CLEAR to delete the value; 0.0. will appear. After entering the measure, press ENTER. With this operation you will obtain two results:
- 1) the new value is memorized;
  - 2) the reverse moves to PROG. CUTS to set the desired number of cuts.

X =	<b>OPERATING CYCLE</b> FCTI		
θ°=	<b>AUTOMATIC</b>		
W =	PGR. NO	MEASUR.	CUTS PROG.
F = 153	0	905,7	2343
S =	SINGLE PROGRAM		θ CUTS
kg= 10	RUN/PROG=PROGRAMMING		PROG.
DL= 0	F0 = PGR. SINGLE		CUTS
SL= 3,8	F9 = MAIN MENU		EXEC.
AM= 0.0	F8 = BLADE THICKNESS		
A = 0.1	F7 = SING/CONT CYCLE		
T = 0: 0	F6 = EXEC. STEP/CONT		
TT= 0:10			
F1= SMS NO			

- With the reverse on PROG. CUTS, set the number of cuts to be executed using the numeric keys as for the previous operation. Digit 100, pressing in order buttons “1” “0” “0”; then press ENTER again. With this operation you will obtain two results:
- 1) the new value is memorized;
  - 2) the reverse moves to NR PGR.

X =	<b>OPERATING CYCLE</b>			FCTI
θ°=	<b>AUTOMATIC</b>			
W =	PGR. NO	MEASUR.	CUTS	PROG.
F = 153				
S =	0	905,7	2343	
kg= 10	SINGLE PROGRAM			θ CUTS
DL= 0	RUN/PROG=PROGRAMMING			PROG.
SL= 3,8	F0 = PGR. SINGLE			CUTS
AM= 0.0	F9 = MAIN MENU			EXEC.
A = 0.1	F8 = BLADE THICKNESS			
T = 0: 0	F7 = SING/CONT CYCLE			
TT= 0:10	F6 = EXEC. STEP/CONT			
F1= SMS NO				

- End of programming. Press RUN/PGR to return to execution.

**N.B.** Whenever CLEAR is pressed in the single program automatic mode, when the machine is stopped, the count of the cuts executed previously is reset.

- After pressing RUN/PGR, the reverse will disappear from the display; this indicates that the machine is ready for operation. To confirm the new program, press CLEAR; this will produce two results:
  - 1) confirmation of the program to be executed
  - 2) count reset of cuts executed previously.

X =	<b>OPERATING CYCLE</b>			FCTI
θ°=	<b>AUTOMATIC</b>			
W =	PGR. NO	MEASUR.	CUTS	PROG.
F = 153				
S =	0	905,7	2343	
kg= 10	SINGLE PROGRAM			θ CUTS
DL= 0	RUN/PROG=PROGRAMMING			PROG.
SL= 3,8	F0 = PGR. SINGLE			CUTS
AM= 0.0	F9 = MAIN MENU			EXEC.
A = 0.1	F8 = BLADE THICKNESS			
T = 0: 0	F7 = SING/CONT CYCLE			
TT= 0:10	F6 = EXEC. STEP/CONT			
F1= SMS NO				

- Enter the value BLADE THICKNESS which must be programmed every time the tool is changed. It is necessary to add also the blade thickness to the cutting measure, because the bar supply system works when the carriage is at zero, i.e. after being cut, the piece is on the right of the blade, and this value is subtracted from the total length of the finished piece. Press F8 to enter this value.

<b>BLADE THICKNESS</b>		<b>= 3,8</b>
<b>RESIDUAL</b>		
<b>PROGRAMMED</b>		<b>= 1547 m</b>
<b>BLADE LIFE</b>		<b>= 952 m</b>
<b>MAXIMUM BLADE MOTOR CURRENT</b>		
<b>TORTOISE 1ST SPEED AMP.</b>		<b>= 12.5</b>
<b>SPEED HEAD AP MPP</b>		
<b>BAR INITIALIZING SIZE</b>		<b>= 1</b>
<b>RUN/PROG = PREVIOUS MENU</b>		<b>= 170</b>

- After pressing F8 the display will show BLADE THICKNESS. To enter the value press in order the numeric keys and the decimal point. To memorize the new value press ENTER again. Of course, in case of a typing error, it is possible to correct it by pressing CLEAR. Once the operation is complete, press RUN/PROG to return to the operating display screen.

X =	<b>OPERATING CYCLE</b>			FCTI
θ°=	<b>AUTOMATIC</b>			
W =	PGR. NO	MEASUR.	CUTS	PROG.
F = 153	0	905,7	2343	
S =	SINGLE PROGRAM			θ CUTS
kg= 10	RUN/PROG=PROGRAMMING			PROG.
DL= 0	F0 = PGR. SINGLE			CUTS
SL= 3,8	F9 = MAIN MENU			EXEC.
AM= 0.0	F8 = BLADE THICKNESS			
A = 0.1	F7 = SING/CONT CYCLE			
T = 0: 0	F6 = EXEC. STEP/CONT			
TT= 0:10				
F1= SMS NO				

- Now it is possible to start operation. To check the measure of the piece cut, press F6; in the first box the indication STEP will appear.

X =	<b>OPERATING CYCLE</b>			FCTI
θ°=	<b>AUTOMATIC</b>			
W =	PGR. NO	MEASUR.	CUTS	PROG.
F = 153	0	905,7	2343	
S =	SINGLE PROGRAM			θ CUTS
kg= 10	RUN/PROG=PROGRAMMING			PROG.
DL= 0	F0 = PGR. SINGLE			CUTS
SL= 3,8	F9 = MAIN MENU			EXEC.
AM= 0.0	F8 = BLADE THICKNESS			
A = 0.1	F7 = SING/CONT CYCLE			
T = 0: 0	F6 = EXEC. STEP/CONT			
TT= 0:10				
F1= SMS NO				

- After pressing F6, the machine proceeds as follows:
- START
  - INITIAL CUT
  - BAR SUPPLY
  - CUT IN AUTOMATIC MODE
  - STOP.

The machine performs the first cycle of operations, to cut to size the first piece. This enables a precise check of the measure of the piece. If the size is correct, press F6 again to deactivate the check cycle, then press START.

X =	<b>OPERATING CYCLE</b>			FCTI
θ°=	<b>AUTOMATIC</b>			
W =	PGR. NO	MEASUR.	CUTS	PROG.
F = 153	0	905,7	2343	
S =	SINGLE PROGRAM			θ CUTS
kg= 10	RUN/PROG=PROGRAMMING			PROG.
DL= 0	F0 = PGR. SINGLE			CUTS
SL= 3,8	F9 = MAIN MENU			EXEC.
AM= 0.0	F8 = BLADE THICKNESS			
A = 0.1	F7 = SING/CONT CYCLE			
T = 0: 0	F6 = EXEC. STEP/CONT			
TT= 0:10				
F1= SMS NO				




- If the size is not correct, use the BLADE THICKNESS parameter to enter the correction value. Repeat the cut with the check cycle activated. In this case the machine will perform the following operations:
  - START
  - BAR SUPPLY
  - CUT IN AUTOMATIC MODE
  - STOP.

In other words, the machine starts again where it had stopped, automatically changing the size with the set adjustment, and supplying the bar with the new measure. Check the size again, and if it is correct, press F6 to delete STEP, then press START.

X =	<b>OPERATING CYCLE</b>			FCTI
θ° =	<b>AUTOMATIC</b>			
W =	PGR. NO	MEASUR.	CUTS	PROG.
F = 153	0	905,7	2343	
S =	SINGLE PROGRAM			θ CUTS
kg= 10	RUN/PROG=PROGRAMMING			PROG.
DL= 0	F0 = PGR. SINGLE			CUTS
SL= 3,8	F9 = MAIN MENU			EXEC.
AM= 0.0	F8 = BLADE THICKNESS			
A = 0.1	F7 = SING/CONT CYCLE			
T = 0: 0	F6 = EXEC. STEP/CONT			
TT= 0:10				
F1= SMS NO				



- Select the cutting speed.
- Select the fluid for automatic operation by pressing the specific button. The button led will light up.

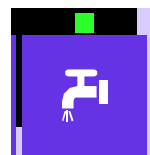

- Set the head descent speed regulator to 0 to prevent inadvertent movement of the cutting head, once the cycle starts.

### Cutting

- select the disk speed pressing the turtle key (first speed) or the hare key (second speed);

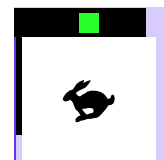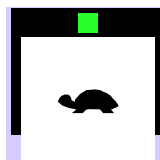

- start operation.




Now the blade starts, the cutting cylinder is under pressure and the lubricant/coolant supply starts. At this stage it is possible to adjust, according to the type of material, the 3 parameters which influence the cut: the disk rotation speed and the head downstroke speed, through the relative potentiometers on the control panel.


- N.B.** In this phase, pressing the head dowstroke button, the FCTA spot is deleted.




- When the machine arrives at the end of the cut it is necessary to memorize the FCTA position, by pressing the relative button;

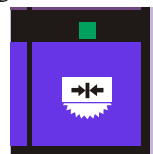

- once the FCTA memorising button has been pressed, the display will show the symbol confirming memorisation.

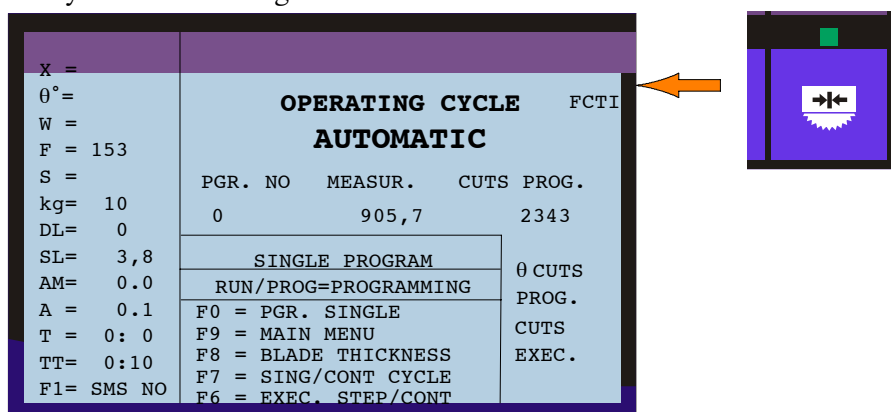


- Then the machine will bring the head to the FCTI spot, and will deliver the material to execute another cut in the set mode: step or continuous.

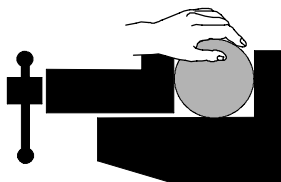

- N.B.** Every time the machine finishes a cut the number of CUTS EXEC. is updated by one unit. The initial cut, and the cuts executed after an emergency, are not counted.


- The machine can stop in two ways, when in automatic mode: BAR FINISHED or CUTS FINISHED in both cases, all that is required to exit these situations is to press the RESET button, following which the machine will again be ready to begin a new cutting programme, or cutting a new bar. In both cases a clear message will be displayed.

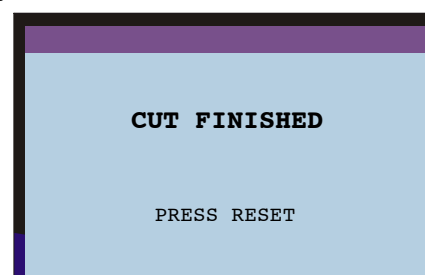

- The cuts programmed in the SINGLE PGR. have finished. The display will show the relative message;



- the machine stops in position to start cutting.

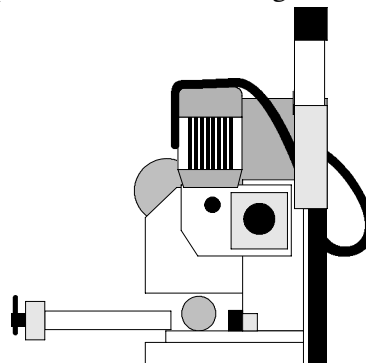

- Pressing RESET the display return to the operating screen, displaying the data of the program in progress. Press CLEAR to reset the cuts previously done.

X =	<b>OPERATING CYCLE</b> <span style="float:right">FCTI</span> <b>AUTOMATIC</b>			
θ° =				
W =				
F = 153				
S =	PGR. NO	MEASUR.	CUTS	PROG.
kg= 10	0	905,7		2343
DL= 0				0 CUTS PROG.
SL= 3,8	SINGLE PROGRAM			
AM= 0.0	RUN/PROG=PROGRAMMING			CUTS EXEC.
A = 0.1	F0 = PGR. SINGLE			
T = 0: 0	F9 = MAIN MENU			
TT= 0:10	F8 = BLADE THICKNESS			
F1= SMS NO	F7 = SING/CONT CYCLE			
	F6 = EXEC. STEP/CONT			

## Multiple programming

- ▶ Press button F0 to access the MULTIPLE PROGRAMMING. The display proposes the data of the last program executed before switching off the machine, or before the SINGLE PGR.
- ▶ The first box will show the message referring to one of the two operating modes of the automatic program:
  - 1) CONTINUOUS CYCLE: sequence programs;
  - 2) SINGLE CYCLE: one program at a time.
 Press the RUN/PROG button to set operation and to enter the data.

X =	OPERATING CYCLE FCTI		
θ°=			
W =	AUTOMATIC		
F = 153			
S =	PGR. NO	MEASUR.	CUTS PROG.
kg= 10	10	905,7	2343
DL= 0	CONTINUOUS CYCLE		θ CUTS PROG.
SL= 3,8	RUN/PROG=PROGRAMMING		
AM= 0.0	F0 = PGR. SINGLE		
A = 0.1	F9 = MAIN MENU		CUTS
T = 0: 0	F8 = BLADE THICKNESS		EXEC.
TT= 0:10	F7 = SING/CONT CYCLE		
F1= SMS NO	F6 = EXEC. STEP/CONT		

- ▶ After pressing the RUN/PROG button, the display will show a programming screen to program cuts and select the programs to be executed. The function of each button is described in the message. To access CUT PROGRAMMING press F1.

<b>PROGRAMMING</b>	
<b>F1 = PROGRAMMING CUTS</b> <b>F2 = SELECT PROGRAMMES</b> <b>F3 = SEL. PROG. LOOP</b>	

- ▶ The first CUT PROGRAMMING display screen shows the program number in reverse, which means that it is possible to change the value. Start entering the operating parameters from program No. 1; to enter the program number

press the numeric key1: the old value will automatically be replaced by the new one.

PROGRAMMING CUTS	
PROGRAMME N°=	<b>12</b>
MEASUREMENT=	2002.2
N° OF CUTS =	331
θ° CUT =	0° 0'
WIDTH =	0.0

- After pressing 1, press ENTER. With this operation you will obtain two results:
- 1) the desired program number is memorized;
  - 2) the reverse moves to measure, which means that it is possible to change its value.

PROGRAMMING CUTS	
PROGRAMME N°=	1
MEASUREMENT=	<b>200.2</b>
N° OF CUTS =	331
θ° CUT =	0° 0'
WIDTH =	0.0

- With the reverse on MEASURE the value of the first batch of pieces to be cut can be entered, i.e. L=178; to enter this value press the numeric keys in order. Any typing mistakes can be deleted by pressing CLEAR. After digiting the numbers, press ENTER; the reverse will pass to CUTS No.

PROGRAMMING CUTS	
PROGRAMME N°=	1
MEASUREMENT=	178
N° OF CUTS =	<b>331</b>
θ° CUT =	0° 0'
WIDTH =	0.0

- Repeat the same operation to set the number of cuts; press in order the numeric keys 5 and 0. After digiting the numbers press ENTER. With this operation you will obtain two results:
- 1) the new value is memorized;

2) the display screen scrolls automatically to show the next program, i.e. PGR. NUMBER 2.

PROGRAMMING CUTS	
PROGRAMME N°=	2
MEASUREMENT=	323.5
N° OF CUTS =	500
θ° CUT =	0°0'
WIDTH =	0.0

- At this point, the operator can chose whether to set operation in this program (no.2), or to select PROGRAM POSITION number and enter new values, as described previously. Proceed with setting the programs in order.

#### FIRST PROGRAMME

PROGRAMMING CUTS	
PROGRAMME N°=	1
MEASUREMENT=	178
N° OF CUTS =	50
θ° CUT =	0°0'
WIDTH =	0.0

#### SECOND PROGRAMME

PROGRAMMING CUTS	
PROGRAMME N°=	2
MEASUREMENT=	60
N° OF CUTS =	112
θ° CUT =	0°0'
WIDTH =	0.0

### THIRD PROGRAMME

PROGRAMMING CUTS	
PROGRAMME N°=	3
MEASUREMENT=	15
N° OF CUTS =	120
θ° CUT =	0°0'
WIDTH =	0.0

- After setting all the cutting programs, press ENTER. The last value entered will be memorized and the display will scroll to the next program.

PROGRAMMING CUTS	
PROGRAMME N°=	4
MEASUREMENT=	630
N° OF CUTS =	30
θ° CUT =	0°0'
WIDTH =	0.0

- Once the programs have been set, press the RUN/PROG button to quit Cut Programming.
- After pressing the RUN/PROG button, the display will show the Programming screen. Now the programs to be executed must be communicated to the controller. To do this press F2.

PROGRAMMING	
F1 =	PROGRAMMING CUTS
F2 =	PROGRAMME SELECTION
F3 =	SEL. PROG. LOOP

- Set the sequence of programs to be executed, up to maximum 32. The display screen shows the cursor in position A, and the last program numbers set in order of execution. There is no limit in relation to the programmable order, whether it be in increasing, decreasing, repetitive or jump order, nor in relation to the minimum number of programs.

- Press the numeric keys to set the programs: digit 1 to set the 1st.

A	B	C	D	E	F	G	H
<b>11</b>	12	16	17	18	20	23	21
I	J	K	L	M	N	O	P
29	30						
Q	R	S	T	U	V	W	Z
AA	BB	CC	DD	EE	FF	GG	HH

- After pressing the numeric key the value is immediately updated. As usual, in case of typing errors, it is possible to correct them by pressing CLEAR. After setting the new program to be executed, press ENTER. The new value is memorized and the cursor moves to the next position.

A	B	C	D	E	F	G	H
1	<b>2</b>	16	17	18	20	23	21
I	J	K	L	M	N	O	P
29	30						
Q	R	S	T	U	V	W	Z
AA	BB	CC	DD	EE	FF	GG	HH

- Set the second program by pressing the numeric key 2, then press ENTER. Proceed as described above for the remaining cutting programs to be executed.

A	B	C	D	E	F	G	H
1	2	<b>3</b>	17	18	20	23	21
I	J	K	L	M	N	O	P
29	30						
Q	R	S	T	U	V	W	Z
AA	BB	CC	DD	EE	FF	GG	HH



- Select the third programme by pressing the numeric key: 3 and press: ENTER. Repeat the operation to select the last cutting programme to execute.

A	B	C	D	E	F	G	H
1	2	3	4	18	20	23	21
I	J	K	L	M	N	O	P
29	30						
Q	R	S	T	U	V	W	Z
AA	BB	CC	DD	EE	FF	GG	HH


- Once the last program has been set, complete the selecting operation by pressing CLEAR.
- After pressing CLEAR, the previous value is deleted and 0 appears. To confirm the end of the programming operations and that only the first four programs are to be executed press ENTER again.

A	B	C	D	E	F	G	H
1	2	3	4	0	20	23	21
I	J	K	L	M	N	O	P
29	30						
Q	R	S	T	U	V	W	Z
AA	BB	CC	DD	EE	FF	GG	HH

- At this point, all the other programs memorised are deleted, and the cursor returns to the first position. Now it is possible to return to the operating display screen by pressing the RUN/PROG button.

A	B	C	D	E	F	G	H
1	2	3	4				
I	J	K	L	M	N	O	P
Q	R	S	T	U	V	W	Z
AA	BB	CC	DD	EE	FF	GG	HH

- Pressing the RUN/PROG button again, the PROGRAMMING display screen returns.

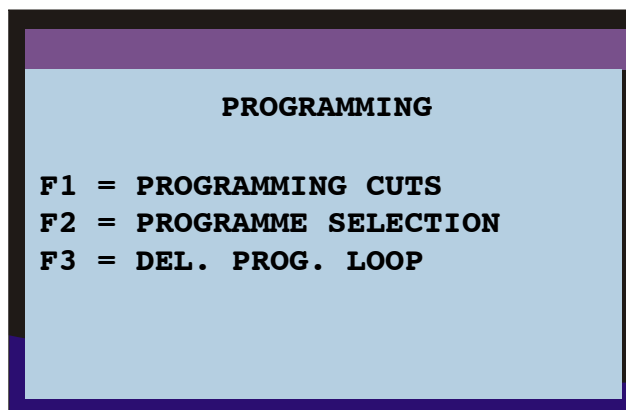


- Pressing the RUN/PROG button, the operating display screen returns, where no parameter has been changed yet. To activate the new program set, press CLEAR. With this operation you will obtain two results:
  - 1) the data of the previous program is deleted from the memory;
  - 2) the data of the new program is entered.
- After pressing CLEAR, the display screen will show the data of the new program being executed.

**N.B.**

Whenever CLEAR is pressed in the automatic operation mode in the multiple programming, with the machine stopped, the operation in progress is reset. This means that if the machine has performed some cuts of the first program, and it is stopped by pressing CLEAR, the cuts already executed are reset. When the machine restarts it will start from the initial cut and therefore from the first cut programmed. If the machine is stopped by pressing CLEAR during the execution of a program after the first, for example the second or third, the display will return to the first program of the series programmed, resetting the number of cuts executed in all the programs performed until that moment. When the machine is restarted, the machine will start from the initial cut, i.e. from the first cut of the first program.

The second operating mode in Multiple Programming is the Single Cycle.

- The message Single Cycle will replace Continuous Cycle by pressing F7.

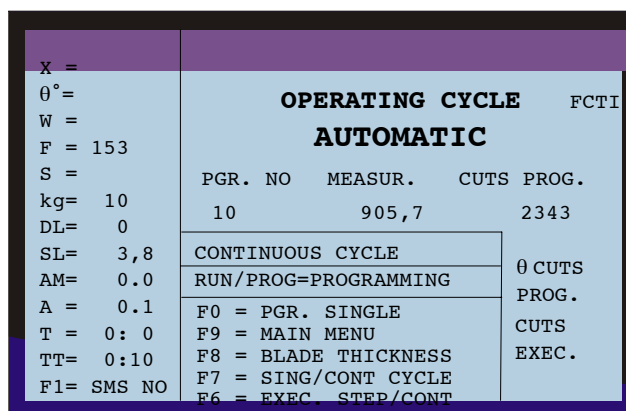

Activating this option the machine will operate as follows: at the end of the cuts in each program, the machine will stop and wait for a new START command. This allows replacing the piece collection container, in order to separate pieces of different sizes. To return to the Continuous cycle mode press F7.


## Multiple programming cuts

Press the **START** button to re-start the cutting cycle.



**START**

- ▶ When the **START** button has been pressed, the display reads **AUTOMATIC EXECUTION**. In this mode, all manual commands are blocked. The commands available when the machine is cutting are: **EMERGENCY – RUN/PROG – STOP**.
- ▶ Press **STOP** with the machine cutting;

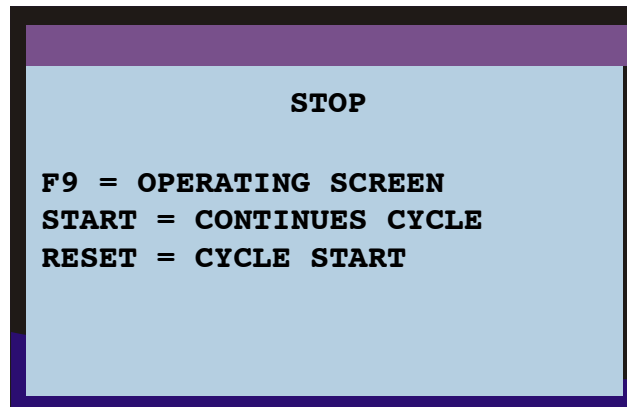


- ▶ after pressing **STOP** the machine stops with the last operation in progress. In other words, if the machine was cutting, it stops with the blade on the cut and waits for the next instructions. This control is important for the use of the machine: for example, when the machine is started without having set the program to be executed, or when the cut or supply are not correct, or whenever it is necessary to momentarily stop the machine.


	<b>BEGIN CUT</b> = Pressing <b>RESET</b> the display returns to the operating screen and the machine returns to the cutting start position. This is to correct the necessary parameters and restart the cycle.
	<b>CONTINUOUS CYCLE</b> = If during the cut or material supply something falls into the machine, a tool or cloth or something else, it is necessary to stop the machine by pressing <b>STOP</b> to draw it out. Press <b>START</b> to activate the machine again.
	<b>WORK SCREEN</b> = In case of doubts concerning the program in progress, after pressing <b>STOP</b> and the machine is stopped, it is possible to return to the operating screen by pressing <b>F9</b> , leaving the program in progress. After verifying the doubts, press <b>F9</b> to return to the <b>STOP</b> screen and decide whether to restart the cycle by pressing <b>START</b> or stop it by pressing <b>RESET</b> .

## Automatic loop operating cycle


- Press F9 to pass to the main menu and change operating mode.
- Press F5 to pass to the cutting cycle in AUTOMATIC LOOP. This mode enables the machine to execute cuts with different depths and lengths on the same bar.

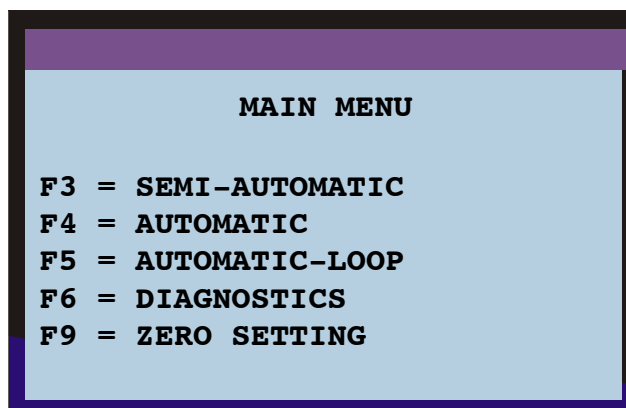


- Press F7 to select the LOOP mode, that can be single or continuous.
- SINGLE LOOP: this operating mode is used to cut material at preset depths (P1, P2, P3) and lengths (L1, L2, L3), while the possibility of intervening in the work cycle on completion of each LOOP executed, is retained.

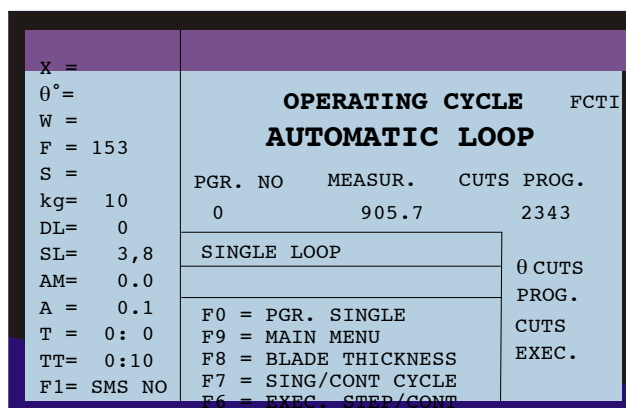

- CONTINUOUS LOOP: this operating mode is used to obtain preset depths and lengths of cuts on material, with LOOP repetitions up to 99 times.

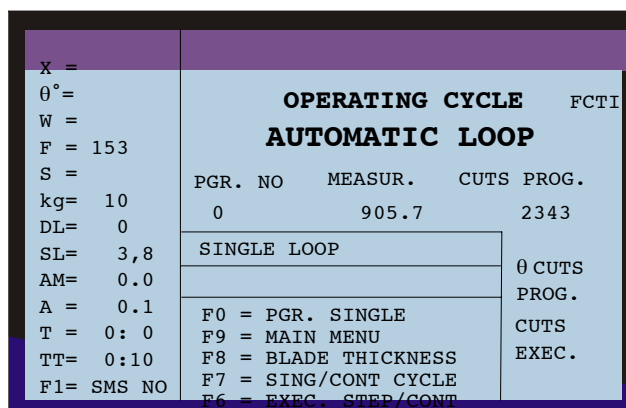

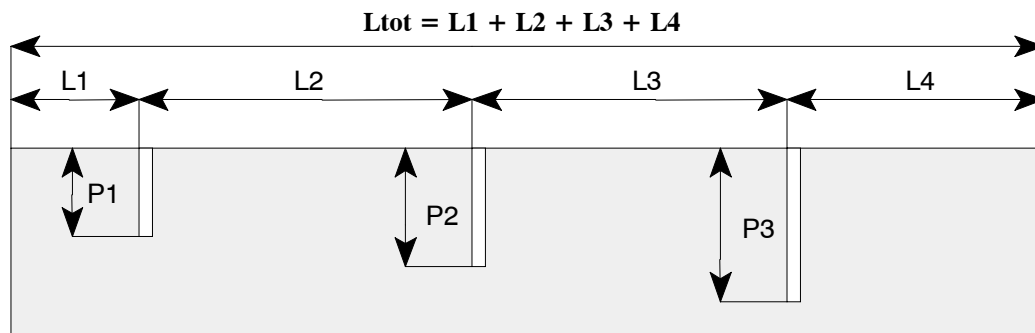

- ▶ Prepare for cutting as if for an automatic cycle (see the instructions in the relevant paragraph).
- ▶ Set cutting parameters as indicated in the automatic cycle paragraph, for programme data and technological machine control parameters.
- ▶ By pressing run/prog. programming is accessed. Press the F1 button, to programme cuts.
- ▶ Key in the values for each field and confirm each piece of data input by pressing ENTER.

PROGRAMMING CUTS	
PROGRAMME N°=	1
MEASUREMENT=	100
N° OF CUTS =	1
θ° CUT =	0° 0'
WIDTH =	45.5

- ▶ When ENTER is pressed again, the screen for the second LOOP programme appears. Proceed to input the data for further programmes. When completed, press RUN/PROG. Press the F3 key on the programming screen, which relates to LOOP PROGRAMME SELECTION.


PROGRAMMING CUTS	
PROGRAMME N°=	2
MEASUREMENT=	100
N° OF CUTS =	1
θ° CUT =	0° 0'
WIDTH =	45.5

- All that remains to be done, is that the sequence of execution of cutting programmes is to be established. Key in the programme numbers, to correspond to the letters, confirming each one by pressing ENTER.

A	B	C	D	E	F	G	H
<b>1</b>	12	16	17	18	20	23	21
I	J	K	L	M	N	O	P
29	30						
Q	R	S	T	U	V	W	Z
AA	BB	CC	DD	EE	FF	GG	HH
LOOP NR. = 99							


- Also key in the number of LOOPS if using a continuous work cycle. Press RUN/PROG. to proceed.
- The display screen will show the parameters of the first program set. Pressing START the machine is reset and performs the initial cut before starting the LOOP. Then the supply unit places the material of the length set in the first program and the head descends to execute the cut. PROGRAMMING FCTA will appear on the display. Once the cutting depth has been reached, reset the head downstroke regulator by stopping the cutting head stroke; then press the Head Downstroke Limit (FCTA) memorizing button.
- Memorise the cut depth for the second programme and so on for all programmes selected. On completion of this operation the user can select whether the cuts should be carried out in single or continuous mode, by pressing F7.

# Diagrams, exploded views and replacement parts

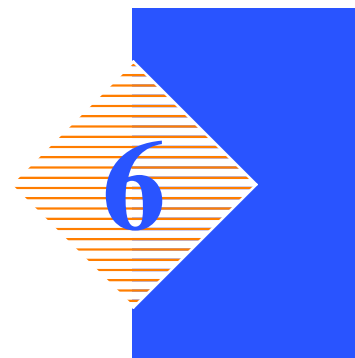

This chapter contains functional diagrams and exploded views of the **CNF 400 CNC**. This document is intended to help in identifying the location of the various components making up the machine, giving information useful in carrying out repair and maintenance operations; This chapter will also enable the user to order replacement parts with no risk of misunderstanding, as all parts are given codes.

## Pneumatic diagram CNF 400 CNC

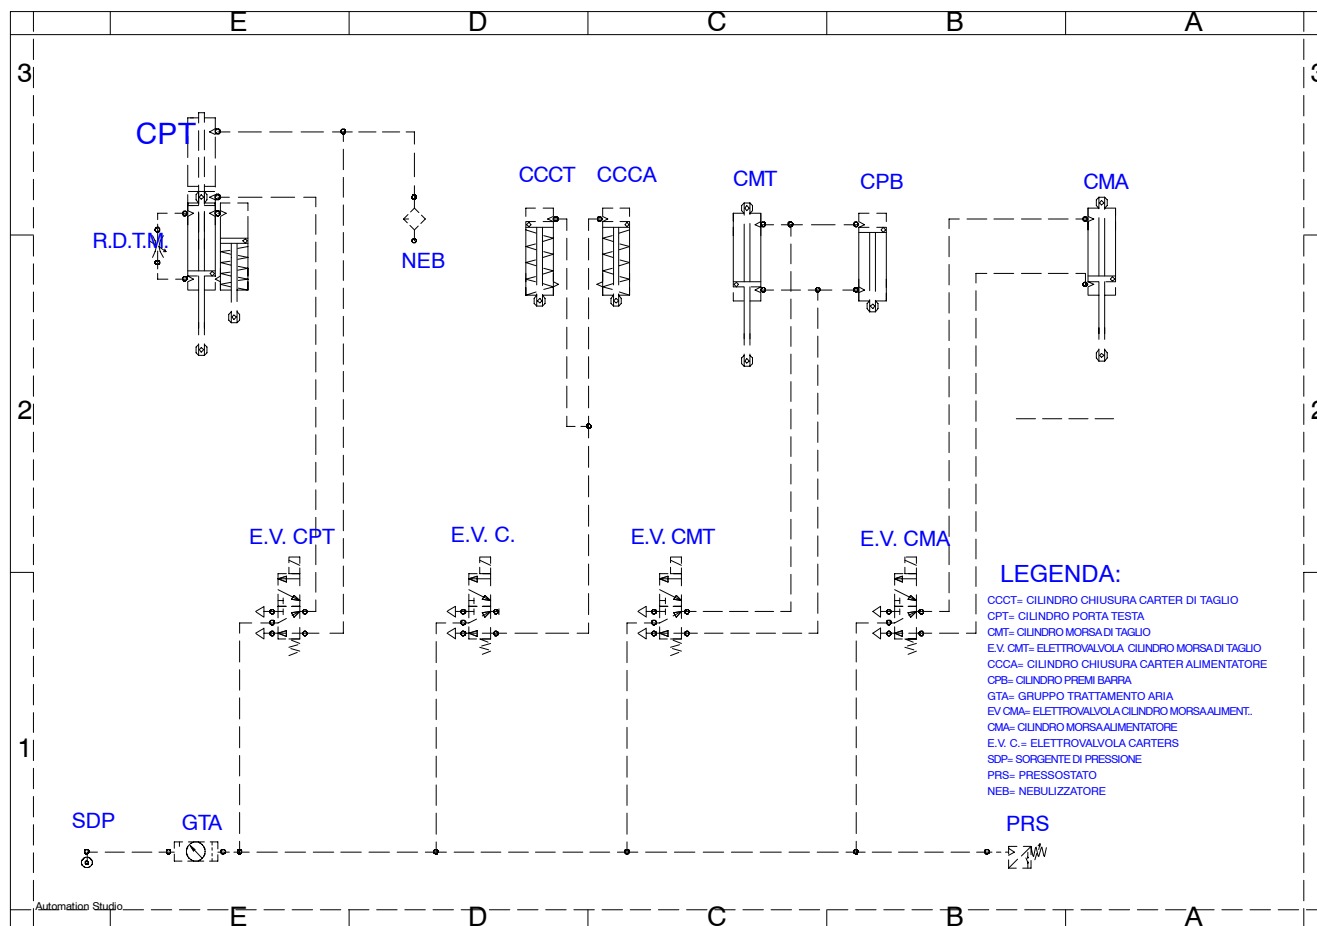

## APS/P drive for step motors

### FOREWORD

This drive allows you to control a step motor, using the input steps (STEP-IN). The motor completes one step on the LOW-HIGH transition of this signal. When the DIRECTION input is connected to +12 Vdc/+24 Vdc the motor will turn clockwise. When it is disconnected, or connected to 0V the drive will turn anti-clockwise.

When the ENABLE input is connected to +12 Vdc/+24 Vdc the drive is disabled (current on motor = 0) resulting in the rotation of the motor being interrupted. When it is disconnected, or connected to 0 V, the drive will be re-enabled and the motor will be energised after at least 1 step is started.

When the CURRENT REDUCTION input is connected to +12 Vdc/+24 Vdc the current on the motor will be reduced. When it is disconnected or connected to 0V the current will be returned to the regular level.

The rate of acceleration/deceleration, the current, and the step division, can be adjusted using the dip-switches and trimmers on the card (see tables).

The two outputs allow the machine to display if the drive is protected (READY\_OUT) and if positioning in progress has finished (BUSY).

### CHARACTERISTICS

CUT	APS3/P
VDC NOM. [V]	40-80
VDC MAX. [V]	90
VDC MIN. [V]	30
I MAX. [A]	10
I MIN. [A]	1
I PASSO [A]	0.5
Operating temperature [°C]	0-55

### MEANING OF THE PARAMETERS IN THE TABLE

- **Vdc nom:** Nominal voltage at which the drive can be powered.
- **Vdc max:** Maximum voltage at which the drive can operate, where this limit is exceeded the protection intervenes, inhibiting the operation of the drive itself.
- **Vdc min:** Minimum voltage at which the drive can operate. When the voltage drops below this limit, the protection intervenes, inhibiting the operation of the drive itself.
- **I max:** Maximum value for the phase current.
- **I min:** Minimum value for the phase current.
- **I step:** Difference between the settable current values.
- **Operating temperature:** Forced ventilation is necessary for currents exceeding 6A.

### TECHNICAL CHARACTERISTICS – APS/P DRIVE

<b>Power supply</b>	Terminal Name: + HV (Positive power supply) GND (0 V)
<b>Engine connection</b>	PHASE A1 = Phase A1 of the step motor PHASE A2 = Phase A2 of the step motor PHASE B1 = Phase B1 of the step motor PHASE B2 = Phase B2 of the step motor



TECHNICAL CHARACTERISTICS – APS/P DRIVE	
<b>Outputs</b>	Of a PNP optoinsulated type “open collector” (10 mA max)
	Also optoinsulated, so an external power supply (+12V/+24V) must be connected to the terminal common to the optoinsulators (Pin 12 connector J2). Maximum current for each output (10 mA).
<b>Inputs</b>	Of a PNP type (from 12 Vdc to 24 Vdc)
	Not optoinsulated: jumper JP1 –inserted Pin 12 of connector J2 –connected to +15V auxiliary (pin 21 connector J2) (common input optoinsulators)
	Optoinsulated: jumper JP1 –not inserted Pin 18 on connector J2 –connected to GND of outside power supply (common input optoinsulators)
<b>Protections and safety devices</b>	Protections against short circuits: – between outputs – between outputs and the positive power supply terminal If one of the conditions above occurs, the drive will disable the power bridge, and display the error conditions on the screen: “u” = wrong power supply voltage value “t” = thermal protector intervention “c” = max. current protector intervention. due to a short circuit across the phases, or excess current. If the drive is not disabled by a protective device, the display will indicate the letter “r” (ready).
	Thermal protection against overheating
	Mains undervoltage and overvoltage safety devices
INPUTS	
SIGNAL	FUNCTION
DISABLE	Disables the power bridge (current on motor=0)
CURRENT REDUCTION	Reduces the current on the motor. The percentage reduction can be set at from 25% to 50% of the regulated current using dip A1.
DIRECTION	Select the direction of rotation. The signal must remain stable for at least 50 microseconds before and 50 microseconds after the low–high transition of the STEP–IN signal.
STEP–IN	The motor carries out a step on the low–high transition of this signal. It is preferable to use a square wave with a duty–cycle of 50 %. The absence of this signal for 0,5 sec determines the automatic reduction of the current (stand–by condition). The percentage reduction for stand–by can be set at 25% or 50% of the regulated current, using dip A1.
OUTPUTS	
OUT1 BUSY	BUSY: this open collector output indicates if the drive is busy positioning or if it is at the correct level. Drive at level: low level. Drive occupied: high level.
OUT2 DRIVE_READY	DRIVE_READY: this open collector output indicates if the drive is ready or if a protection device has intervened. Drive protected: low level. Drive ready: high level.

### RATE ADJUSTMENT

It is possible to set the rate of acceleration/deceleration for the motor from a minimum of 1 ms to a maximum of 2 s (the time indicated refers to an acceleration from 1 Hz to 10 KHz), using the DIP A 3–6.

Rate value table				
DIPA 3	DIPA 4	DIPA 5	DIPA 6	RAMPA [ms]
OFF	OFF	OFF	OFF	1
OFF	OFF	OFF	ON	10
OFF	OFF	ON	OFF	20
OFF	OFF	ON	ON	30
OFF	ON	OFF	OFF	50
OFF	ON	OFF	ON	70
OFF	ON	ON	OFF	100
OFF	ON	ON	ON	150
ON	OFF	OFF	OFF	200
ON	OFF	OFF	ON	300
ON	OFF	ON	OFF	400
ON	OFF	ON	ON	500
ON	ON	OFF	OFF	800
ON	ON	OFF	ON	1000
ON	ON	ON	OFF	1500
ON	ON	ON	ON	2000

### SETTING DIVISIONS OF MOTOR STEPS

It is possible to set the division of the motor steps using DIP–SWITCHES B 2 and 3.

DIP SWITCH B		
DIPB 2	DIPB 3	STEP DIVISION
ON	OFF	Complete Step (200 steps/rev)
ON	ON	<b>Half Step (400 steps/rev)</b>
OFF	OFF	Quarter Step (800 steps/rev)
OFF	ON	Eighth of a Step (1600 steps/rev)

### ADJUSTING THE CURRENT

To adjust the current:

- Position DIP B–4 to the ON position (current adjustment mode).
- Rotate trimmer RV6 until the screen displays the current required (clockwise to increase).

Adjustment range: from 1A to 10A step 0.5A.

- Return DIP B–4 to the OFF position (RUN mode).


VALUE DISPLAYED	CURRENT SET
1	1 A
5	5 A
5.	5.5 A
0	10 A
A	11 A
B	12 A

**N.B.** Adjust the current with the motor stopped.


## DIP-SWITCHES SUMMARY TABLE

DIP SWITCH A		
DIP	ON	OFF
6	Set Rate	Set Rate
5	Set Rate	Set Rate
4	Set Rate	Set Rate
3	Set Rate	Set Rate
2	Not used	Not used
1	Reduction of current in stand-by mode to 50% of set current	Reduction of current in stand-by mode to 25% of set current
DIP SWITCH B		
DIP	ON	OFF
4	Current adjustment mode	RUN mode
3	Step division setting	Step division setting
2	Step division setting	Step division setting
1	Not used	Not used

## SCHEMATIC CONFIGURATION OF INPUTS / OUTPUTS

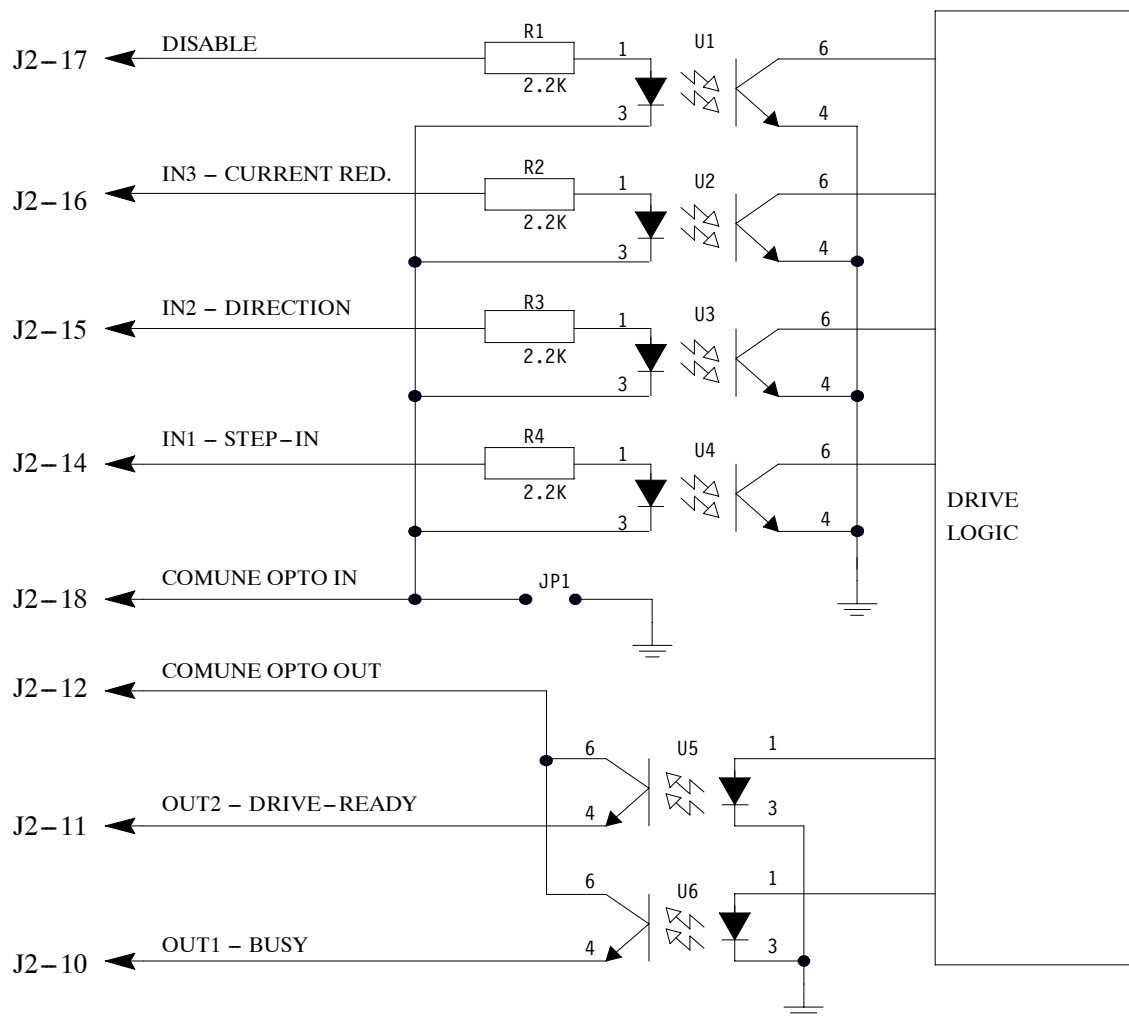

## LAYOUT OF APS/P DRIVE COMPONENTS

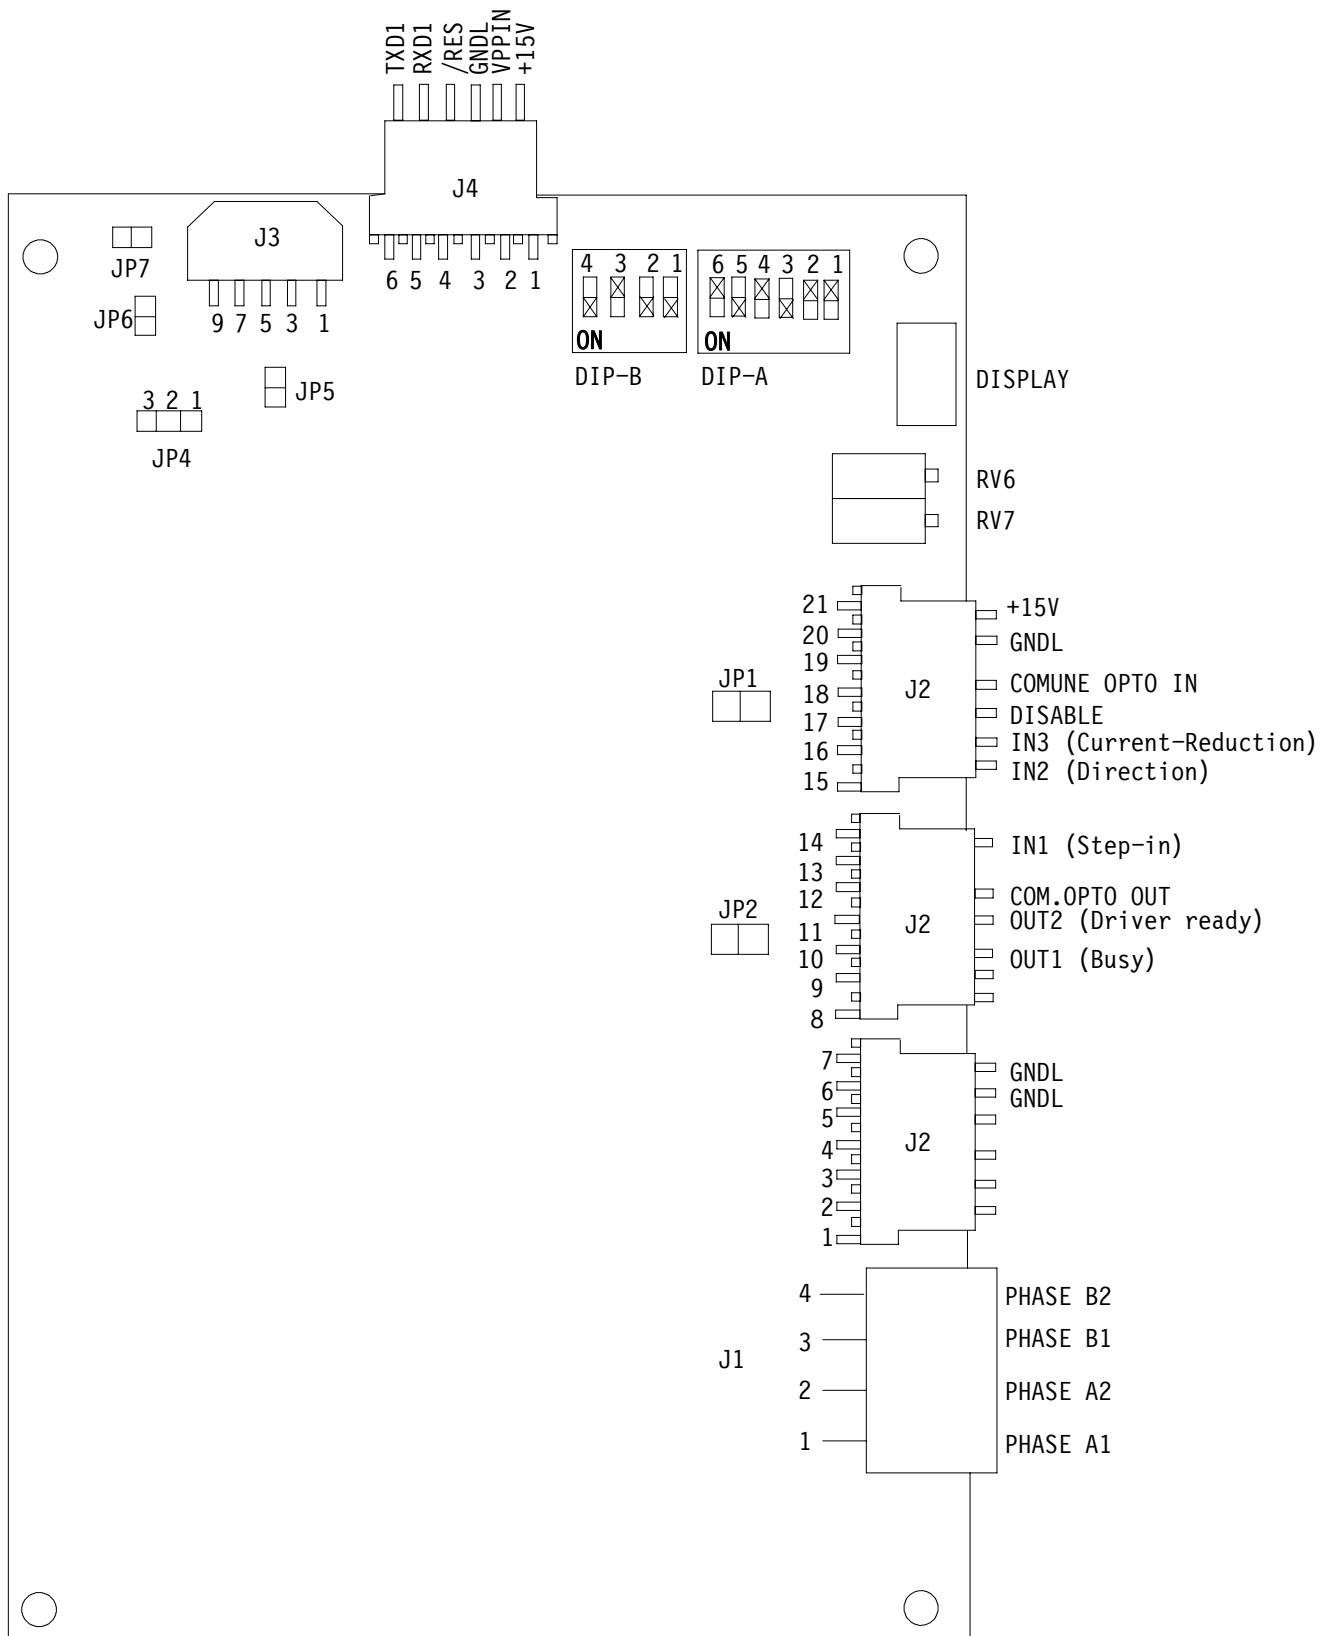


## How to read the wiring diagrams

With the introduction of the new standardised wiring diagrams, the following gives an illustration of the way in which they have been drawn up.

Each sheet of the project contains a box which gives the following information:

The numbers indicate the columns into which the entire drawing is divided

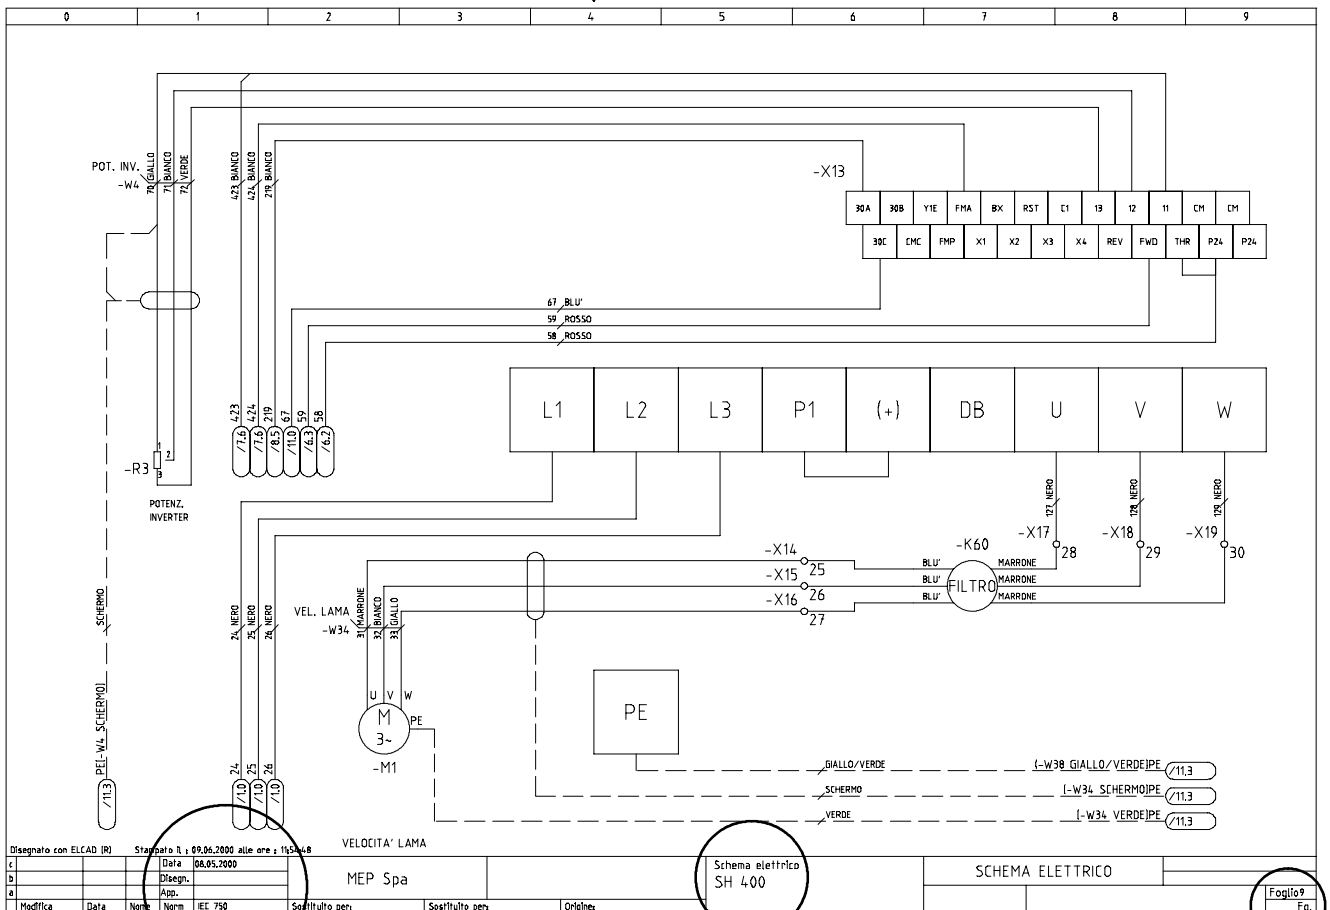

Schema elettrico  
SH 400

Indications of the  
model of machine

Data	08.05.2000
Disegn.	MARIO ROSSI
App.	
Norm	IEC 750

Indications of the date production  
started

Identification of the designer

Identification of the Reference Standard


Foglio 9
Fg. 1

Indication of the  
page number

Each component in the wiring diagram is identified by a unique alphanumeric identification code, in compliance with regulations:

The wire is identified by the code –W4

This symbol identifies the wire with its relative number and colour

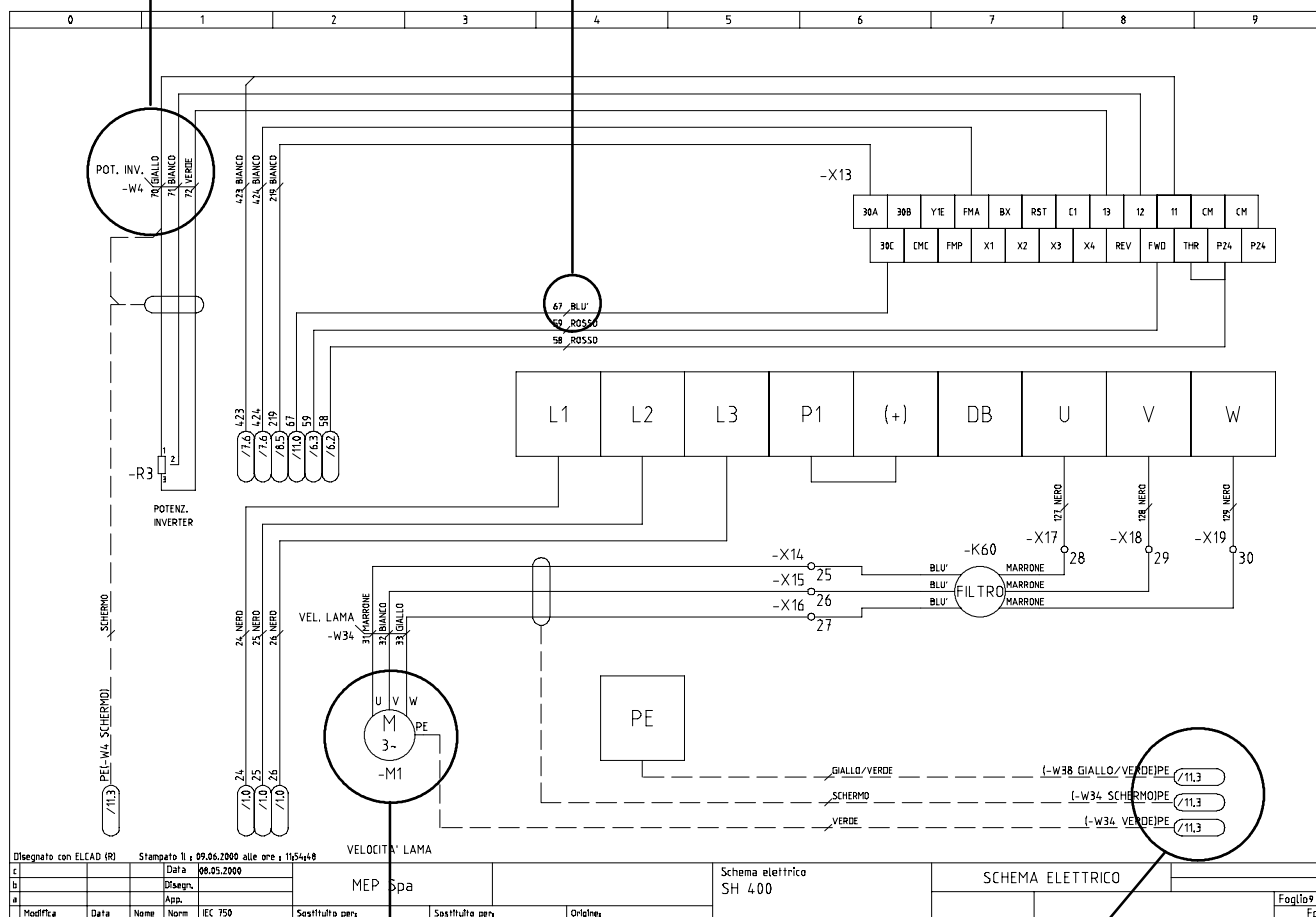

The motor is identified by the code –M1

These symbols, known as potentials, are used to provide page references: the first number indicates the page to be referred to, the second number, after the dot, identifies the column on that page; example /11.8 indicates that the wire continues on page no. 11 in column 8

The pages following the wiring diagrams contain the following lists:

1. components list (list of all components) and terminals list (list of all the terminals) with the following information:
  - ✓ in-house article code;
  - ✓ identification code;
  - ✓ reference, no. of the page and column on which it can be found;
  - ✓ description;
  - ✓ manufacturer.

ART. COD.	ID	PRES. REF	DESCRIPTION	MANUFACTURER
022.2151	-B1	/5.2	STRAIN GAUGE	DELTATEC

2. wires list (list of all wires) with the following information:

- ✓ in-house article code;
- ✓ identification code;
- ✓ description;
- ✓ section of wire (mm<sup>2</sup>);
- ✓ colour of wire;
- ✓ start: indicates the component (identification code and contact number) at which the wire starts;
- ✓ end: indicates the component (identification code and contact number) at which the wire ends; e.g.

CODE	CABLE	DESCRIPTION	SECTION	NO.	COLOUR	START		END	
022.0141	-W7	RESET+EMER-GENZA	0.50	317	BIANCO	-S3	4	-K10	14

In this example, wire no. 317 white, identified as -W7, starts from contact no. 4 on component -S3, and ends at contact no. 14 on component -K10.

Enclosed below is Appendix D2 to European Standard EN 60204-1

### D2-Letter codes used to designate the type of component


LETTER	TYPE OF COMPONENT	EXAMPLES	IDENTIFICATION OF THE APPLIANCE
A	Complex units	Laser Maser Regulator	A
B	Transducers converting a non electrical signal to an electrical signal and vice versa	Transistor amplifier IC amplifier Magnetic amplifier Valve amplifier Printed circuit board Drawer Rack	AD  AJ AM AV AP AT AR
C	Capacitors		C
D	Binary operators, timing devices, storage devices	Digital integrated circuits and devices: Delay line Bistable element Monostable element Recorder Magnetic memory Tape or disk recorder	D
E	Various materials	Devices not specified in this table	E
F	Protective Devices	Lightning protectors Arrestors	F
		Instant action current threshold protector	FA
		Delayed action current threshold protector	FR
		Instant and delayed action current threshold protector	FS
		Fuse	FU
		Voltage threshold protector	FV


LETTER	TYPE OF COMPONENT	EXAMPLES	IDENTIFICATION OF THE APPLIANCE
G	Generators, feeders	Rotating generators Crystal oscillators	G
		Accumulator battery Rotating or static frequency converter Power feeder	GB GF GS
H	Signaling Devices	Buzzer Optical signal, indicator light device	HA HL
J			
K	Relays, Contactors	Instant all or nothing relays or instant contactors Bistable relays or interdependent contactors (All or nothing contactors with mechanical contact or permanent magnet etc.) Contactors Polarised relays Reed relays All or nothing timed relays (timers)	KA  KL  KM KP KR  KT
L	Inductors, reactors	Inductor Stop coil Reactor	L
M	Motors		M
N	Analogue integrated circuits	Operational amplifiers Hybrid analog/digital appliances	N
P	Measurement equipment, test devices	Indicator, recorder and integrator measurement devices Signal generators	P
Q	Power circuit switching appliances	Automatic switch Engine saver switch Knife switch	QF QM QS
R	Resistors	Fixed or variable resistor (rheostat)	R
S	Command or control devices	Selector or switch Button (including electronic proximity switch) Numerical all or nothing sensors (single step) of mechanical and electronic type: – Liquid level sensor – Pressure sensor Position sensor (including proximity) – Rotation sensor – Temperature probe	SA  SB  SL SP  SQ SR ST
T	Transformers	Current transformer Control circuit supply transformer Power transformer Magnetic stabiliser Voltage transformer	TA  TC TM TS TV




LETTER	TYPE OF COMPONENT	EXAMPLES	IDENTIFICATION OF THE APPLIANCE
U	Modulators, converters	Discriminator Demodulator Frequency converter Coder Converter Inverter Telegraphic repeater	U
V	Electronic pipes, semiconductors	Electronic pipe Gas discharge pipe Diode Transistor Thyristor	V
W	Transmission lines, wave guides, antennas	Conductor Cable Bar Wave guide Wave guide directional coupler Dipole Parabolic antenna	W
X	Terminals, sockets, plugs	Connector bar Test plug Plug Socket Terminal connector band	XB XJ XP XS XT
Y	Electrically operated mechanical appliances	Electromagnet Electromagnetic brake Electromagnetic clutch Magnetic table spindle Electromagnetic valve	YA YB YC YH YV
Z	Transformers, impedance adapters, equalizers, band limiters	Line equalizer Compressor Crystal filter	Z

## 68

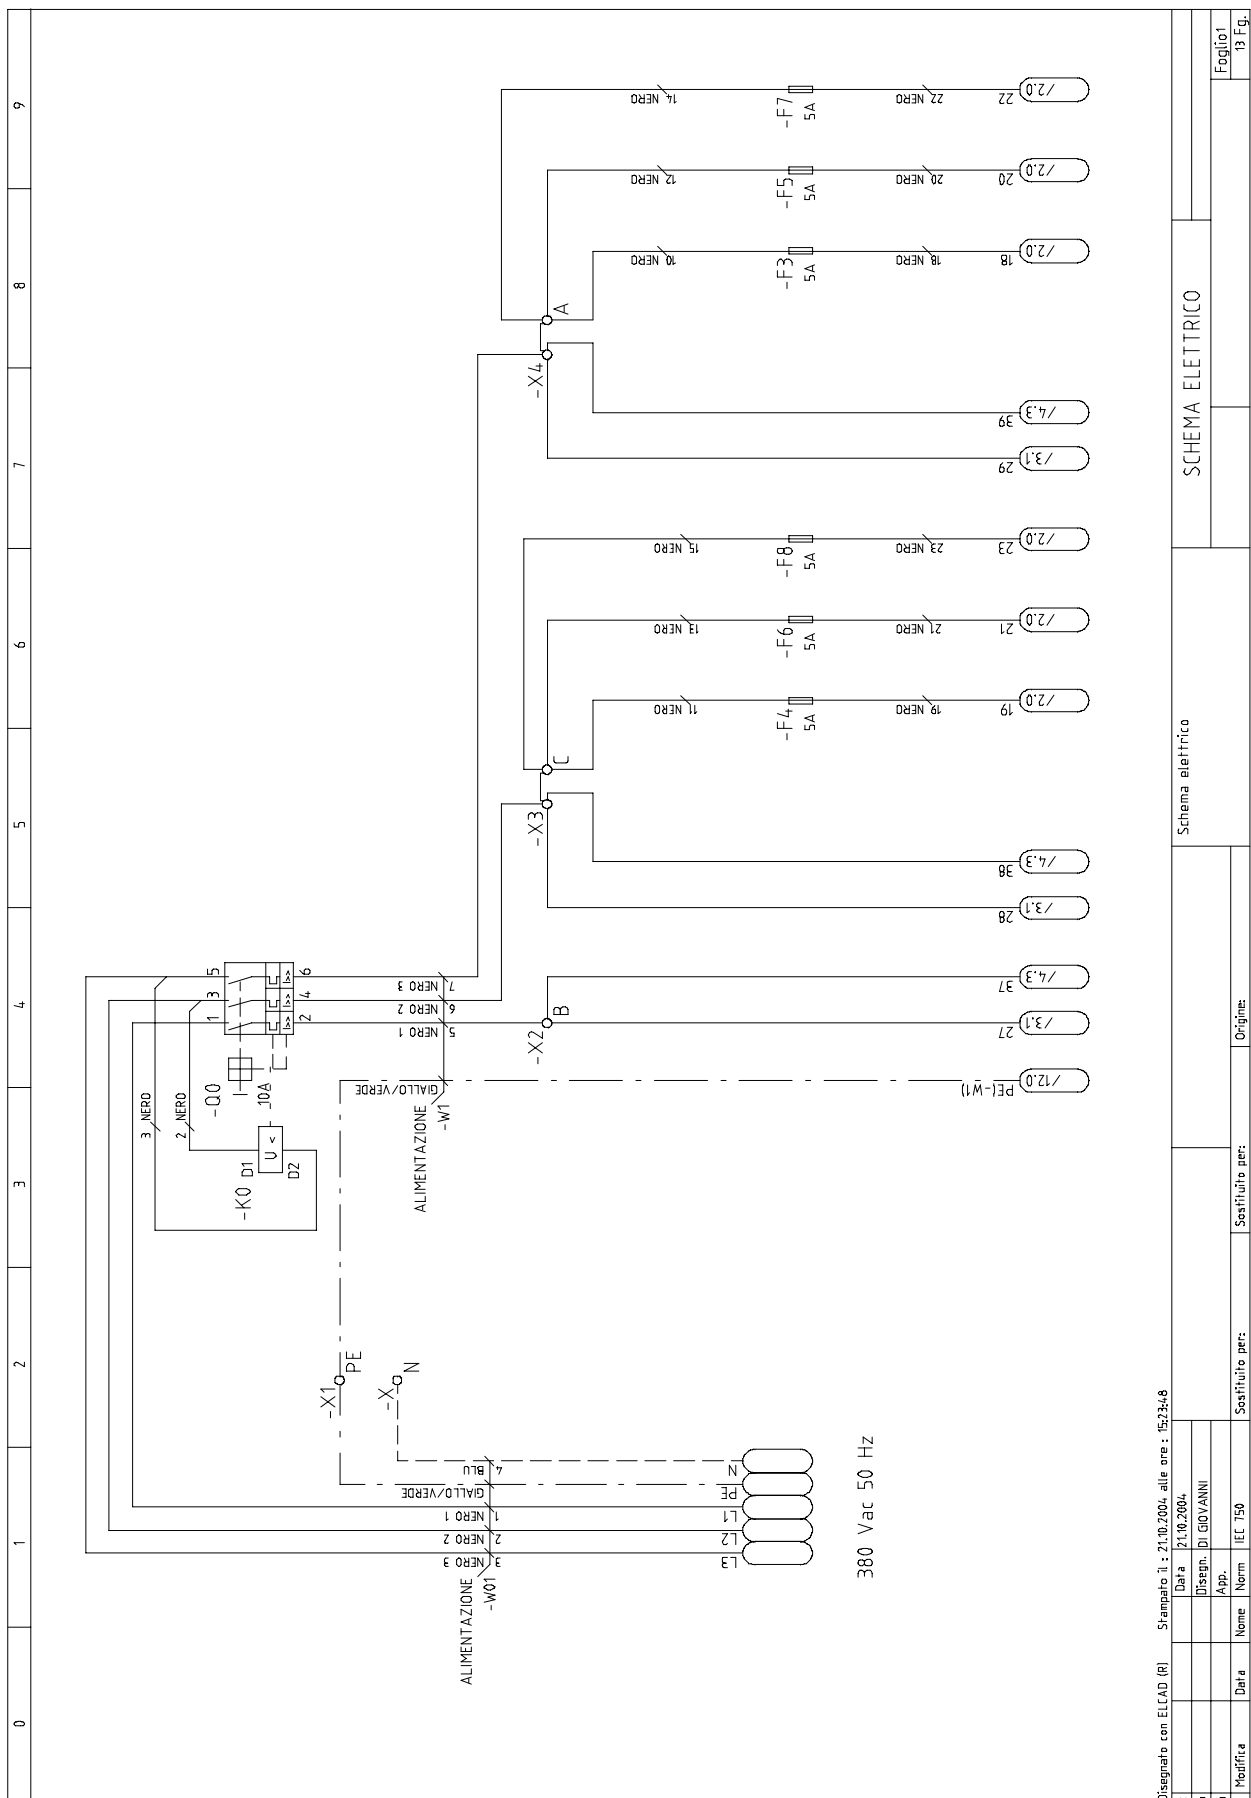

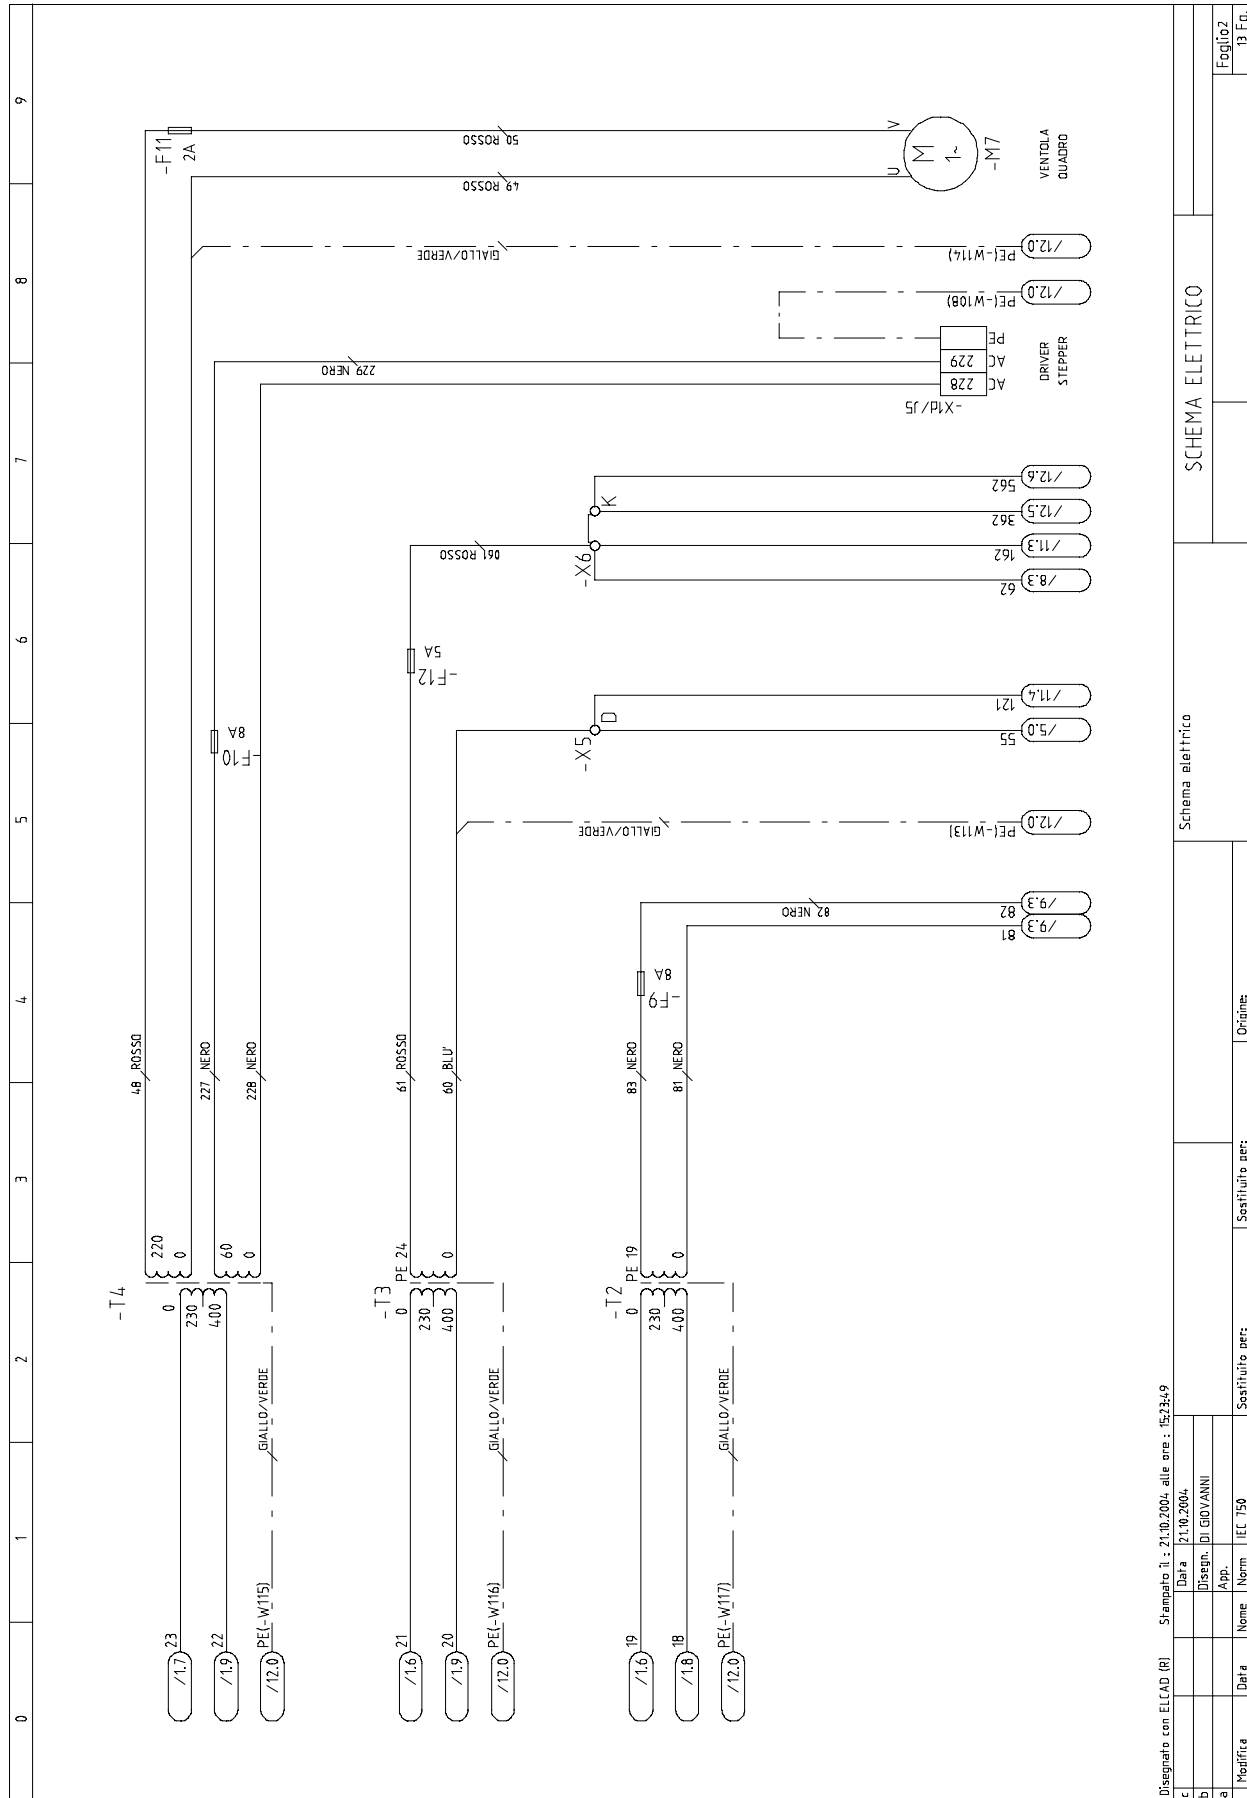


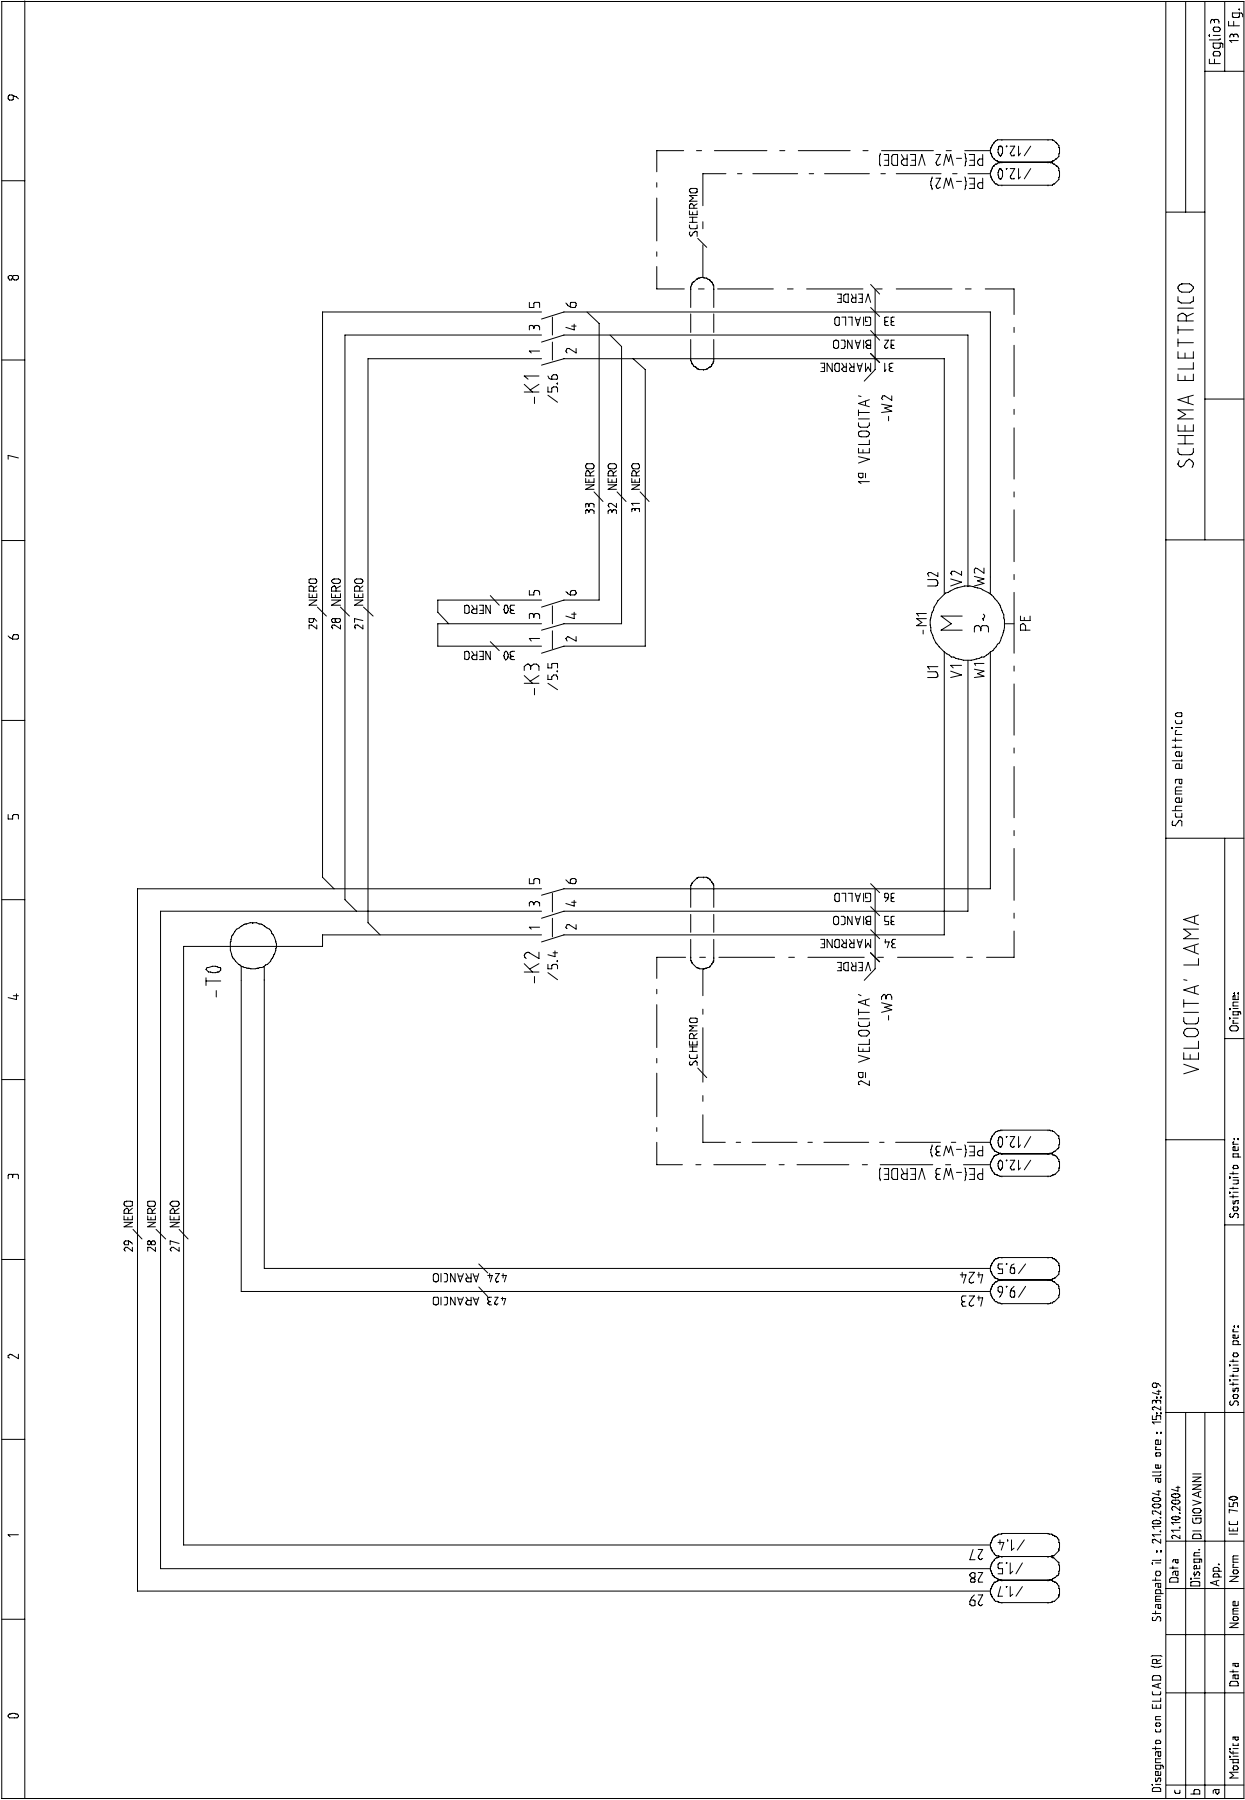









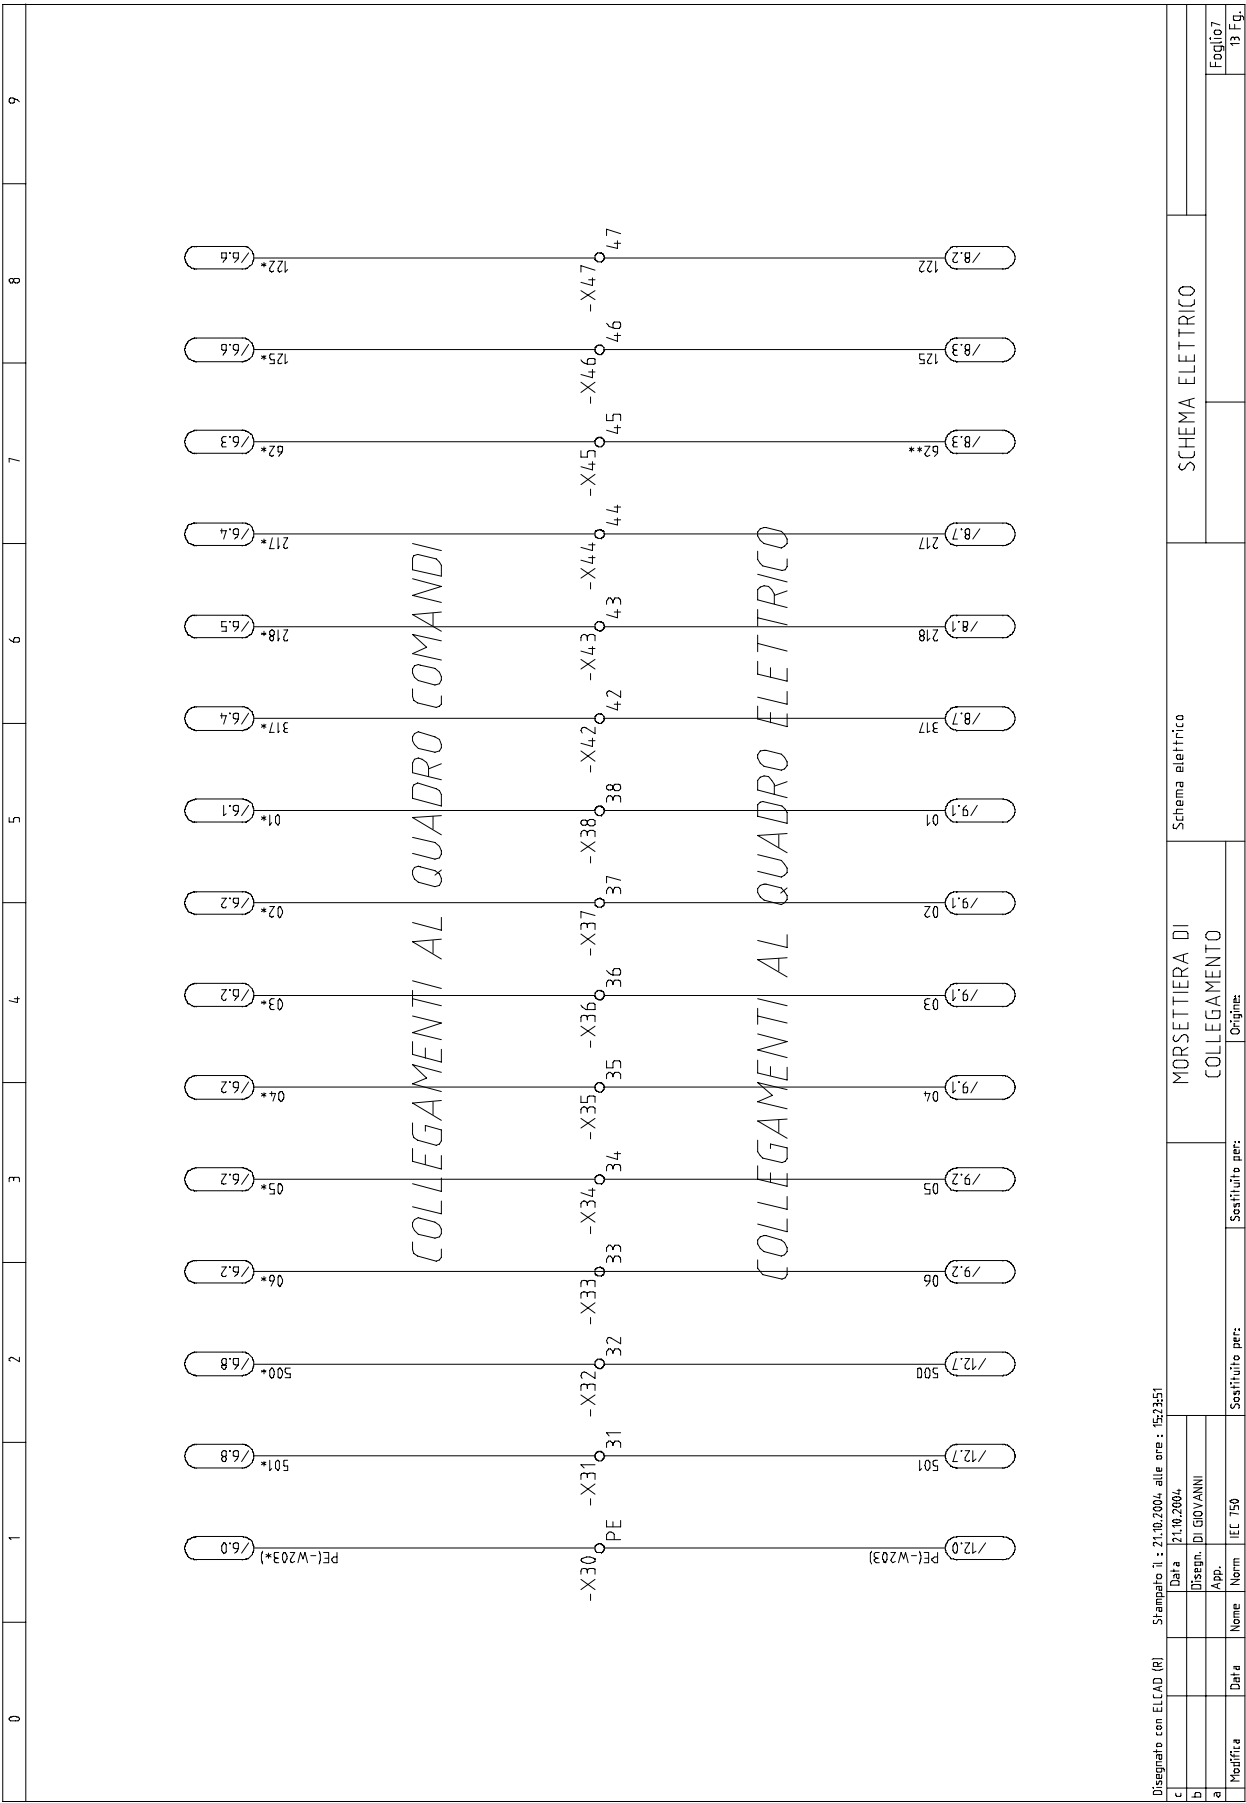




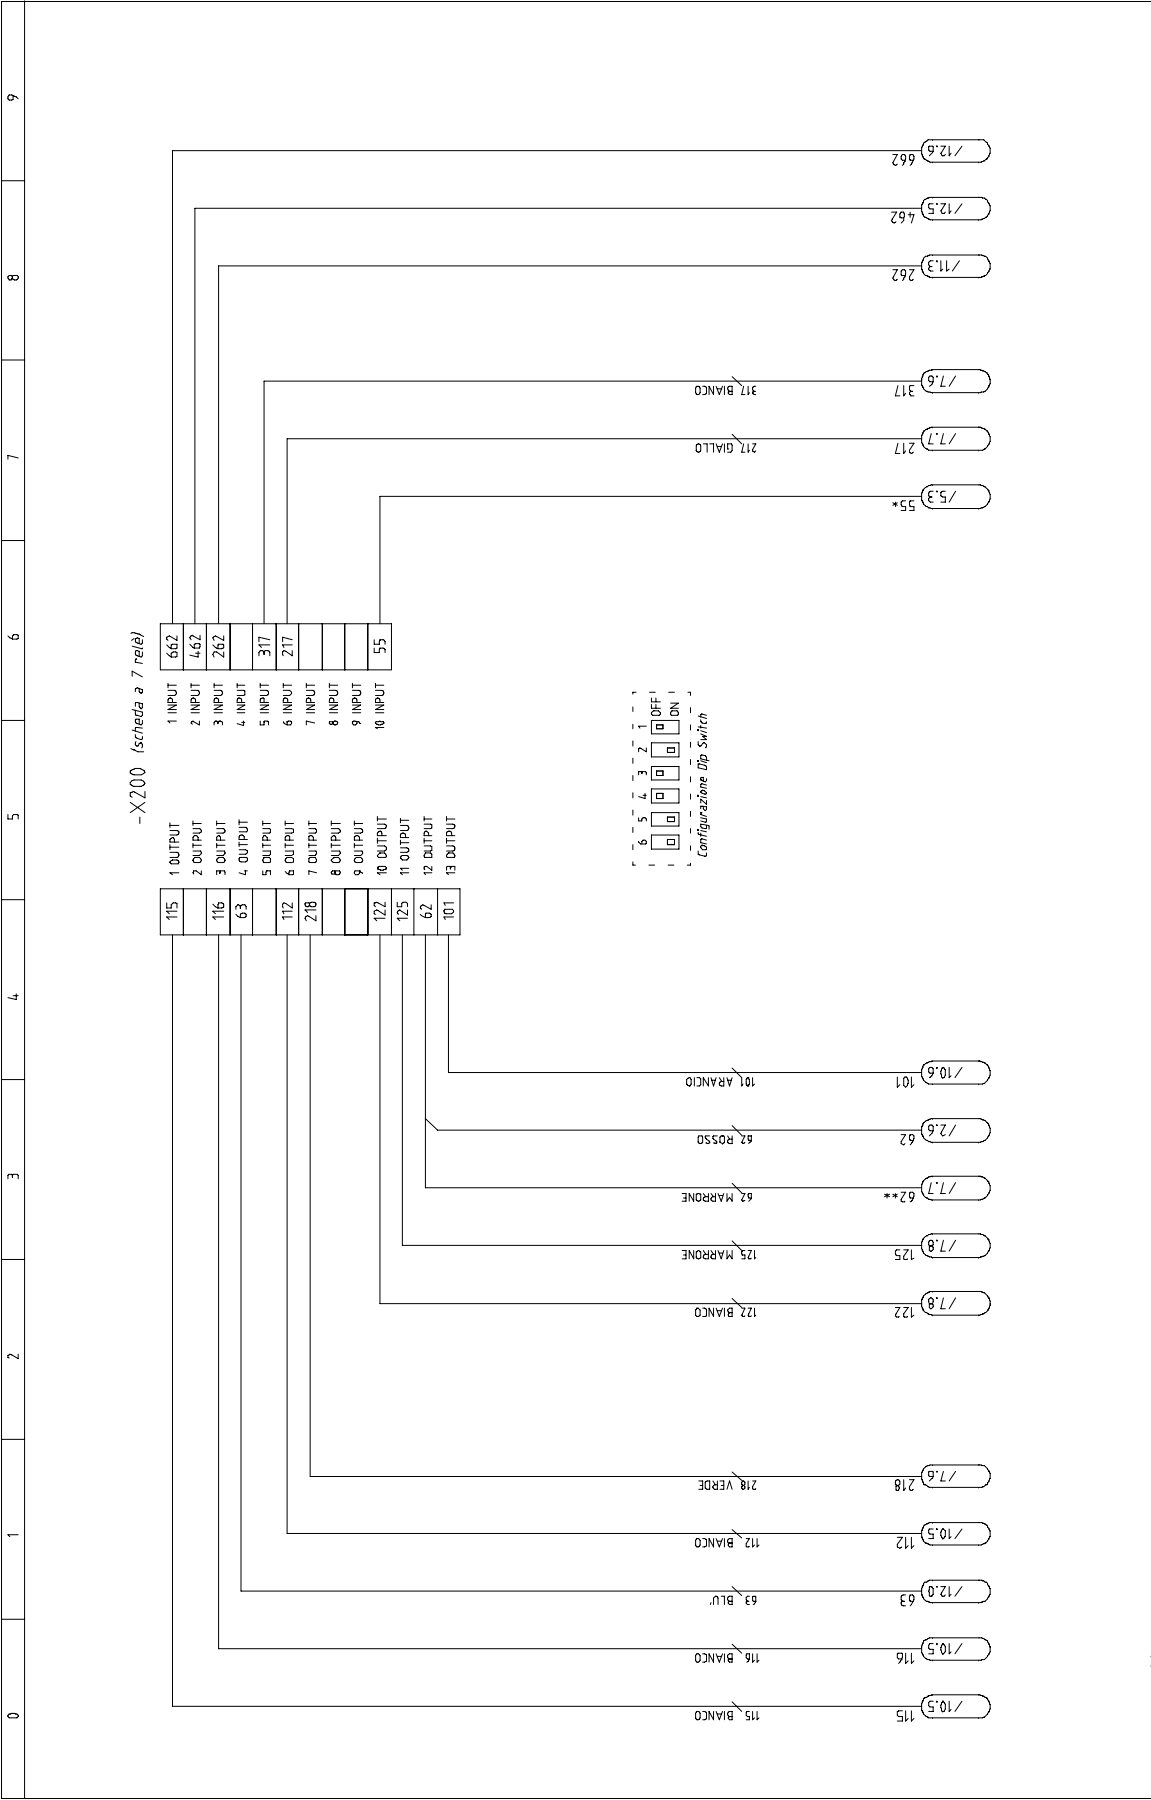



Disegnato con ELCAD (R)				Stampato il : 21.10.2004, alle ore : 15:23:51			
c		Data	21.10.2004	Schema elettrico			
b		Disegn.	DI GIOVANNI	EMERGENZE			
a		App.		Sostituito per:			
		Modifica	Data	None	Norm	IEC 750	Origine:
				Foglio 13 Fg.			

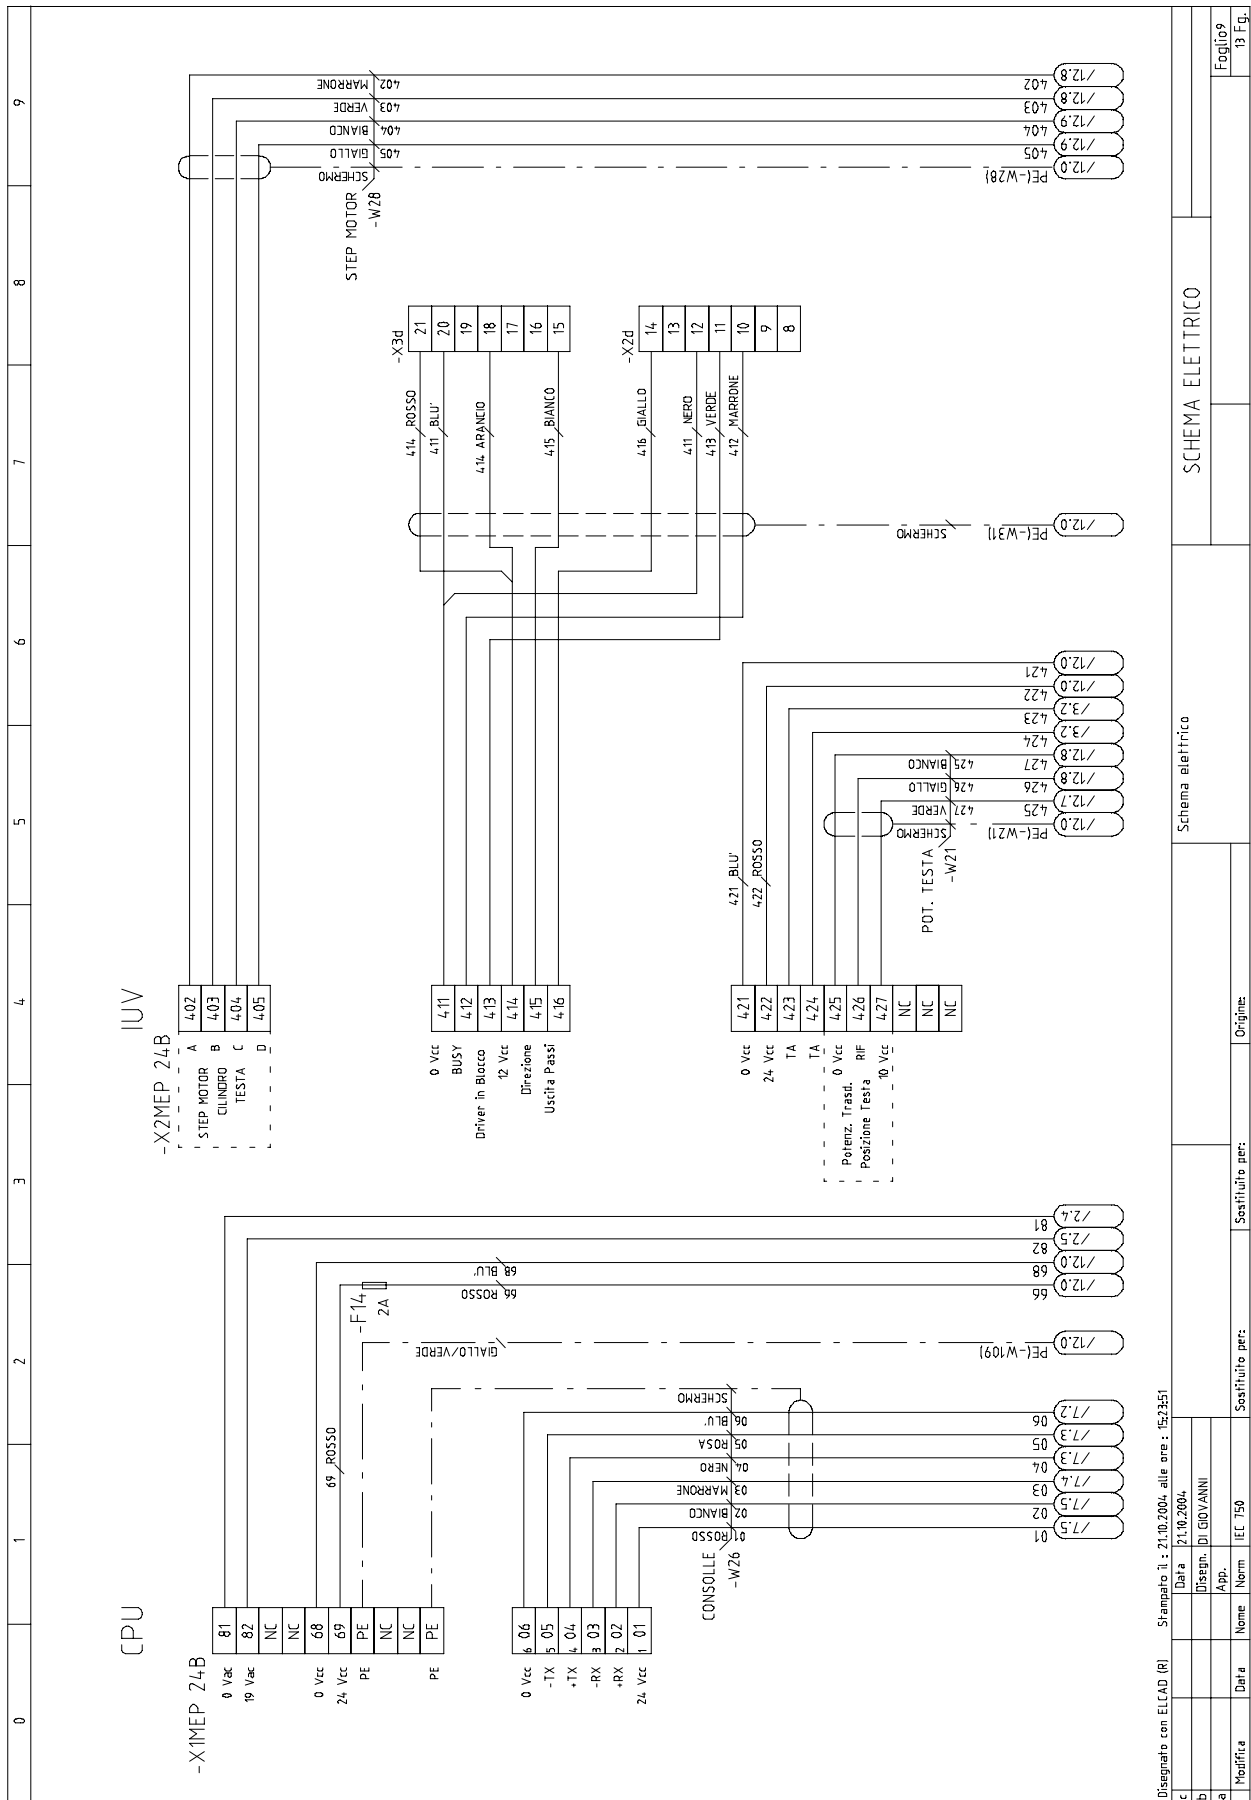

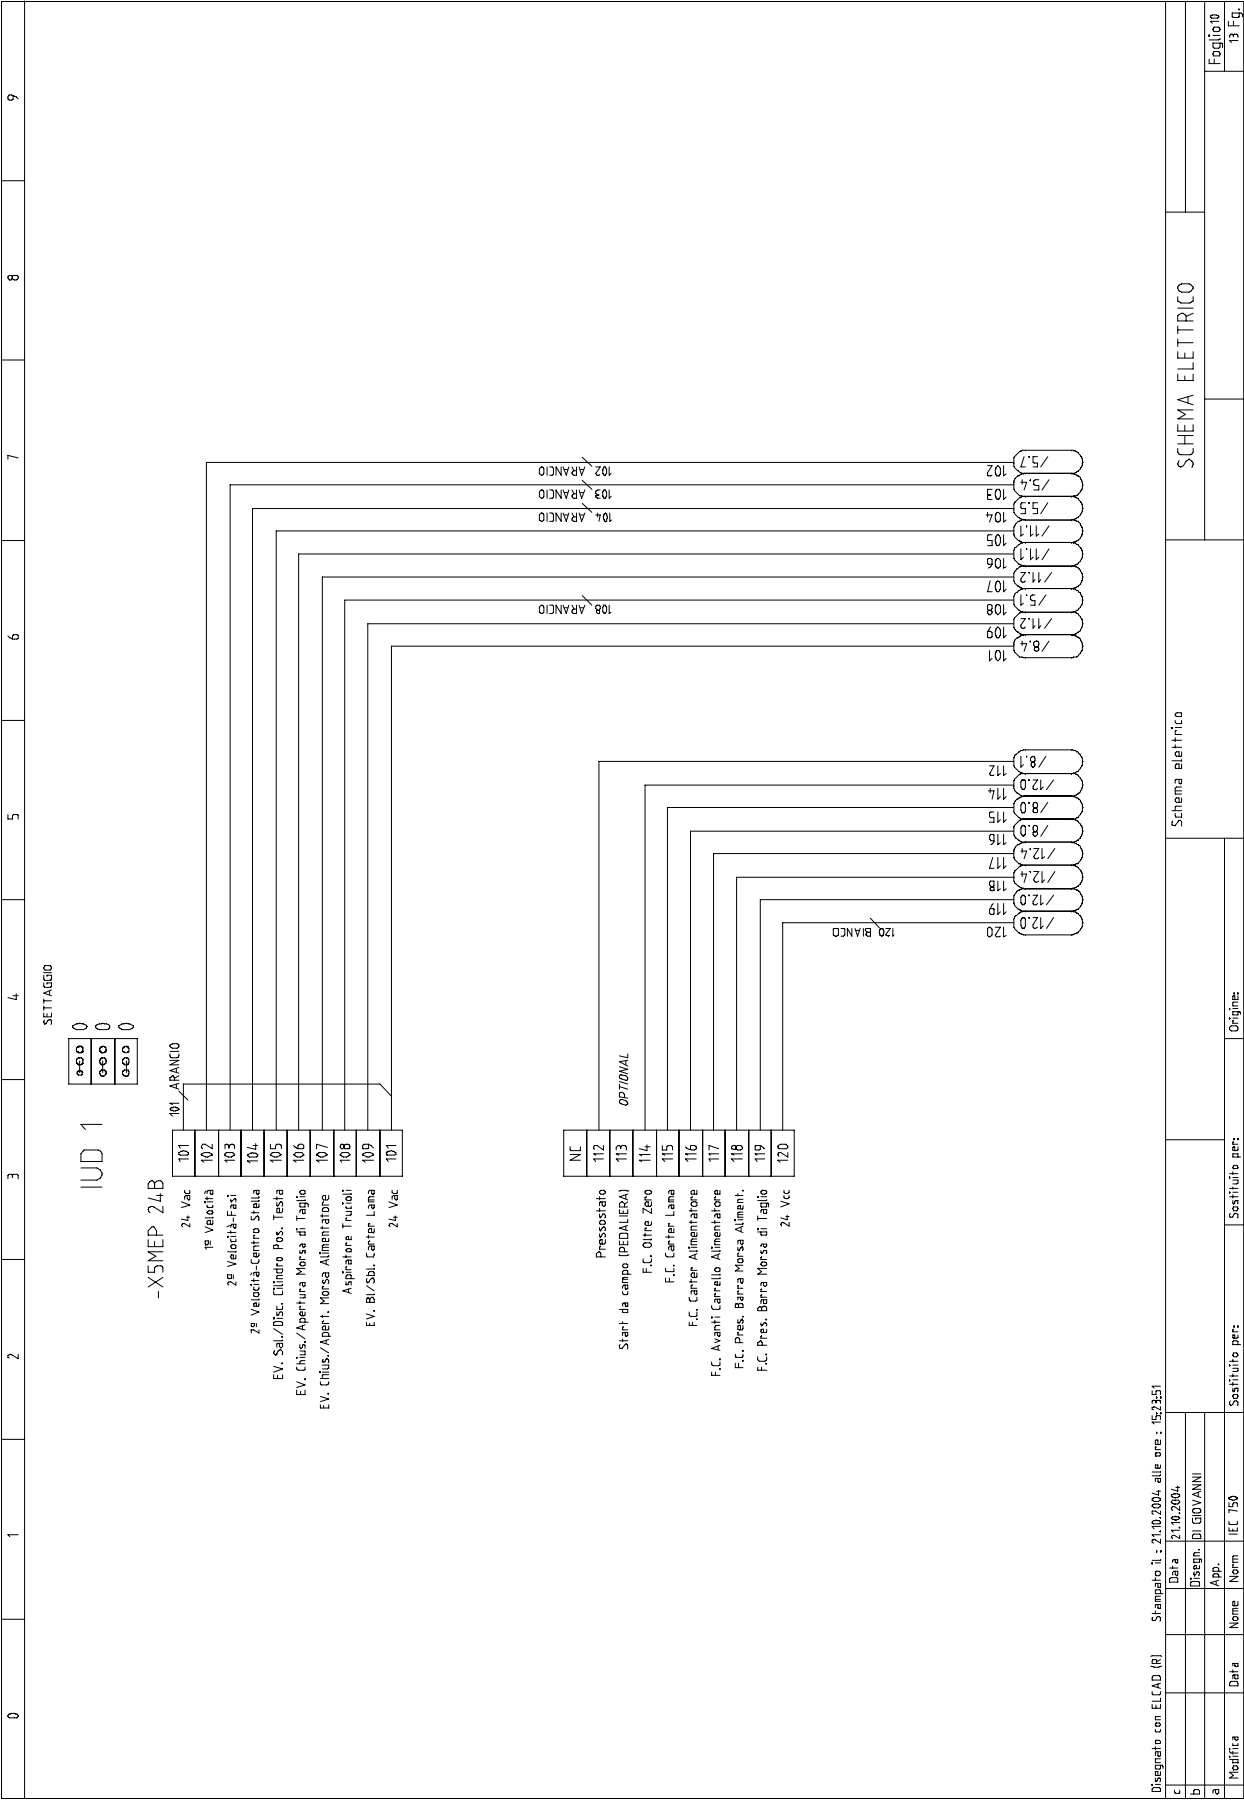



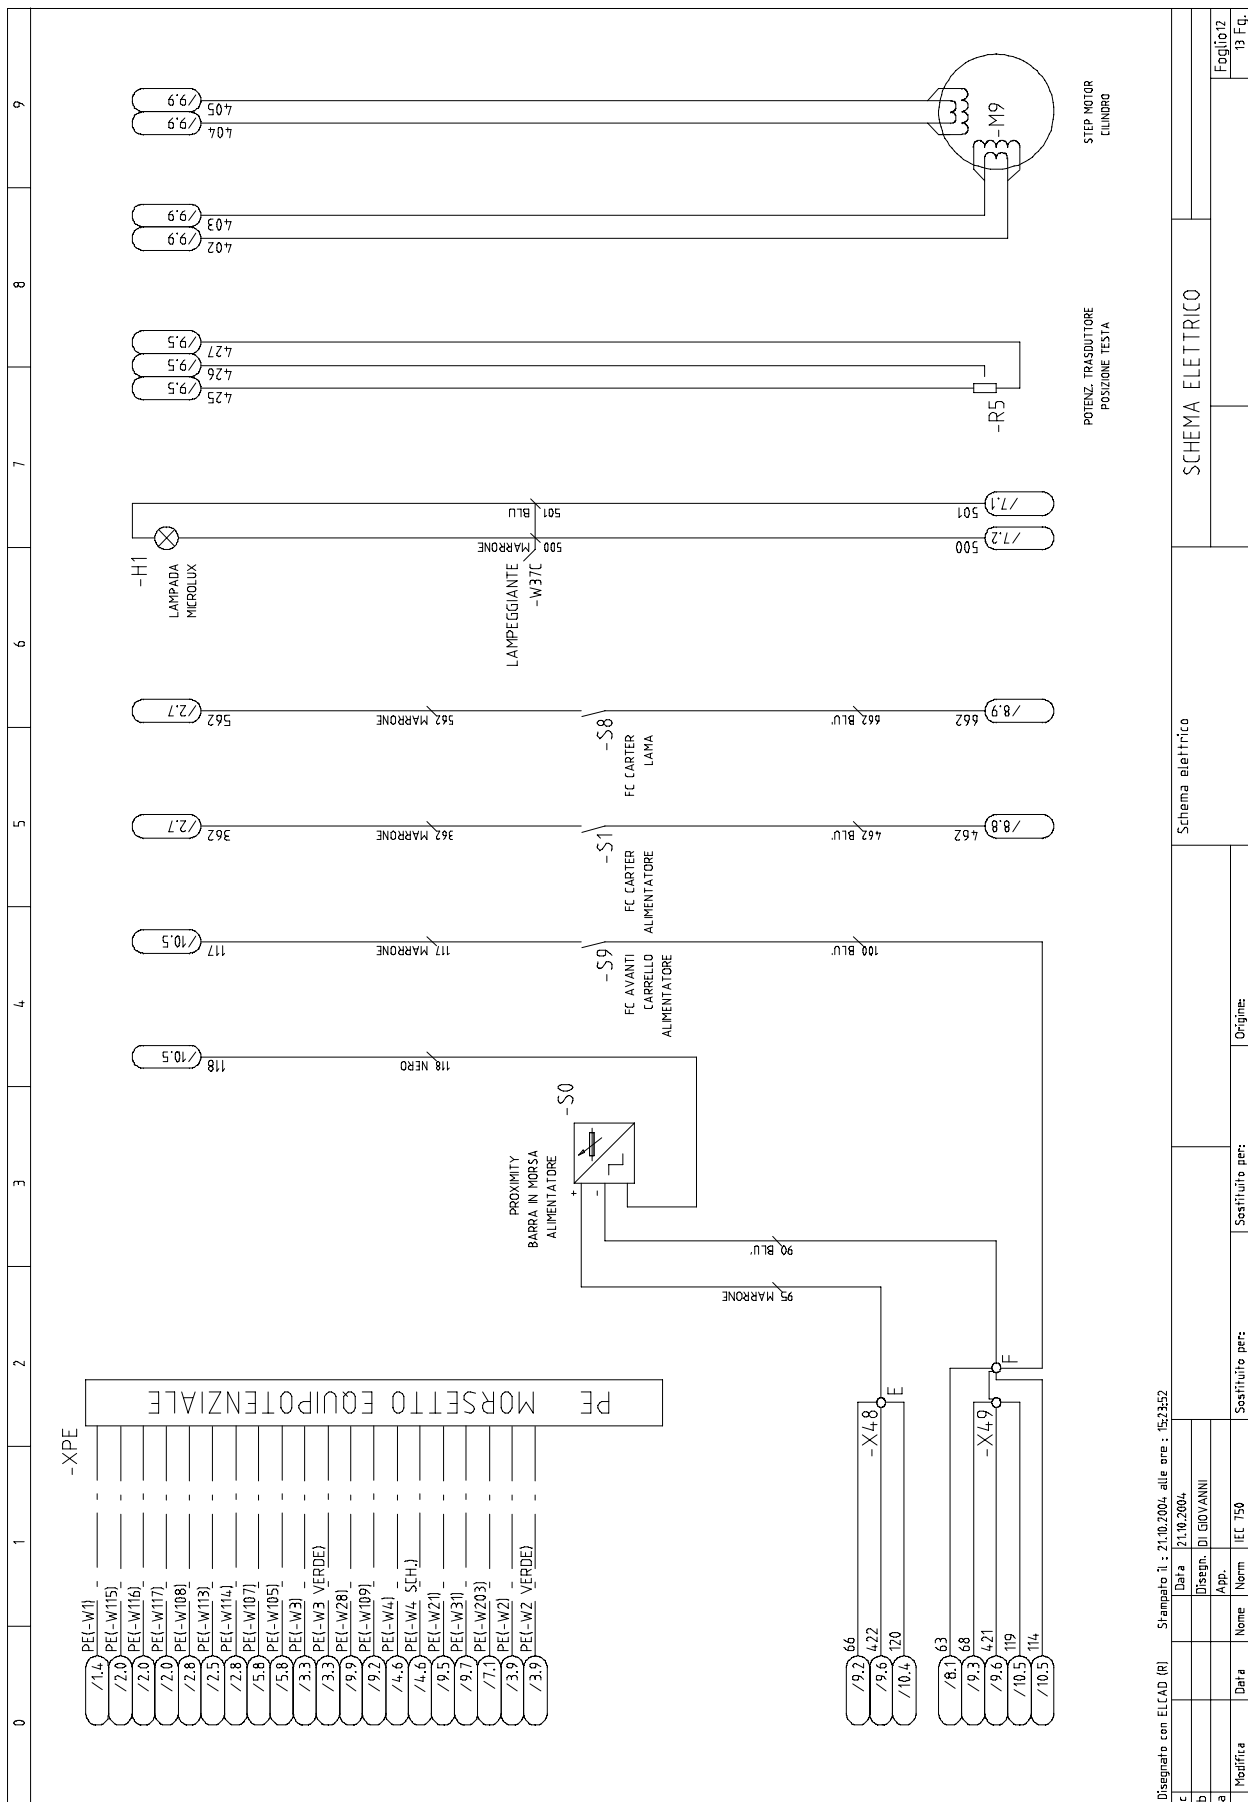


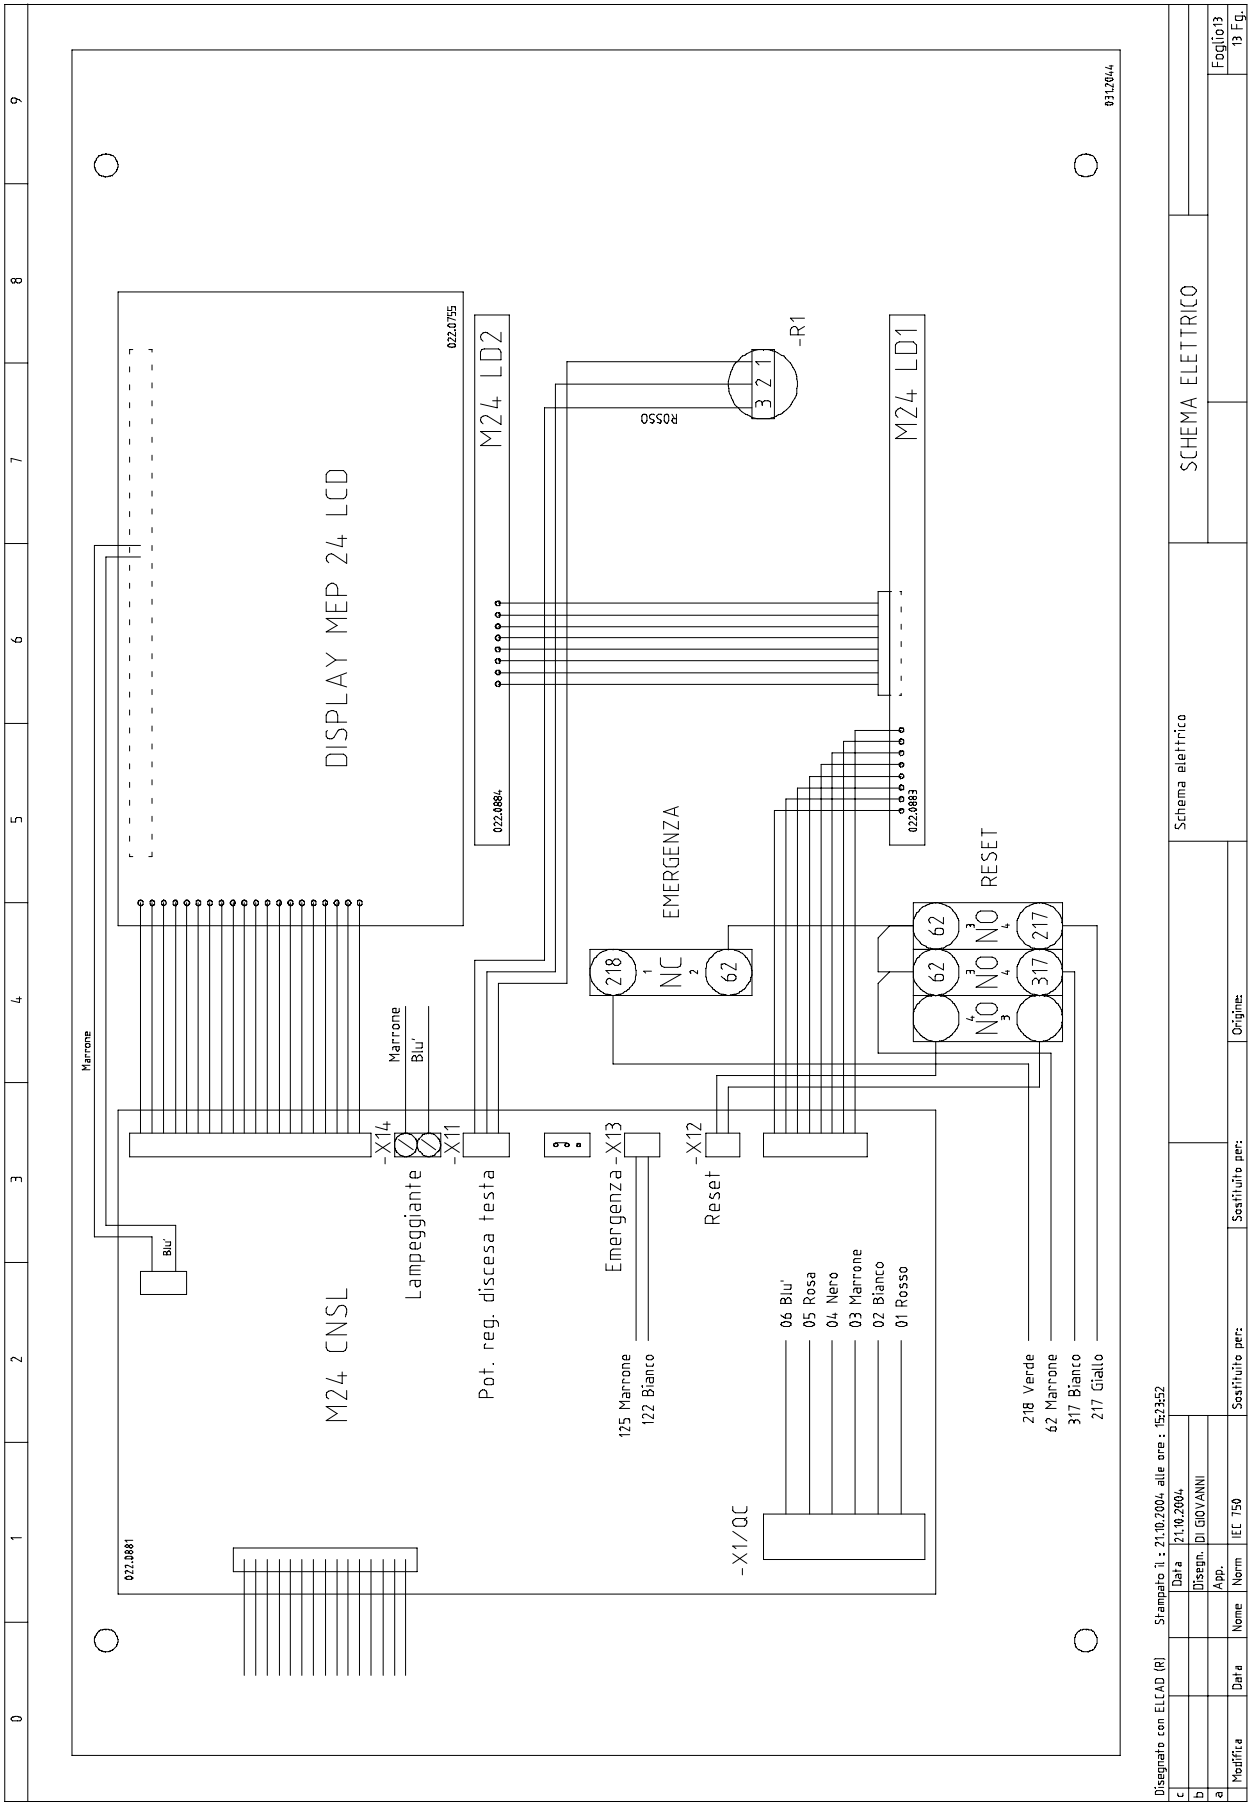

# List of IUD-IUV Card Inputs and Outputs


## IUD: Digital Inputs and Outputs

The following chart lists the Digital Inputs and Outputs of card 1.

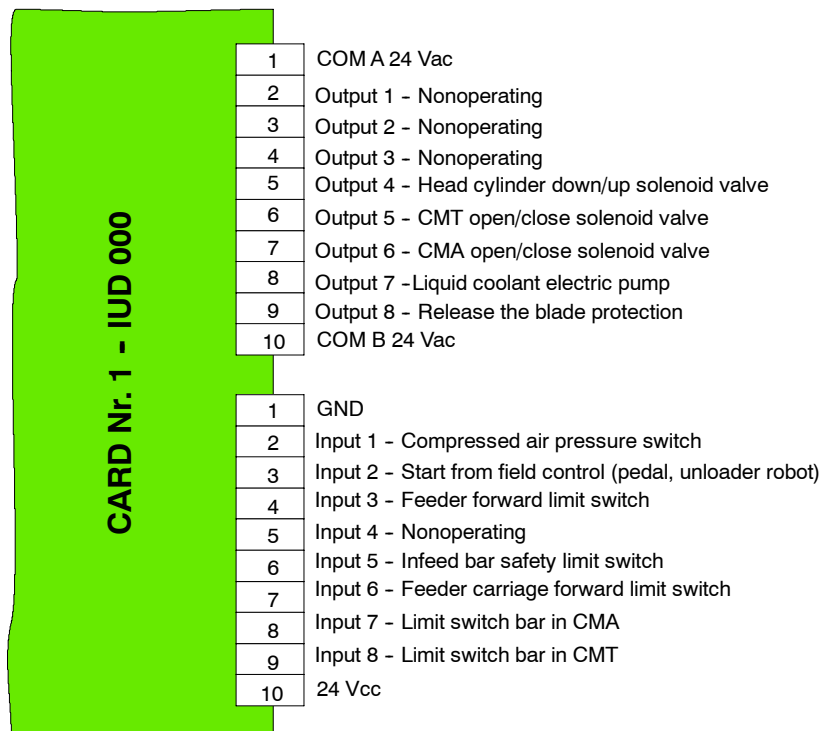

## IUV card: Miscellaneous Inputs and Outputs

The following chart lists the Miscellaneous Inputs and Outputs.

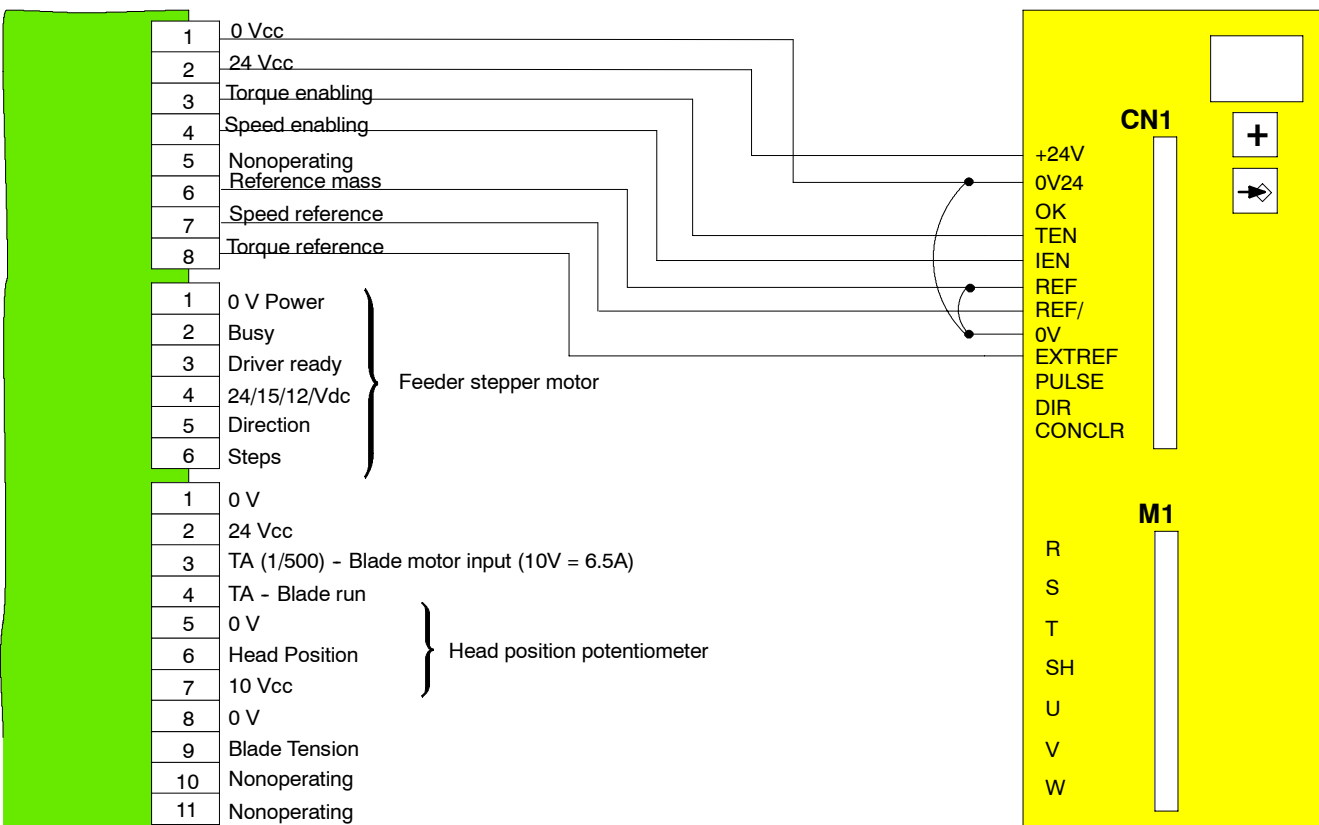


**CN 1 VICE**

<b>CN 1 VICE</b> <b>Vice with 12 poled coupling</b>		
<b>Pin N°</b>	<b>Signal</b>	<b>Signal description</b>
1	+V24	+24 Vdc power supply
2	0V24	Reference mass for the TEN, IEN isolated entrances
3	OK	Driver OK (10 Wmax – 100 Vmax – 100 mAmax). Exit relays indicating the state of the drive. – Contact closed at +24Vdc in normal functioning conditions. – Contact open in alarm conditions of the system
4	TEN	TORQUE ENABLE, signal of torque enabling Isolated digital entrance, active at +24Vdc. With the signal active the drive is enabled to provide torque to the motor. In absence of this signal the motor frees itself immediately.
5	IEN	INPUT ENABLE enabling signal of enabling of the speed reference. Isolated digital entrance, active at +24Vdc. With the signal active the drive enables the reading of the speed set–point present at the REF and REF/ analogical entrances. In absence of the signal the reading of the set–point is disabled and attributed to the value of 0V. With the motor in movement, the absence of the IEN signal causes the functioning motor to stop on the set ramp; the ramp ended the motor is held in torque and in position.
6	REF	External analogical reference signal $\pm 10V$ of the speed. Entrance not invertible
7	REF/	External analogical reference signal $\pm 10V$ of the speed Entrance invertible
8	0V	Reference mass of the REF, REF & EXTREF signals.
9	EXTREF	EXTERNAL TORQUE REFERENCE. Analogical entrance (0+10V) of torque limitations distributable to the motor: Entrance at 0V = no torque; Entrance not connected 0+10V = maximum torque
10	PULSE	Nonoperating
11	DIR	Nonoperating
12	CONCLR	Nonoperating



## CNSL card: Console Inputs and Outputs


The following chart lists the Miscellaneous Inputs and Outputs.

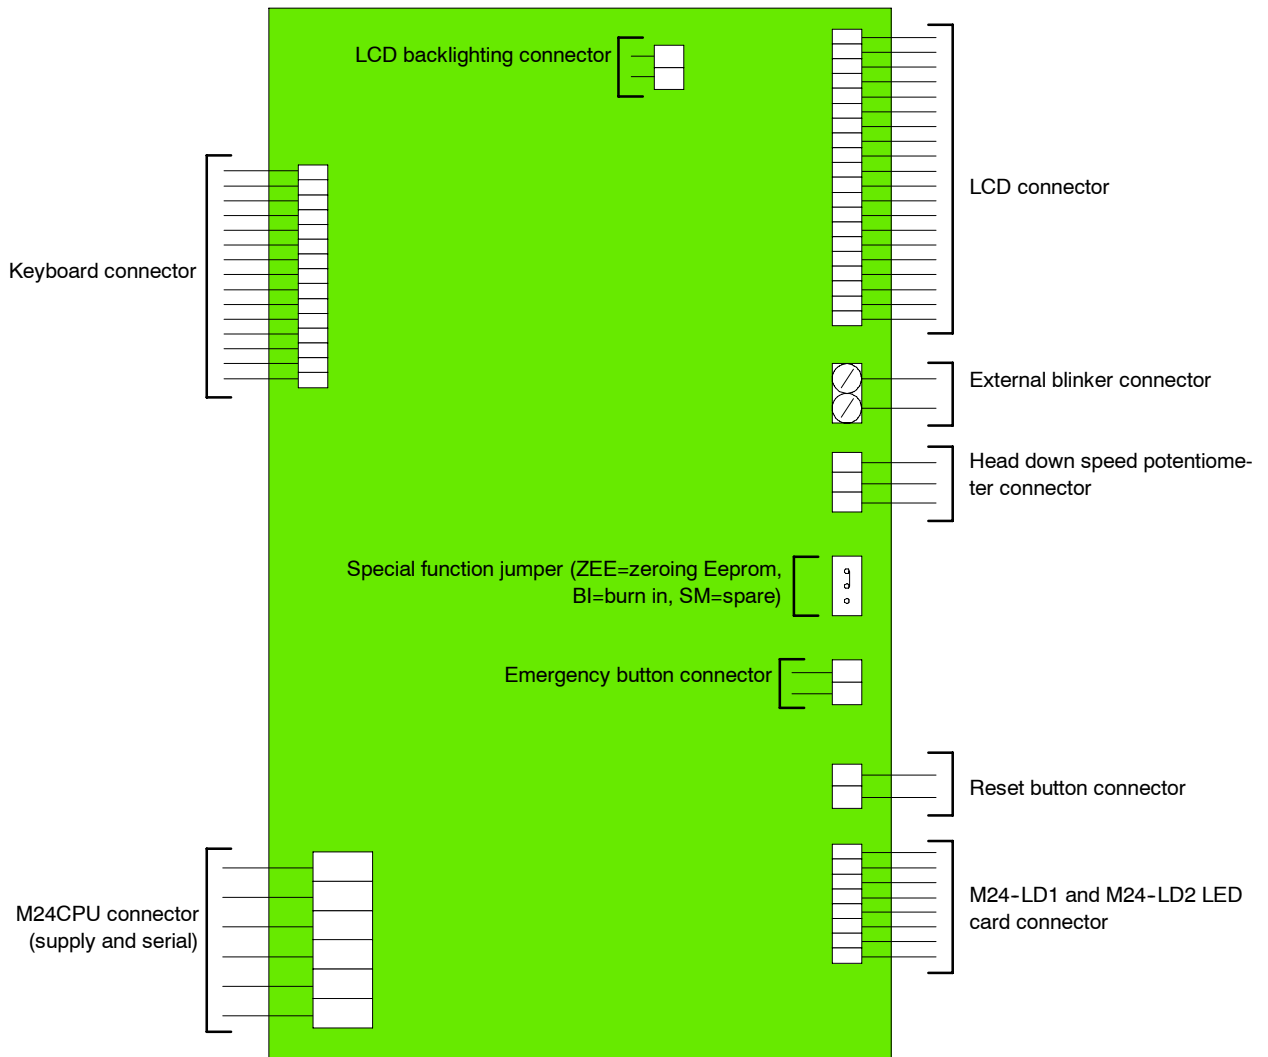

## Exploded views


This part of the manual contains detailed exploded views of the machine which can help to gain a deeper knowledge of how it is made.

### Base

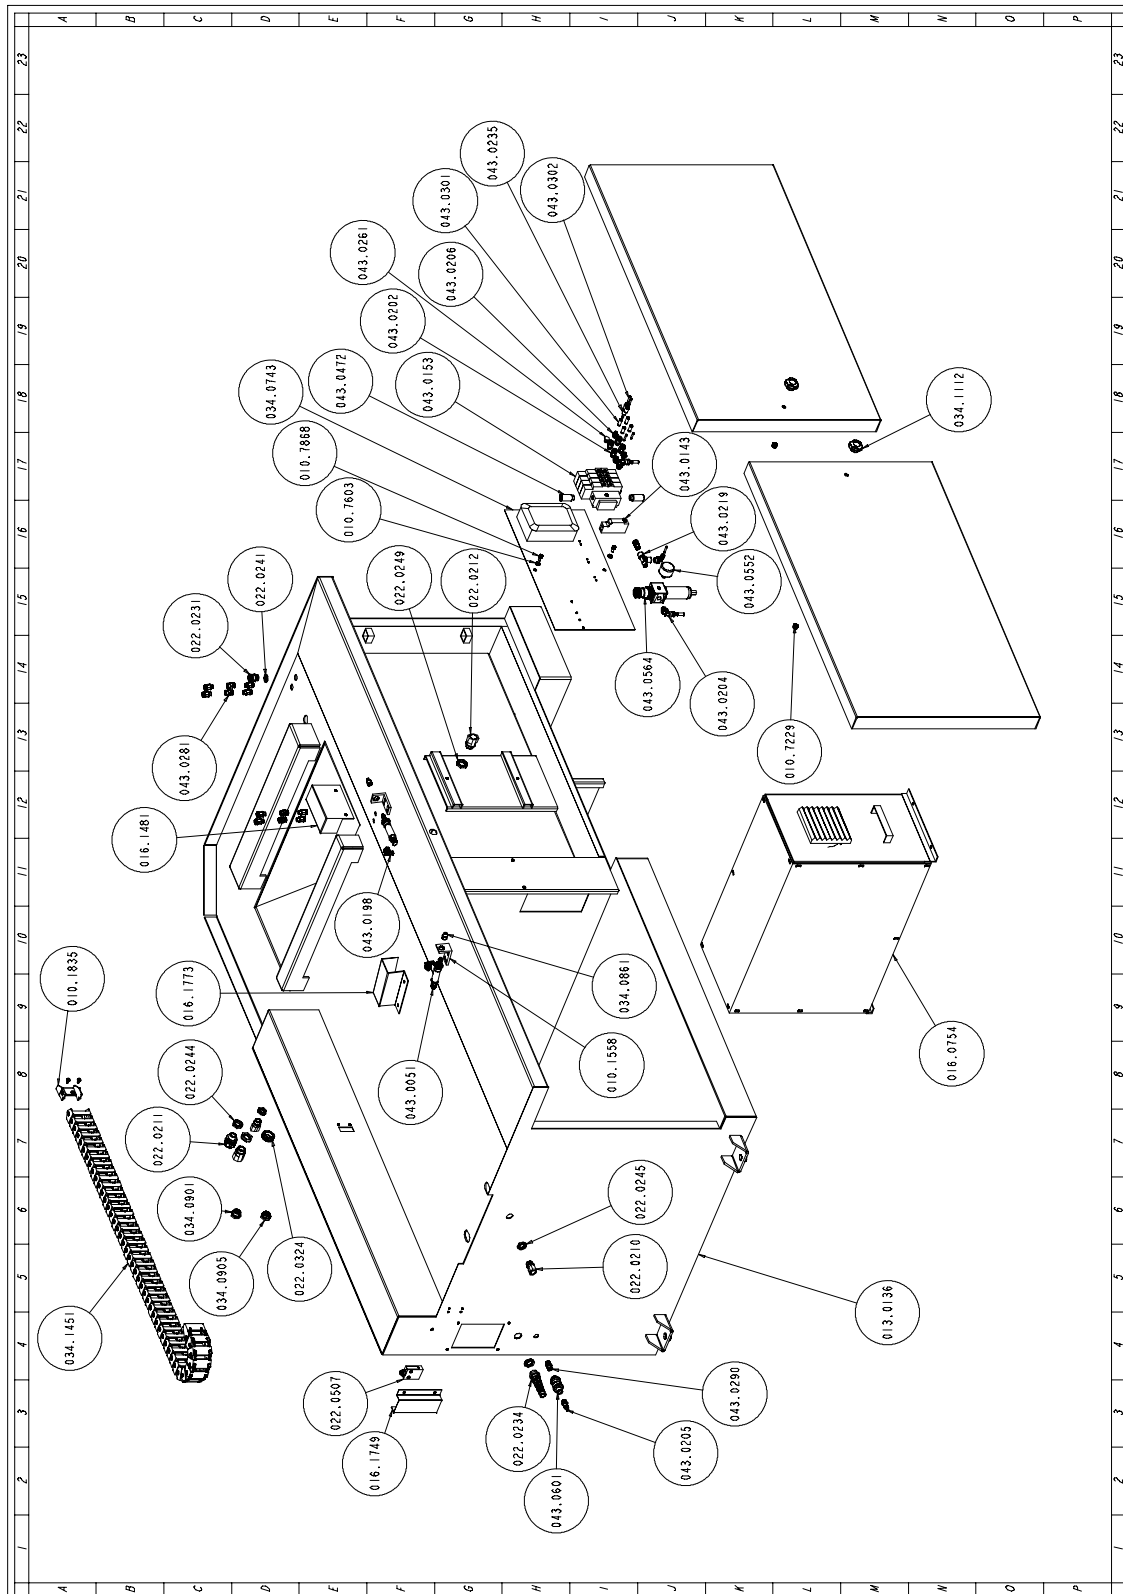


Code	Description	U. of M.	Quantity
010.1558	STAFFA FISSAGGIO CILINDRO SPOR	NR	2,000
010.1835	SET ATTACCHI 117.4.12.P AX-CNC	NR	1,000
010.7221	DADO M16 BASSO	NR	4,000
010.7229	DADO AUTOBLOCCANTE M8	NR	2,000
010.7603	RONDELLA DIAM. 6	NR	2,000
010.7830	VITE BUTON 5 X 10	NR	12,000
010.7868	VITE TCEI 6 X 12	NR	2,000
013.0136	PIEDISTALLO	NR	1,000
016.0754	QUADRO ELETTRICO TI 370 CNC	NR	1,000
016.1481	STAFFA PROTEZIONE CILINDRO SPO	NR	1,000
016.1749	PROTEZIONE FINECORSO CARTER AL	NR	1,000
016.1773	PROTEZIONE CILINDRO BLOCCAGGIO	NR	1,000
022.0210	RACCORDO RAPIDO SEM PG 11	NR	2,000
022.0211	RACCORDO RAPIDO SEM PG 13,5	NR	1,000
022.0212	RACCORDO RAPIDO SEM PG 16	NR	2,000
022.0231	PRESSACAVO IN OTTONE 3/8 BM 24	NR	1,000
022.0234	PRESSACORDONE 3246 NERO PG 13,	NR	1,000
022.0241	DADO IN OTTONE BM 2461 3/8	NR	1,000
022.0244	CONTRODADO 3217B GRIGIO PG 13	NR	2,000
022.0245	CONTRODADO 3213B GRIGIO PG 11	NR	2,000
022.0249	DADO POLIAM.HUMMEL 1.262.1600.	NR	2,000
022.0324	PASSACAVI 24 INC.MM.2.5	NR	1,000
022.0507	FINECORSO D4C-1G02 1M	NR	1,000
034.0743	QUADRO PNEUMATICO SH 270 CNCFE	NR	1,000
034.0861	INSERTO NYLON X CILINDRO TI 37	NR	2,000
034.0901	TAPPO LIVELLO OLIO 1/2 "GAS.	NR	1,000
034.0905	TAPPO OLIO TAO/3 1/2" NERO	NR	1,000
034.1112	VOLANTINO DIAM.40 M8	NR	2,000
034.1451	CATENA PORTACAVI E17.04.63.0	MT	1,000
043.0051	CILINDRO	NR	2,000
043.0143	PRESSOSTATO PNEUM.PS1P1091	NR	1,000
043.0153	BLOCCO DI VALVOLE DA 4 TI 370	NR	1,000
043.0198	ATTACCO A GOMITO GIREV.4X1/4 C	NR	3,000
043.0202	ATTACCO A ESAGONO 8X1/8 - CL 6	NR	12,000
043.0204	ATTACCO A GOMITO 8X1/4 - CL 65	NR	2,000
043.0205	ATTACCO A ESAGONO 8X1/4 - CL 6	NR	1,000
043.0206	ATTACCO A ESAGONO 4X1/8 - CL 6	NR	3,000
043.0219	RACCORDO A"T" MFF 1/4" CL-2070	NR	1,000
043.0235	BIFORCAZ. A Y TUBO 4MM. 242753	NR	1,000
043.0261	TAPPO TTE8 1/8 - CL 2611	NR	1,000
043.0281	MANICOTTO 1/8 M 8/8 - CL 2543	NR	4,000
043.0290	INNESTO RAPIDO 1/4 GHIOTTO 13/	NR	2,000
043.0301	TUBO RILSAN 8X6 NERO COD.172	MT	6,000
043.0302	TUBO RILSAN 4X2.7 BIANCO C.172	MT	5,000
043.0472	SILENZIATORE 1/4- PLASTICA	NR	2,000
043.0552	MANOMETRO DIAM. 40	NR	1,000
043.0564	FR 1/4 20-08	NR	1,000
043.0601	VALVOLA VMS 114-1/4 08	NR	1,000

## Fixed worktable

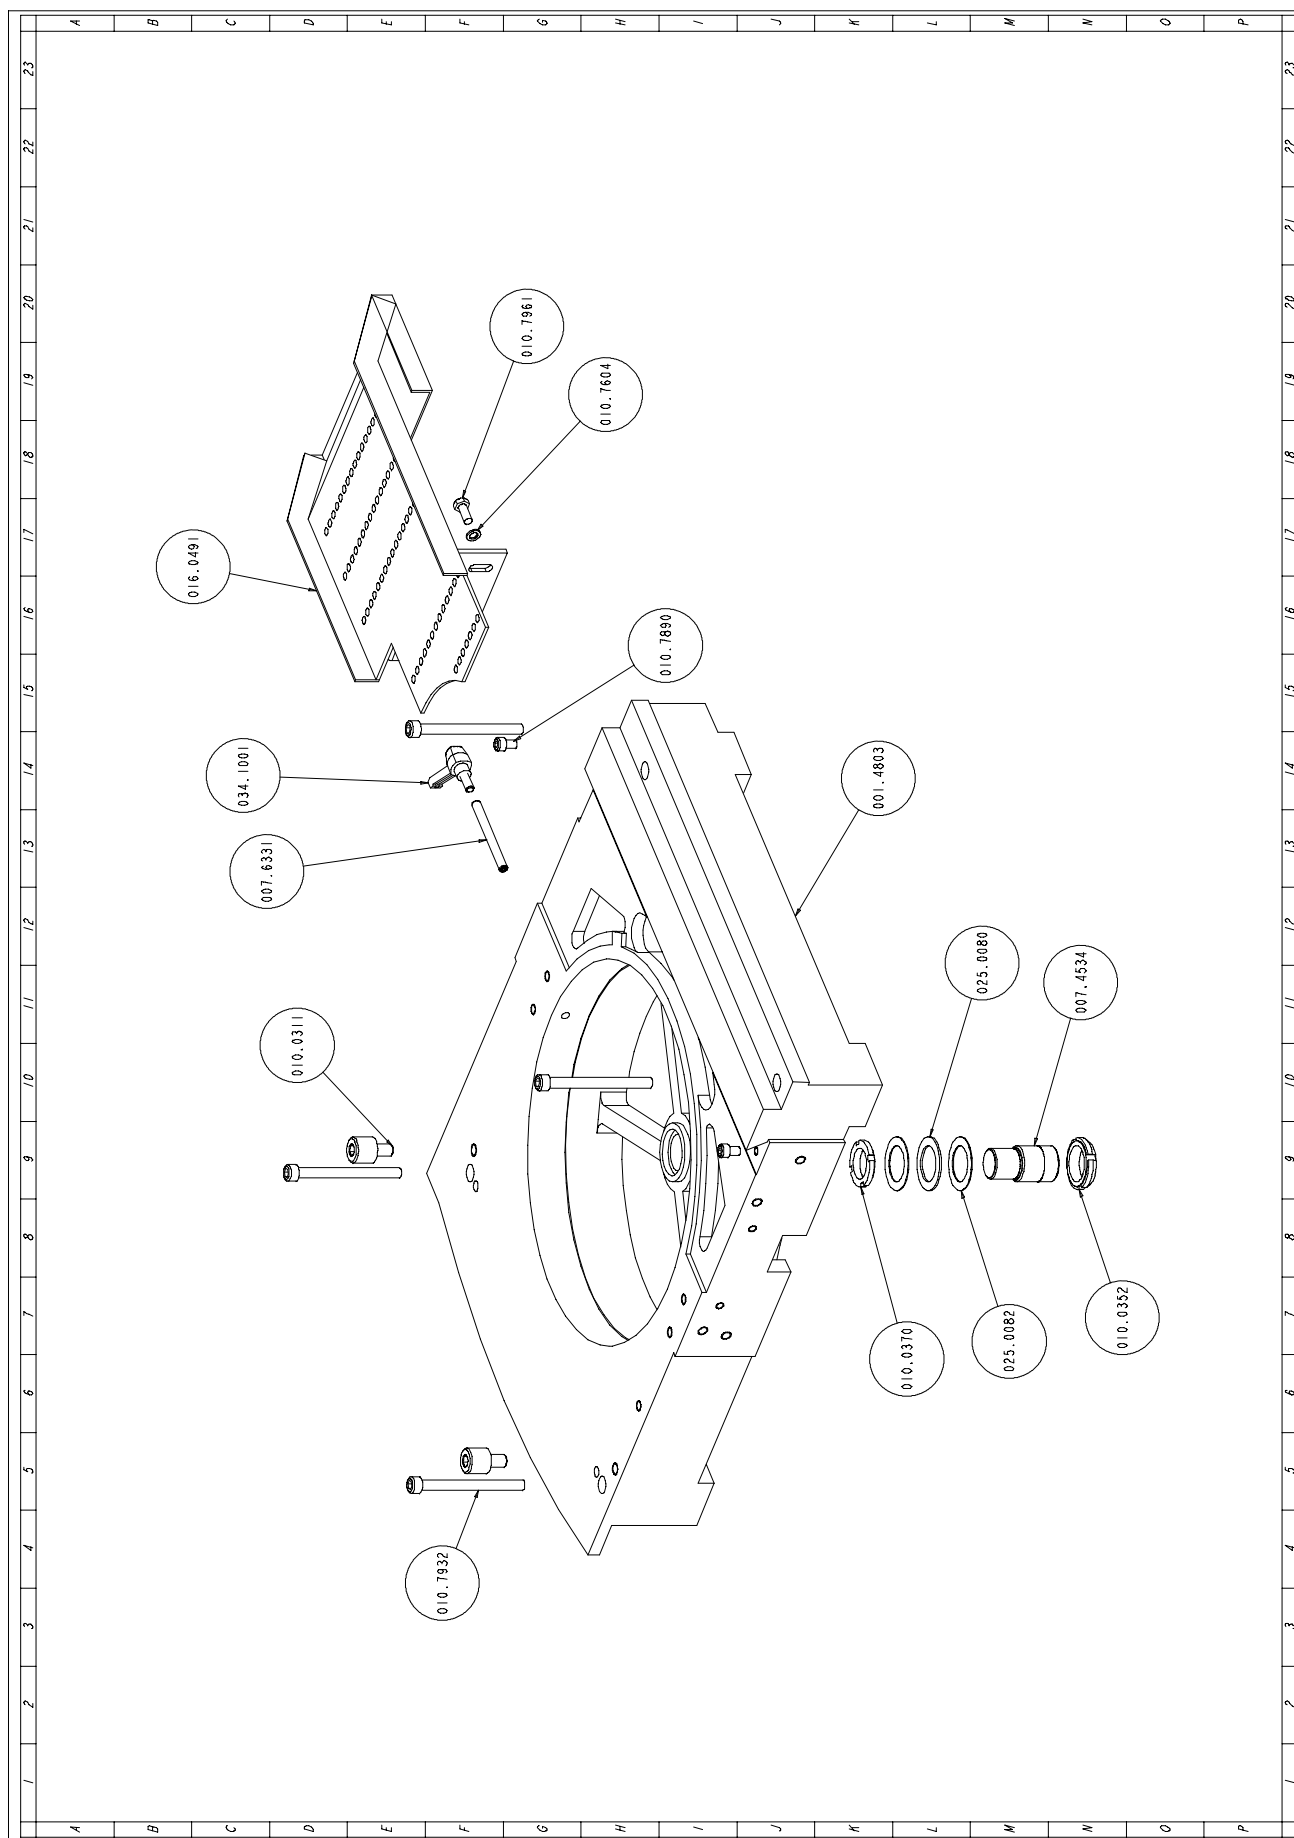


Code	Description	U. of M.	Quantity
001.4803	PIATTAFORMA	NR	1,000
007.4534	PERNO DI CENTRO	NR	1,000
007.6331	PERNO BLOCCAGGIO PIANO GIREVOLE	NR	1,000
010.0311	VITE TCEI M12X16 BATT.PIANO GIREVO.	NR	2,000
010.0352	GHIERA AUTOBLOCCANTE 35X1,5	NR	1,000
010.0370	GHIERA 5S 30X1,5	NR	1,000
010.7604	RONDELLA DIAM. 8	NR	2,000
010.7890	VITE TCEI 8 X 12	NR	2,000
010.7932	VITE TCEI 10 X 110	NR	4,000
010.7961	VITE TE 8 X 20	NR	2,000
016.0491	GUIDA SCARICA PEZZI TI 370 CNC	NR	1,000
025.0080	GABBIA ASSIALE A RULLINI AXK 3552	NR	1,000
025.0082	RALLA AS 3552	NR	2,000
034.1001	LEVA A SCATTO 8 MA PK55	NR	1,000

## Turntable

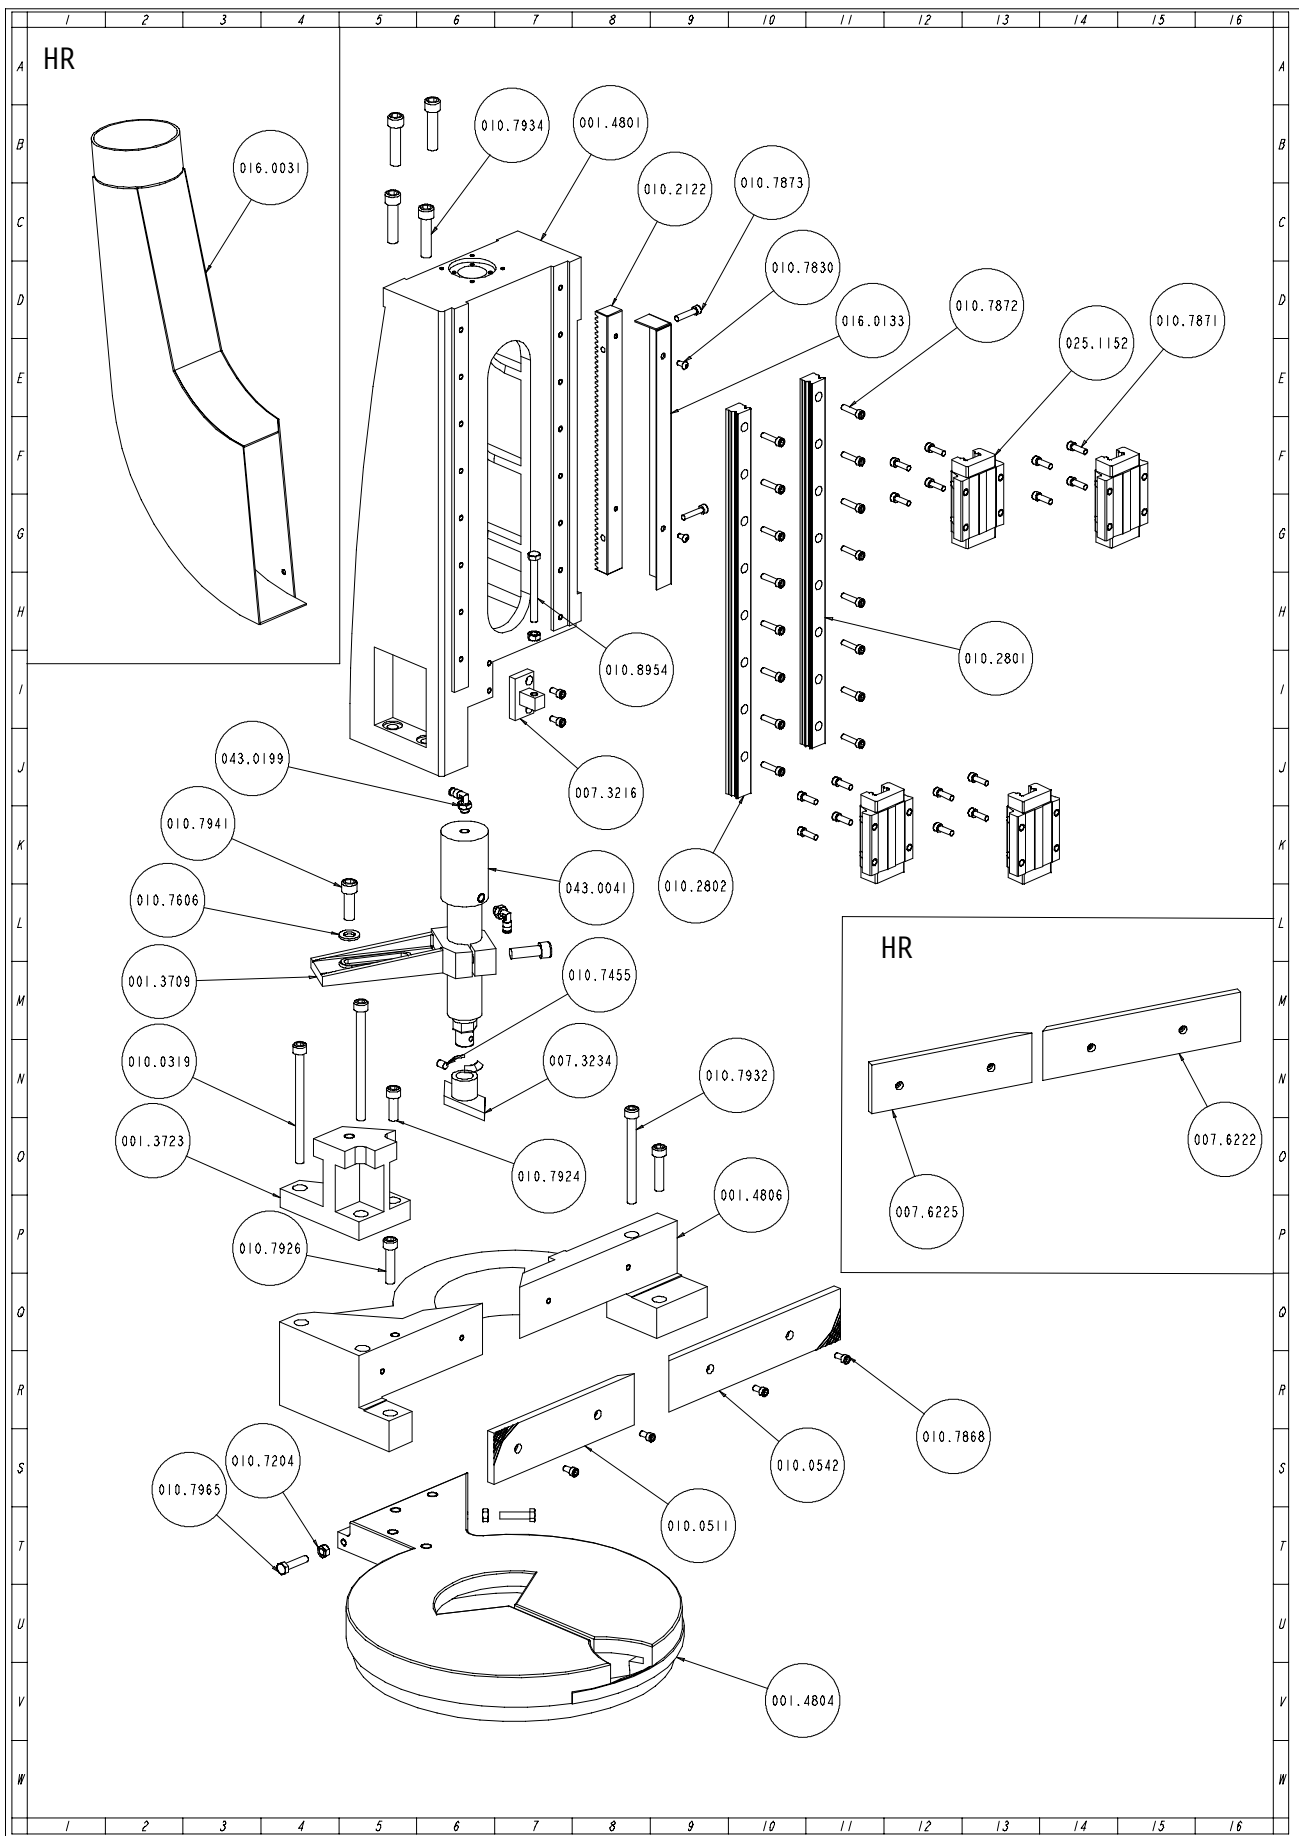

Code	Description	U. of M.	Quantity
001.3709	STAFFA BLOCCAGGIO CILINDRO SUP	NR	1,000
001.3723	SUPPORTO CILINDRO SUPPLEMENTAR	NR	1,000
001.4801	COLONNA PORTANTE	NR	1,000
001.4804	PIATTAFORMA ROTANTE	NR	1,000
001.4806	SQUADRO MORSA	NR	1,000
007.3216	BATTUTA FINECORSO	NR	1,000
007.3234	BOCCOLA/GANASCIA X CILIN.SUPPL	NR	1,000
007.6222	GANASCIA MORSA DESTRA	NR	1,000
007.6225	GANASCIA MORSA SINISTRA TI 370	NR	1,000
010.0319	VITE 8.8 TCEI 10X140 TI	NR	2,000
010.1201	VITERIA E BULLONERIA	NR	1,000
010.2122	CREMAGLIERA TI 370 CNCFE	NR	1,000
010.2801	GUIDA PATTINO	NR	1,000
010.2802	GUIDA PATTINO	NR	1,000
010.7204	DADO M8	NR	3,000
010.7455	GRANO VCE P.CON. 8 X 10	NR	1,000
010.7606	RONDELLA DIAM. 12	NR	1,000
010.7830	VITE BUTON 5 X 10	NR	2,000
010.7868	VITE TCEI 6 X 12	NR	6,000
010.7871	VITE TCEI 6 X 20	NR	16,000
010.7872	VITE TCEI 6 X 25	NR	16,000
010.7873	VITE TCEI 6 X 30	NR	2,000
010.7924	VITE TCEI 10 X 30	NR	1,000
010.7926	VITE TCEI 10 X 45	NR	2,000
010.7932	VITE TCEI 10 X 110	NR	1,000
010.7934	VITE TCEI 12 X 50	NR	4,000
010.7941	VITE TCEI 12 X 35	NR	2,000
010.7965	VITE TE 8 X 35	NR	2,000
016.0031	CONVOGLIATORE TRUCIOLI TI 370	NR	1,000
016.0133	CARTER CREMAGLIERA SOLLEVAMENT	NR	1,000
025.1152	PATTINO LGW25HCZ3C	NR	4,000
043.0041	CILINDRO MORSE 50X10 0 40 L.15	NR	1,000
043.0199	ATTACCO A GOMITO GIREV.4X1/8 C	NR	2,000

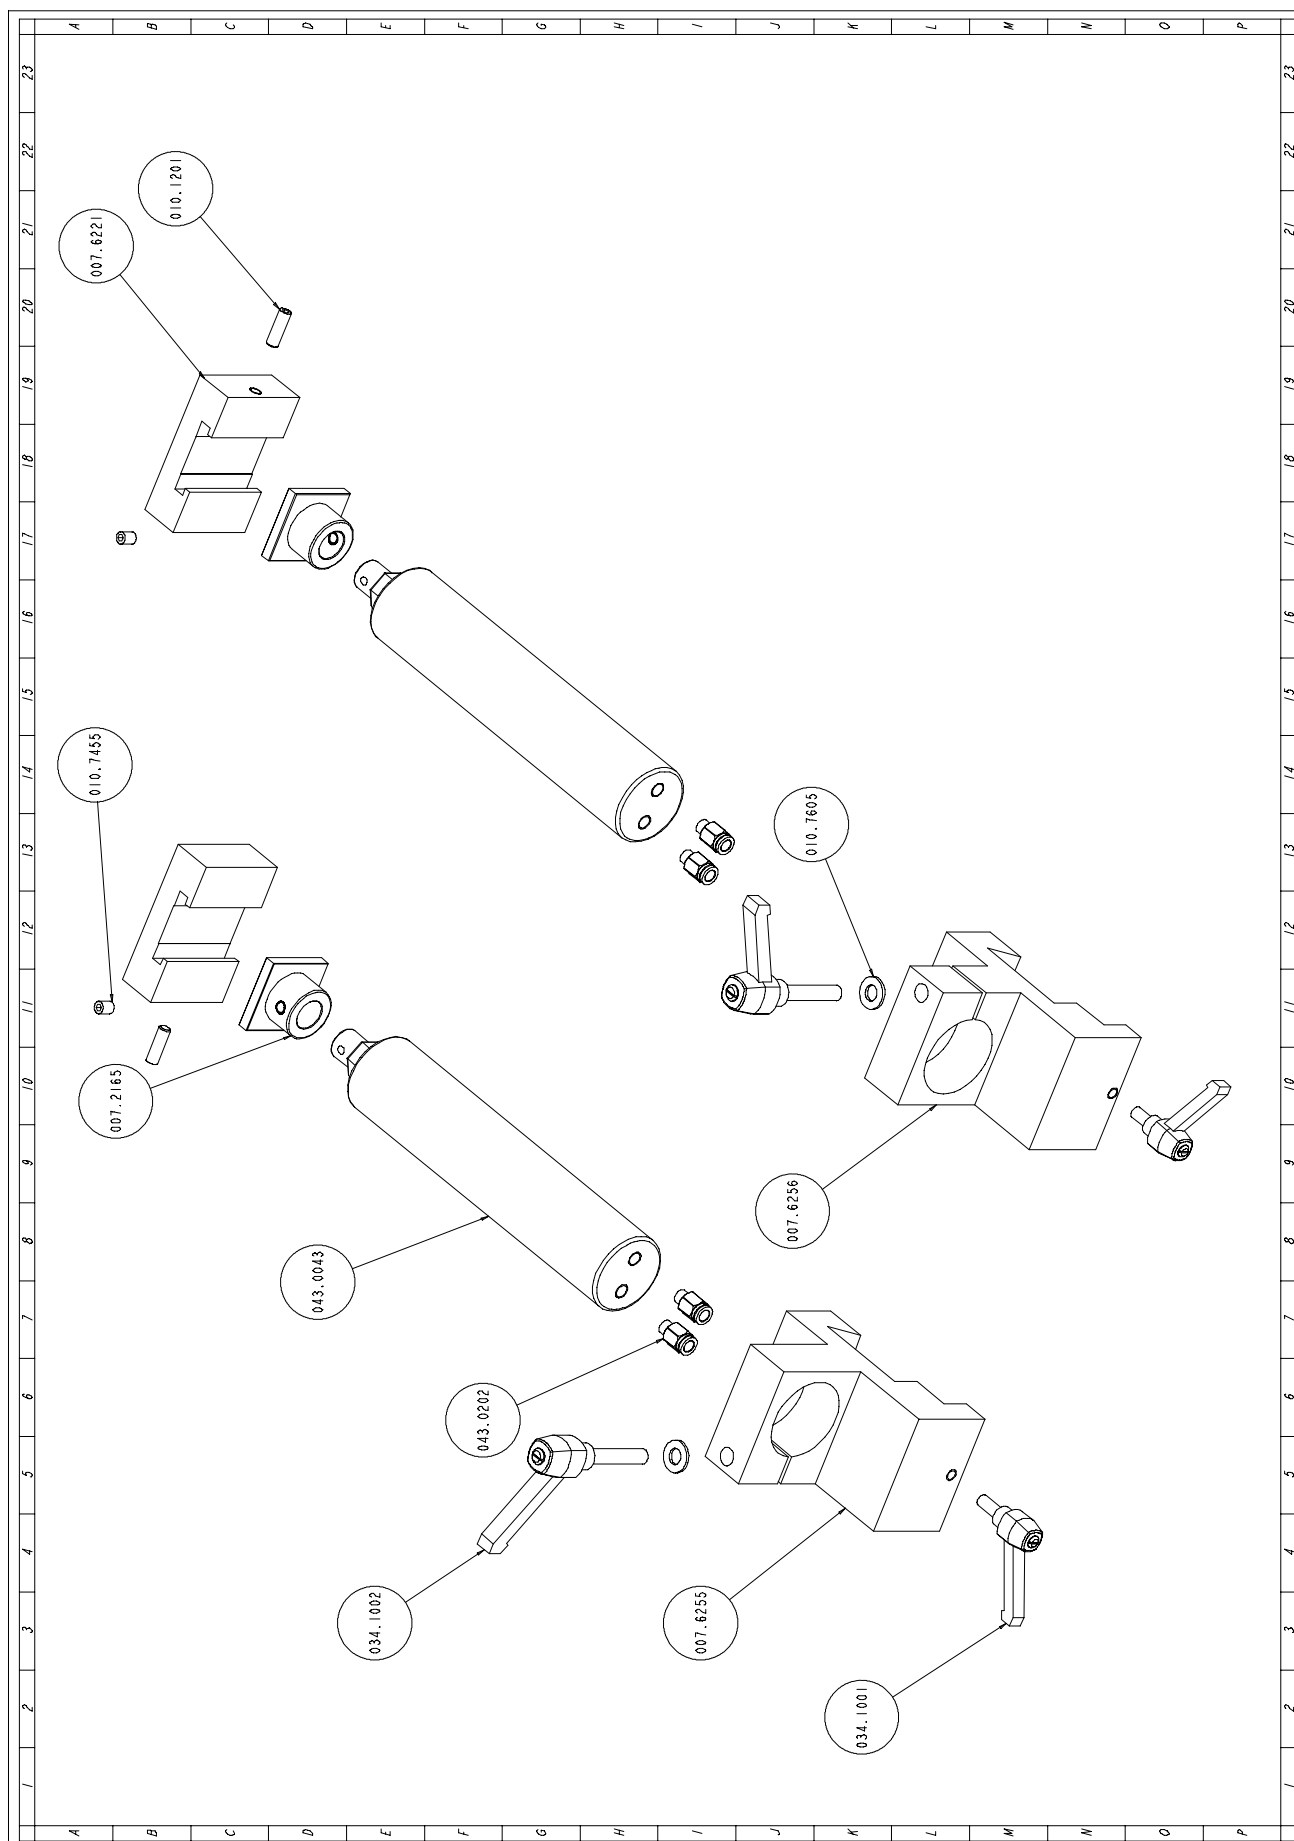
**Vice assembly**



---


Code	Description	U. of M.	Quantity
007.2165	SUPPORTO GANASCIA MORSA	NR	2,000
007.6221	GANASCIA MORSA MOBILE	NR	2,000
007.6255	SUPPORTO CILINDRO MORSA DESTRA	NR	1,000
007.6256	SUPPORTO CILINDRO MORSA SINIST	NR	1,000
010.1201	VITERIA E BULLONERIA	NR	2,000
010.7455	GRANO VCE P.CON. 8 X 10	NR	2,000
010.7605	RONDELLA DIAM. 10	NR	2,000
034.1001	LEVA A SCATTO 8 MA PK55	NR	2,000
034.1002	LEVA A SCATTO 10 MA	NR	2,000
043.0043	CILINDRO MORSE 0 50 C8 D.E.	NR	2,000
043.0202	ATTACCO A ESAGONO 8X1/8 - CL 6	NR	4,000

Head unit

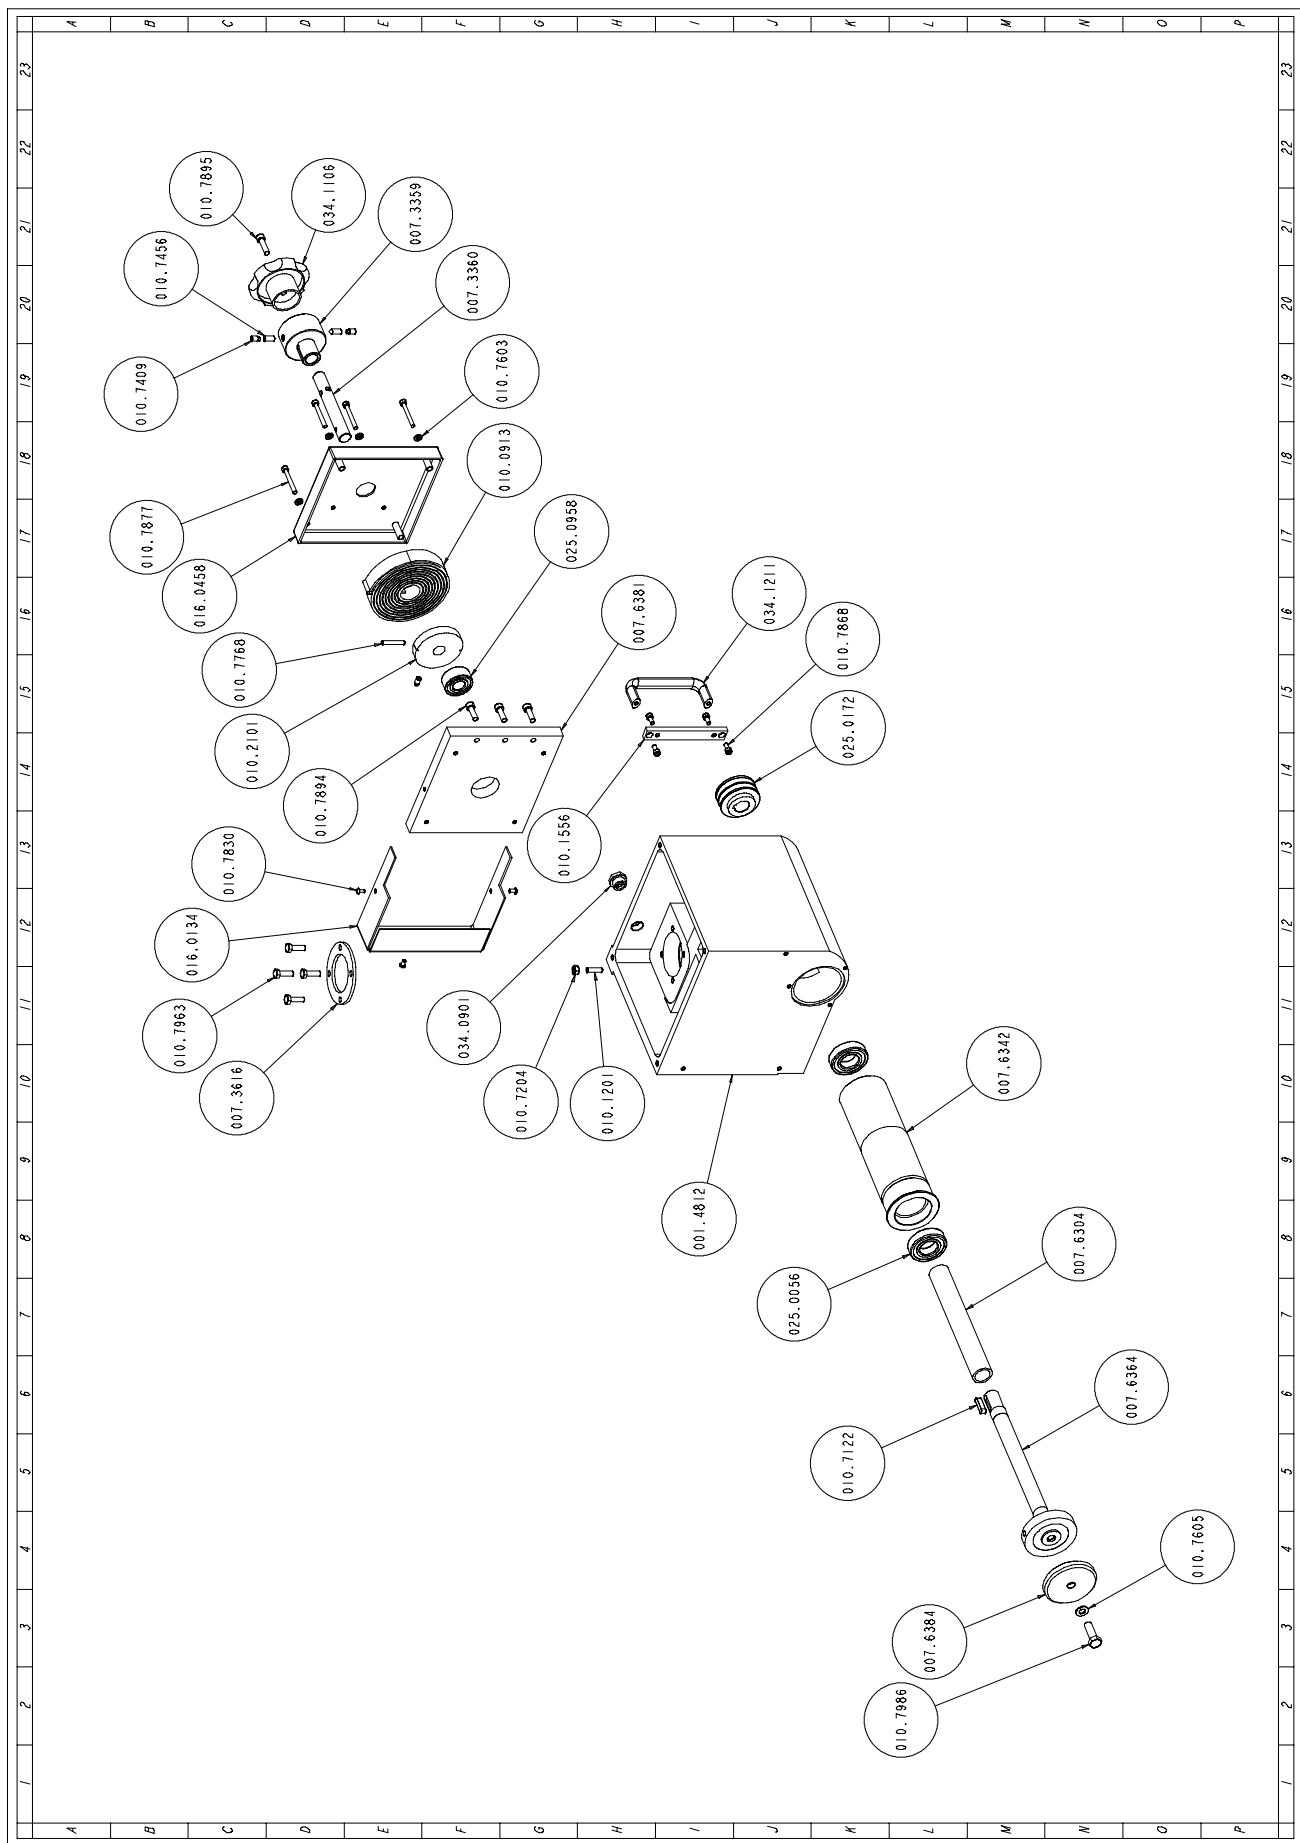


Code	Description	U. of M.	Quantity
001.4812	.TESTA OPERATRICE TI 370 CNCHR	NR	1,000
007.3359	BOCCOLA RIPRESA CORSA	NR	1,000
007.3616	GHIERA FIX CUSCINETTO	NR	1,000
007.6304	DISTANZIALE CUSCINETTI ALBERO	NR	1,000
007.6342	TAMPONE TI 370 CNCHR	NR	1,000
007.6362	ALBERO MOVIMENTO TESTA TI 370	NR	1,000
007.6364	ALBERO PORTADISCO TI 370 CNCHR	NR	1,000
007.6381	FLANGIA PORTAMOLLA RICHIAMO TE	NR	1,000
007.6384	FLANGIA ESTERNA PORTADISCO TI	NR	1,000
010.0913	MOLLA SOLLEVAMENTO TESTA	NR	1,000
010.1201	VITERIA E BULLONERIA	NR	1,000
010.1556	STAFFA FISSAGGIO MANIGLIA TEST	NR	1,000
010.2101	RUOTA SOLLEVAMENTO TESTA	NR	1,000
010.7122	CHIAVETTA 8 X 8 X 32	NR	1,000
010.7204	DADO M8	NR	1,000
010.7409	GRANO VCE P.CIL. 8 X 10	NR	3,000
010.7456	GRANO VCE P.CON. 8 X 16	NR	2,000
010.7603	RONDELLA DIAM. 6	NR	4,000
010.7605	RONDELLA DIAM. 10	NR	1,000
010.7768	SPINA ELASTICA DIAM. 6 X 40	NR	1,000
010.7830	VITE BUTON 5 X 10	NR	3,000
010.7858	VITE TCEI 5 X 10	NR	6,000
010.7868	VITE TCEI 6 X 12	NR	4,000
010.7877	VITE TCEI 6 X 45	NR	4,000
010.7894	VITE TCEI 8 X 25	NR	3,000
010.7895	VITE TCEI 8 X 30	NR	1,000
010.7963	VITE TE 8 X 25	NR	4,000
010.7986	VITE TE 12 X 35	NR	1,000
016.0134	CARTER RUOTA SOLLEVAMENTO TEST	NR	1,000
016.0458	COPERCHIO MOLLA	NR	1,000
025.0056	CUSCINETTO 62.06 2Z C3	NR	2,000
025.0172	PULEGGIA 60X2 SPZ FORO 24	NR	1,000
025.0248	ANELLO DI TENUTA OR PARKER 2-3	NR	1,000
025.0958	CUSCINETTO 3204 A 2RS	NR	1,000
034.0901	TAPPO LIVELLO OLIO 1/2 "GAS.	NR	1,000
034.1106	VOLANTINO DIAM.100 A 6 LOBI	NR	1,000
034.1211	MANIGLIA GN-565-20-128.SW	NR	1,000

Motor assembly

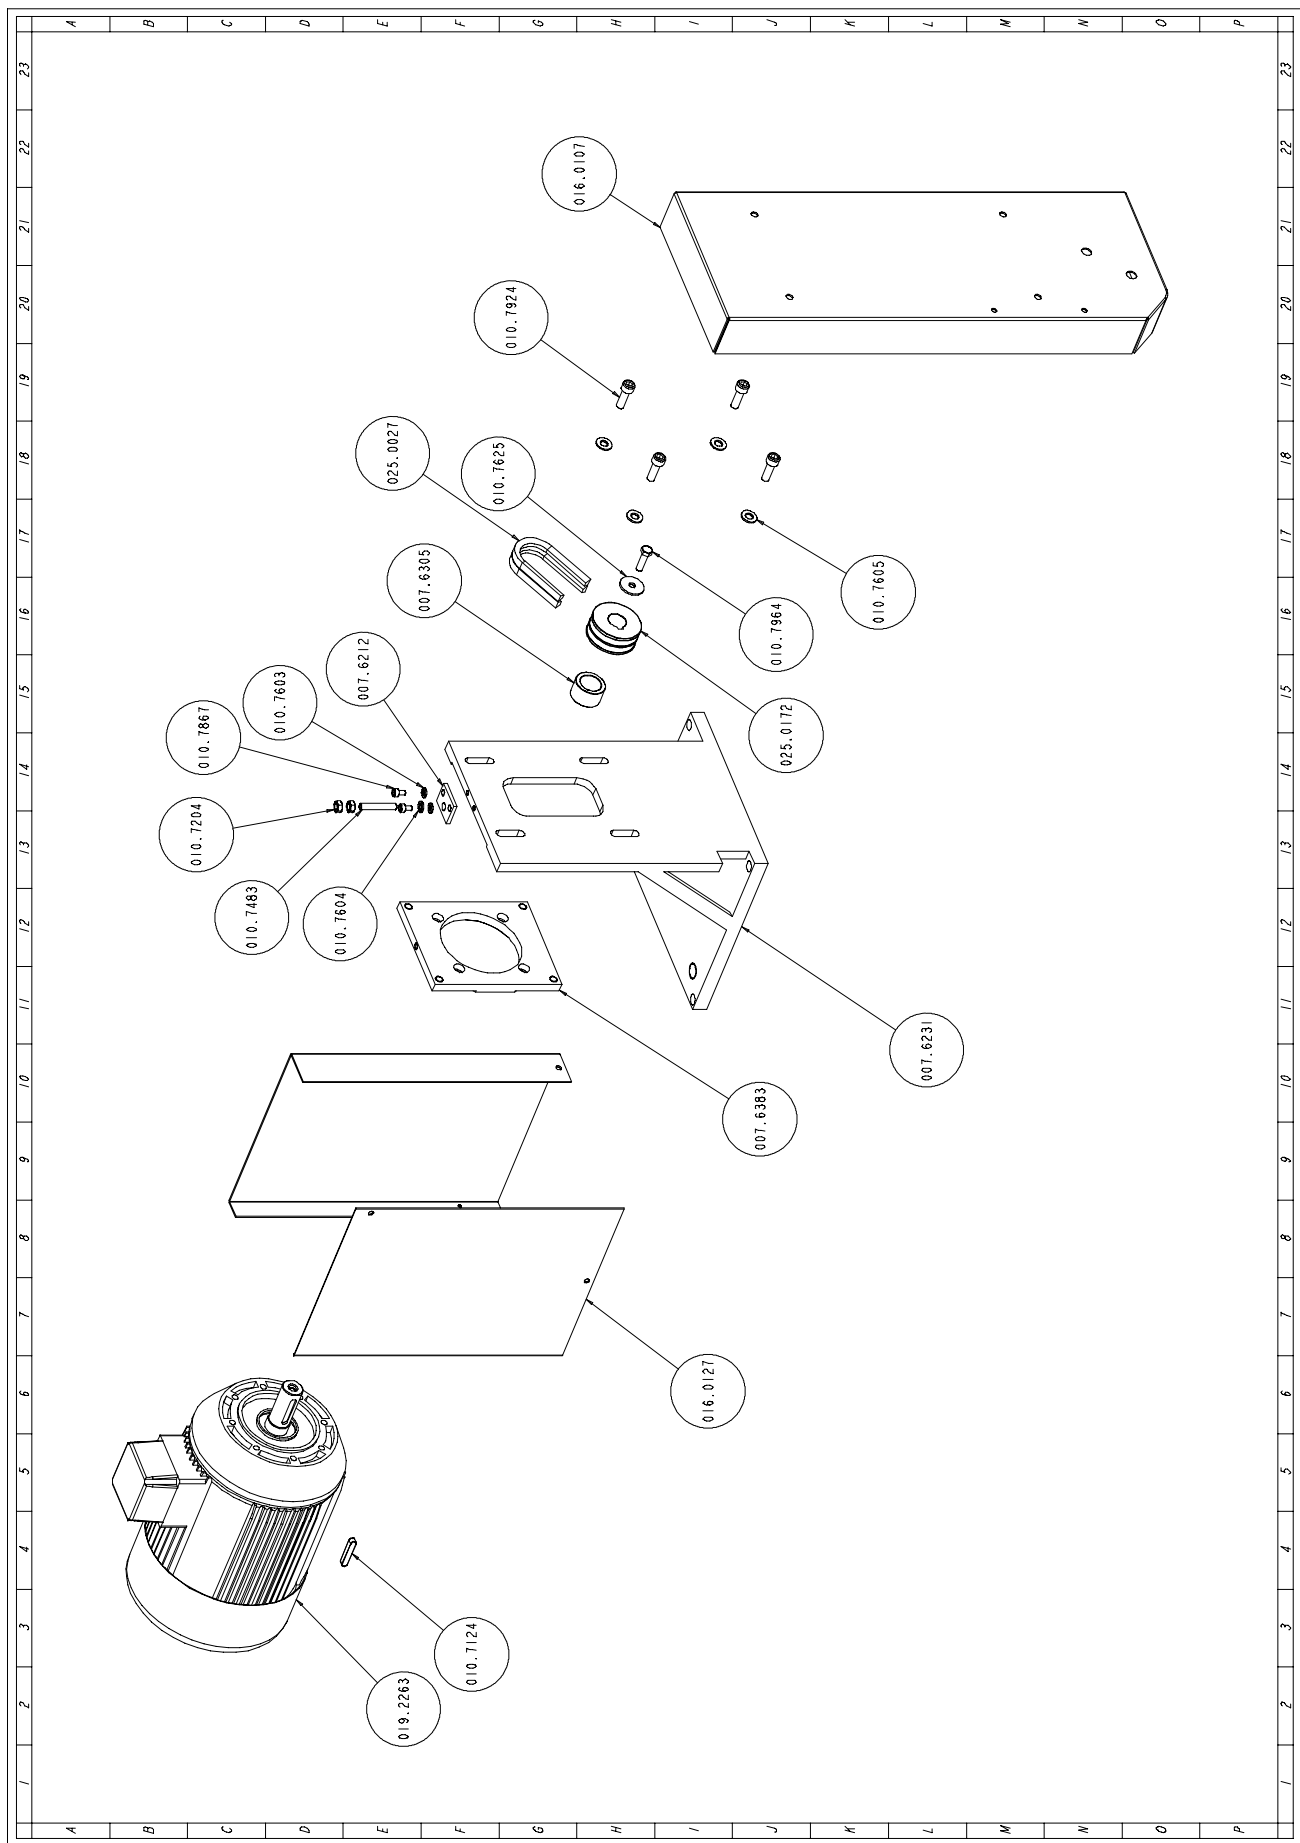

Code	Description	U. of M.	Quantity
007.6212	PIASTRINO X REGOLAZIONE POSIZI	NR	1,000
007.6231	SQUADRO SUPPORTO MOTORE TI 370	NR	1,000
007.6305	DISTANZIALE PULEGGIA MOTORE TI	NR	1,000
007.6383	FLANGIA MOTORE REGOLABILE TI 3	NR	1,000
010.7124	CHIAVETTA 8 X 7 X 45	NR	1,000
010.7204	DADO M8	NR	2,000
010.7483	GRANO VCE PUNTA PIANA 8X50	NR	1,000
010.7603	RONDELLA DIAM. 6	NR	2,000
010.7604	RONDELLA DIAM. 8	NR	1,000
010.7605	RONDELLA DIAM. 10	NR	4,000
010.7625	RONDELLA DIAM. 8 X 32	NR	1,000
010.7867	VITE TCEI 6 X 10	NR	2,000
010.7924	VITE TCEI 10 X 30	NR	4,000
010.7964	VITE TE 8 X 30	NR	1,000
016.0107	CARTER CINGHIA DI TRASMISSIONE	NR	1,000
016.0127	CARTER MOTORE TI 370 CNCHR	NR	1,000
019.2263	KW 4,4/3,3 2/4P.B.14 GR112 V.	NR	1,000
025.0027	CINGHIA SPZ 1180	NR	2,000
025.0172	PULEGGIA 60X2 SPZ FORO 24	NR	1,000


Blade guard unit

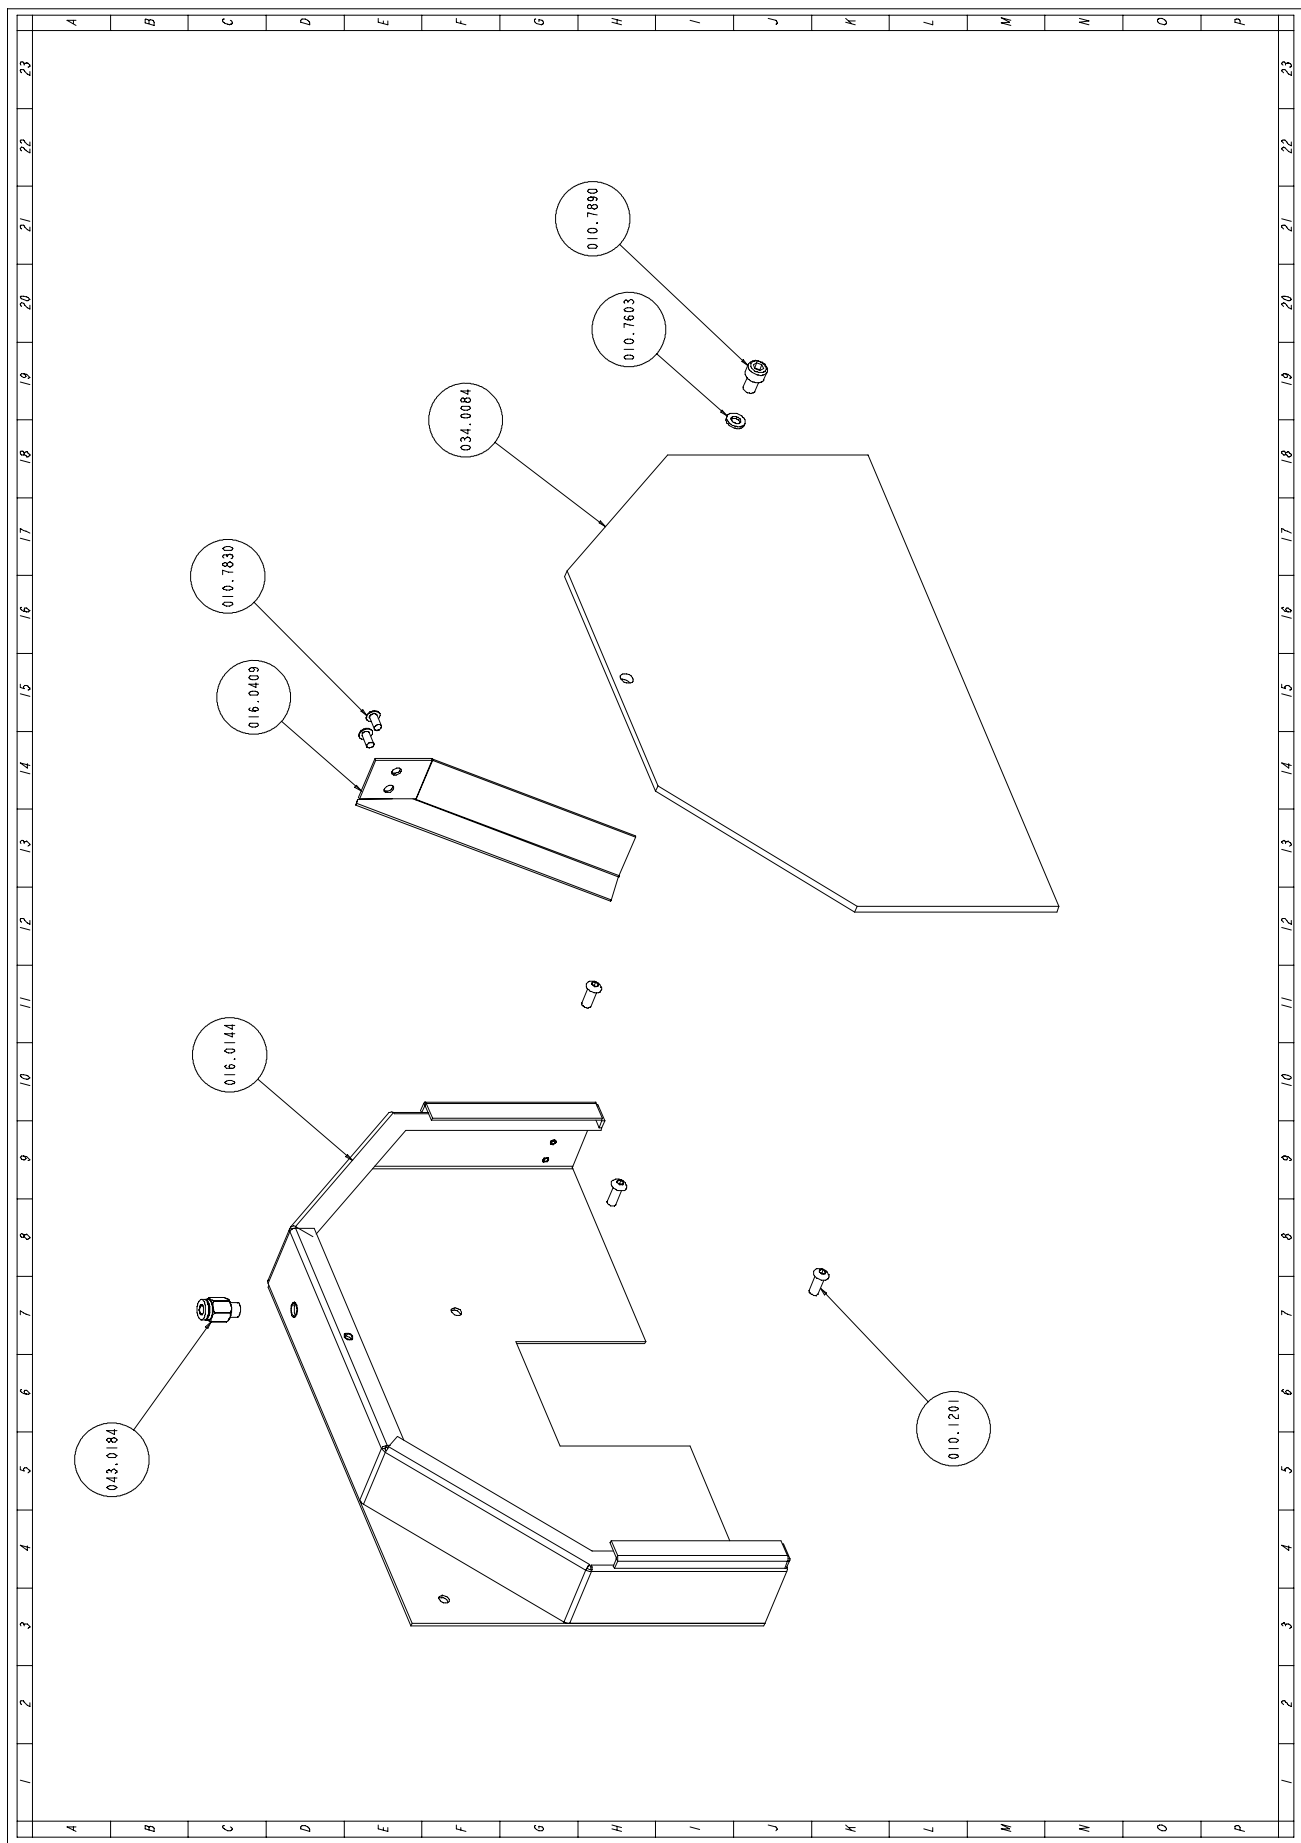

---

Code	Description	U. of M.	Quantity
010.1201	VITERIA E BULLONERIA	NR	3,000
010.7603	RONDELLA DIAM. 6	NR	1,000
010.7830	VITE BUTON 5 X 10	NR	2,000
010.7890	VITE TCEI 8 X 12	NR	1,000
016.0144	CARTER FISCO TIGER 370 HR-MR	NR	1,000
016.0409	PARATRUCIOLI TI 370 HR-MR	NR	1,000
034.0084	PROTEZIONE LEXAN CARTER LAMA T	NR	1,000
043.0184	ATTACCO A ESAGONO 6X1/8 CL 651	NR	1,000


## Electro-cylinder unit

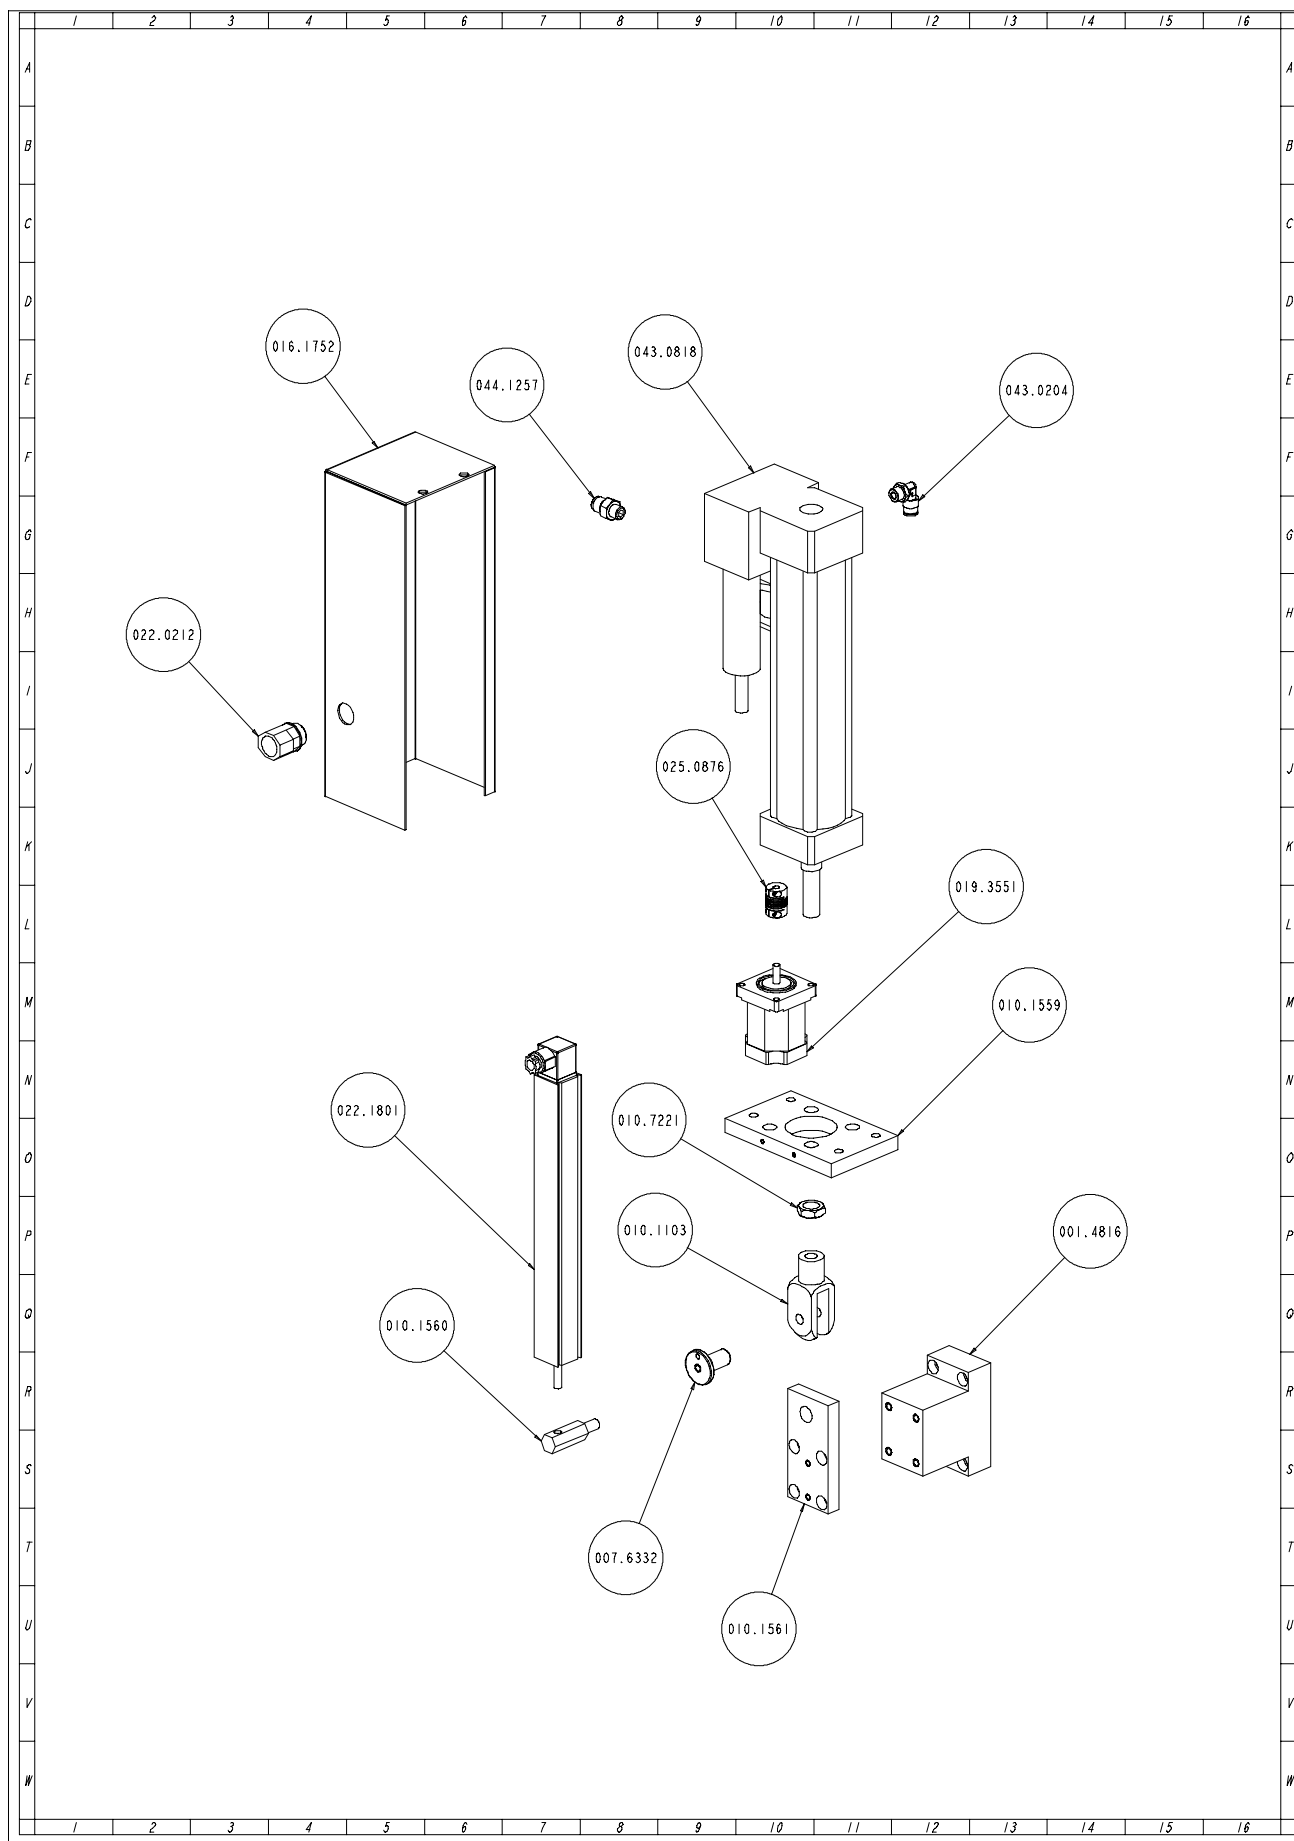



Code	Description	U. of M.	Quantity
001.4816	.SUPPORTO AGGANCIO CILINDRO TI	NR	1,000
007.6332	PERNO FORCELLA TI 370 SX	NR	1,000
010.1103	FORCELLA 16 X 1,5	NR	1,000
010.1559	STAFFA FISSAGGIO CILINDRO TI 3	NR	1,000
010.1560	STAFFA TRASCINAMENTO POTENZIOM	NR	1,000
010.1561	STAFFA AGGANCIO CILINRO TI 370	NR	1,000
010.7221	DADO M16 BASSO	NR	1,000
016.1752	PROTEZIONE CILINDRO	NR	1,000
019.3551	MOTORE MAE MOD.HY 200 2232 190	NR	1,000
022.0212	RACCORDO RAPIDO SEM PG 16	NR	1,000
022.0378	CONNETT.BOBINA VALV. RIGENERAT	NR	1,000
022.1801	POTENZIOMETRO LINEARE LWH225-0	NR	1,000
025.0876	GIUNTO WA 6-6 MM.28 X CILINDRO	NR	1,000
043.0204	ATTACCO A GOMITO 8X1/4 - CL 65	NR	1,000
043.0818	UNITA' IDROPNEUMATICA 63RBRSM	NR	1,000
044.1257	VALVOLA DI CARICO CILINDRO	NR	1,000

## Supply carriage unit

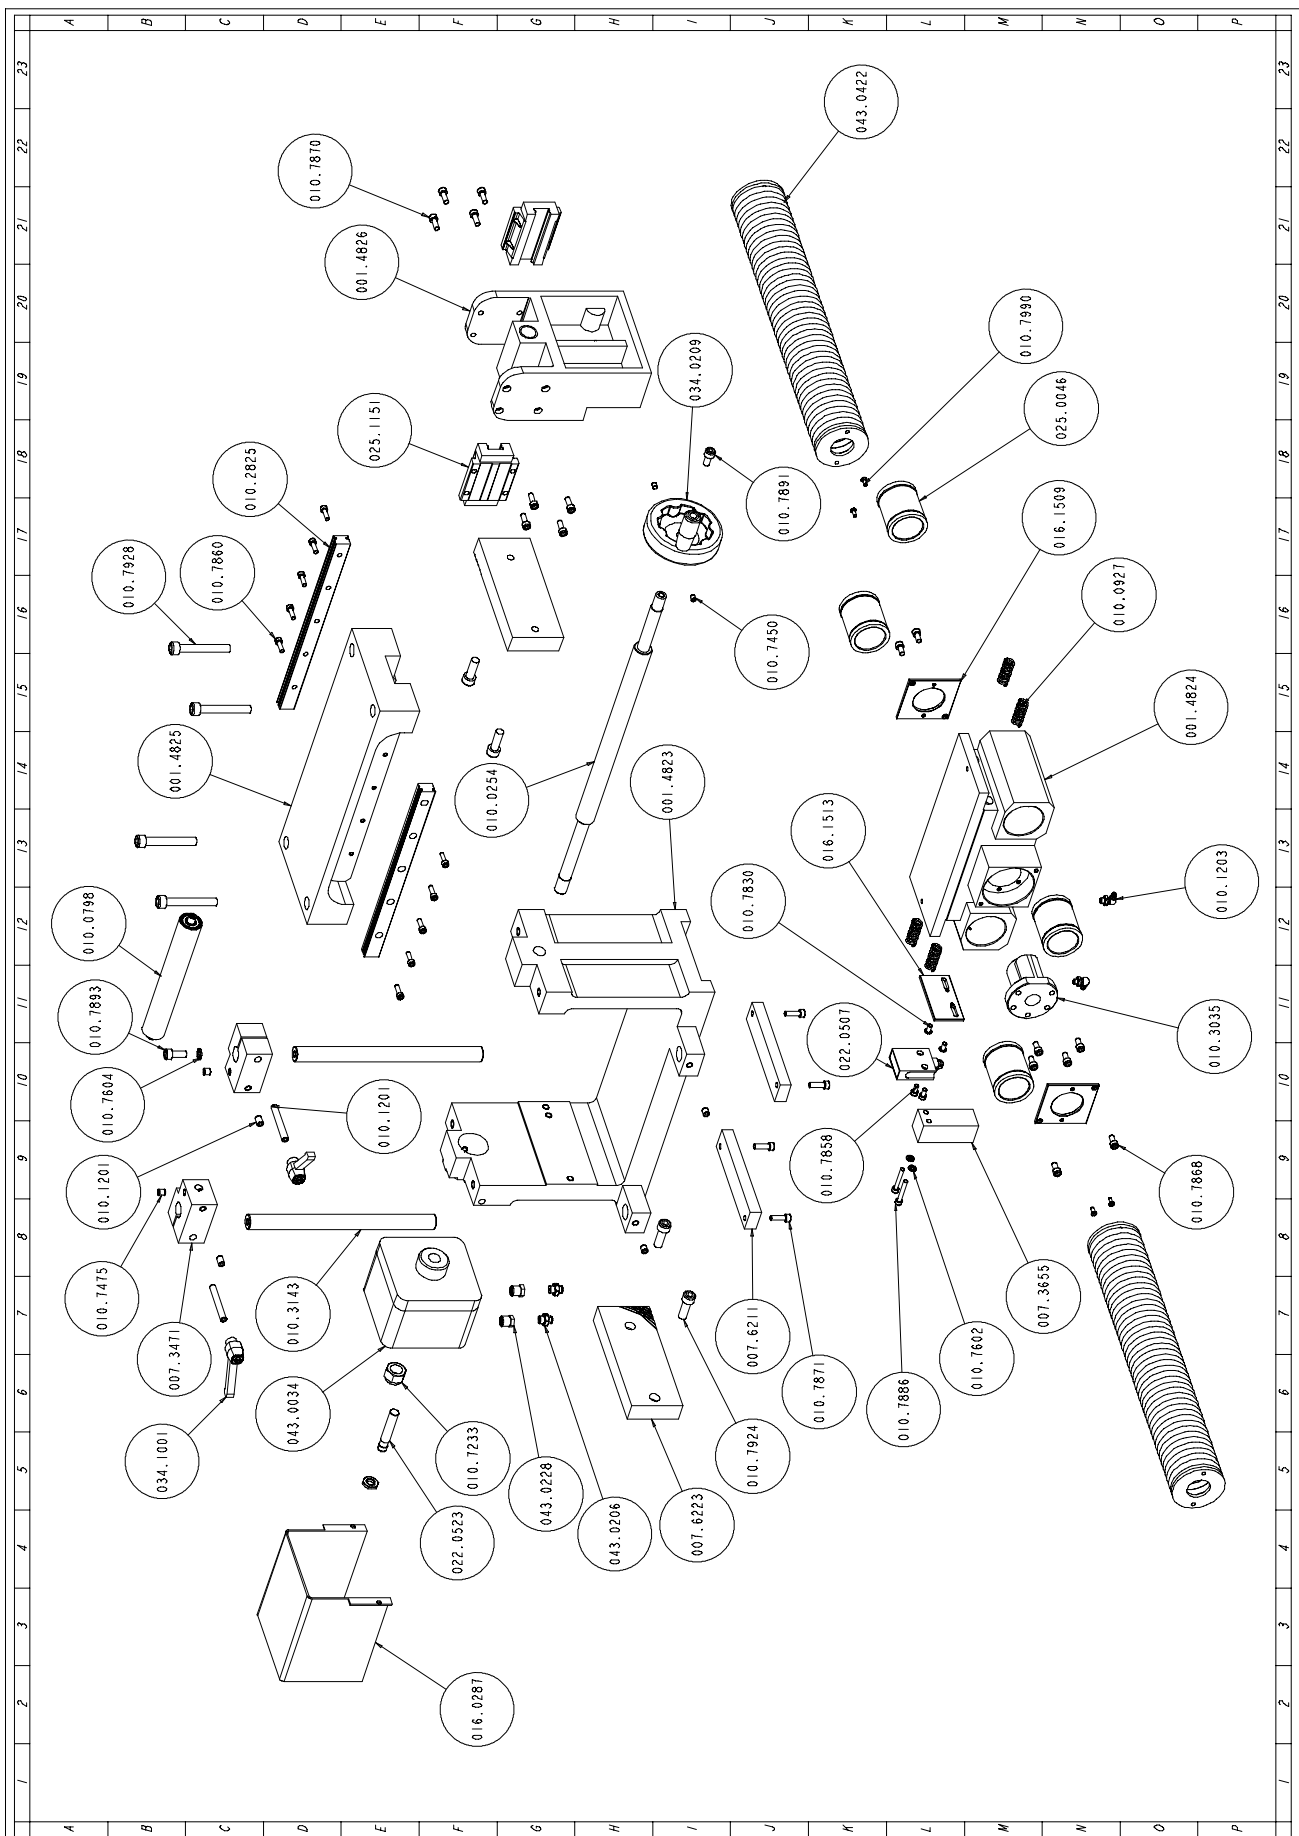


Code	Description	U. of M.	Quantity
001.4823	SLITTA BASCULANTE ALIMENTATORE	NR	1,000
001.4824	CARRELLO ALIMENTATORE	NR	1,000
001.4825	TRAVERSA SLITTA BASCULANTE ALI	NR	1,000
001.4826	STAFFA FISSAGGIO GANASCIA MOBI	NR	1,000
007.3471	TASSELLO FISSAGGIO RULLO PREMI	NR	2,000
007.3655	SUPPORTO CATENA PORTACAVI CN 9	NR	1,000
007.6211	PIASTRINO REGOLAZIONE SLITTA B	NR	2,000
007.6223	GANASCIA ALIMENTATORE	NR	2,000
010.0254	VITE MORSA ALIMENTATORE 535X24	NR	1,000
010.0798	RULLO PREMIBARRA ALIMENTATORE	NR	1,000
010.0927	MOLLA CARRELLO ALIMENTATORE	NR	4,000
010.1201	VITERIA E BULLONERIA	NR	4,000
010.1203	OLIATORE A 90° 6X1	NR	2,000
010.2825	GUIDA PATTINO HGR 20 R 0280 C	NR	2,000
010.3035	CHIOCCIOLA RNFTL2010A25S	NR	1,000
010.3143	SUPPORTO RULLO PREMIBARRA	NR	2,000
010.7233	DADO AUTOBLOCCANTE M16	NR	1,000
010.7450	GRANO VCE P.CIL. 6 X 6	NR	2,000
010.7475	GRANO VCE P.PIANA 8 X 8	NR	4,000
010.7602	RONDELLA DIAM. 5	NR	2,000
010.7604	RONDELLA DIAM. 8	NR	1,000
010.7830	VITE BUTON 5 X 10	NR	2,000
010.7858	VITE TCEI 5 X 10	NR	2,000
010.7860	VITE TCEI 5 X 15	NR	10,000
010.7868	VITE TCEI 6 X 12	NR	8,000
010.7870	VITE TCEI 6 X 16	NR	8,000
010.7871	VITE TCEI 6 X 20	NR	4,000
010.7886	VITE TCEI 5 X 35	NR	2,000
010.7891	VITE TCEI 8 X 16	NR	1,000
010.7893	VITE TCEI 8 X 20	NR	1,000
010.7924	VITE TCEI 10 X 30	NR	4,000
010.7928	VITE TCEI 10 X 70	NR	4,000
010.7990	VITE TSPEI 4 X 8	NR	4,000
016.0287	PROTEZIONE VOLAMPRESS	NR	1,000
016.1509	STAFFA FIX SOFFIETTO CIRCOLARE	NR	2,000
016.1513	STAFFA FIX MICROINTERRUTTORE	NR	1,000
022.0507	FINECORSO D4C-1G02 1M	NR	1,000
022.0523	SENSORE DI PROSSIMITA' PNP	NR	1,000
025.0046	MANICOTTO A SFERA 0658.040.00	NR	4,000
025.1151	PATTINO LGW20HAZ1C	NR	2,000
034.0209	VOLANTINO VDO.100 ALIMENTATORE	NR	1,000
034.1001	LEVA A SCATTO 8 MA PK55	NR	2,000
043.0034	CILINDRO VOLAMPRESS 100-8 ALIM	NR	1,000
043.0229	RIDUZIONE MF 1/4 - CL 2520	NR	2,000
043.0422	SOFFIETTO CIRCOLARE ALIMENTATO	NR	2,000

Use and maintenance manual **CNF 400 CNC**

Code	Description	U. of M.	Quantity
001.4821	STAFFA POSTERIORE ALIMENTATORE	NR	1,000
001.4822	STAFFA ANTERIORE ALIMENTATORE	NR	1,000
007.3656	SUPPORTO MOTORE P/P ALIMENTATO	NR	1,000
007.3731	GIUNTO MOTORE ALIMENTATORE CN	NR	1,000
007.4905	SUPPORTO ALIMENTATORE SH 400	NR	2,000
010.0797	RULLO ALIMENTATORE	NR	10,000
010.1201	VITERIA E BULLONERIA	NR	2,000
010.2032	GUIDA RULLI ALIMENTATORE	NR	2,000
010.3006	VITE A RICIRCOLO DI SFERE Ø 20	NR	1,000
010.3055	GUIDA CARRELLO Ø 40 MM.1283	NR	2,000
010.3147	SUPPORTO VITE RULLATA	NR	1,000
010.7232	DADO AUTOBLOCCANTE M14	NR	1,000
010.7601	RONDELLA DIAM. 4	NR	2,000
010.7604	RONDELLA DIAM. 8	NR	4,000
010.7616	RONDELLA DIAM. 21	NR	2,000
010.7850	VITE TCEI 4 X 8	NR	2,000
010.7861	VITE TCEI 5 X 20	NR	4,000
010.7868	VITE TCEI 6 X 12	NR	8,000
010.7870	VITE TCEI 6 X 16	NR	4,000
010.7871	VITE TCEI 6 X 20	NR	4,000
010.7891	VITE TCEI 8 X 16	NR	2,000
010.7893	VITE TCEI 8 X 20	NR	2,000
010.7896	VITE TCEI 8 X 35	NR	4,000
010.7924	VITE TCEI 10 X 30	NR	2,000
010.7940	VITE TCEI 12 X 30	NR	4,000
016.0879	ADATTATORE DI CARICO PIANALE K	NR	1,000
016.1490	STAFFA COMANDO MICROINTERRUTT.	NR	1,000
016.1736	PROTEZIONE MOTORE ALIMENTATORE	NR	1,000
019.3406	MOTORE P/P SM88.2.18M8 ALIMENT	NR	1,000
025.0813	BOCCOLA A RULLINI INA HK 1512	NR	20,000


Control panel

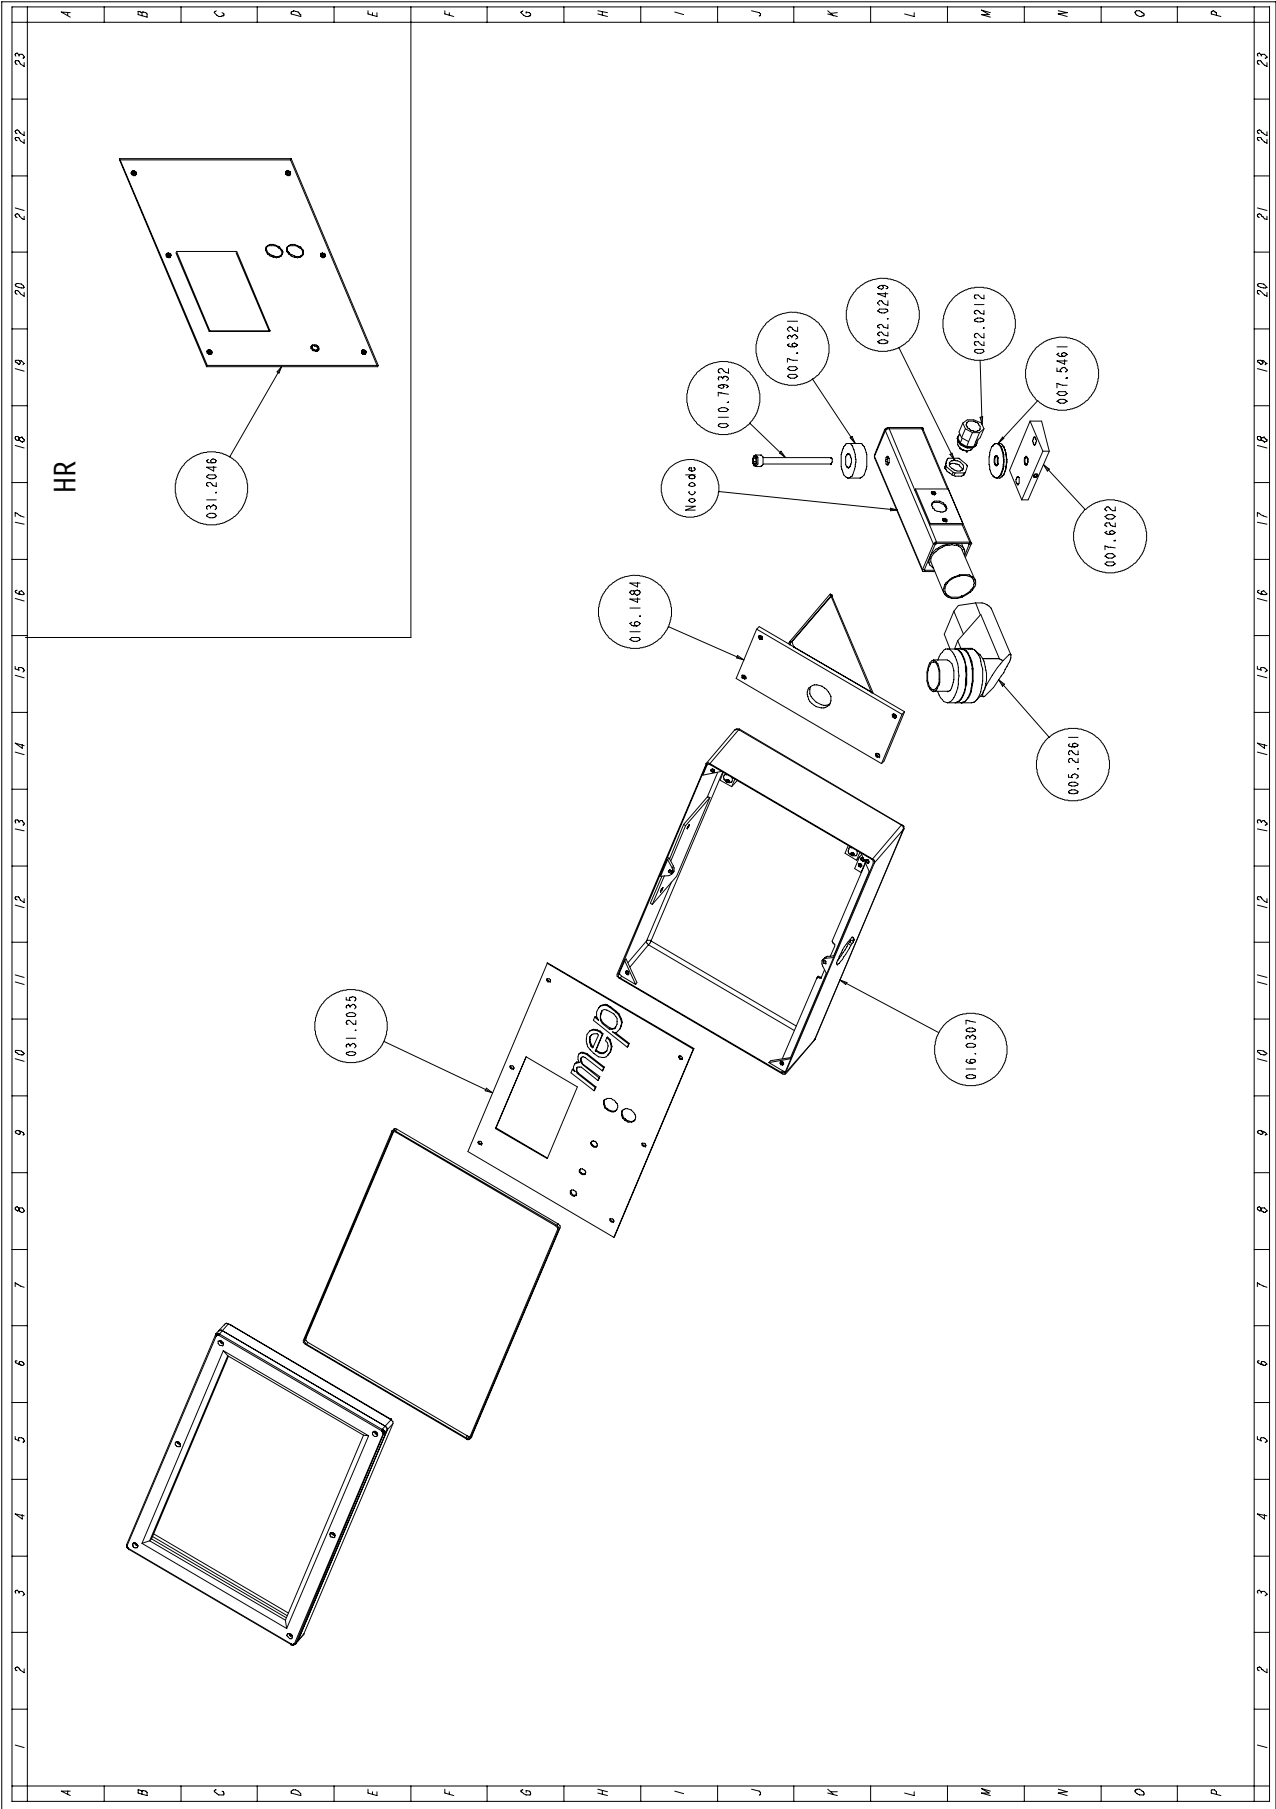

---

Code	Description	U. of M.	Quantity
005.2261	GIUNTO ANGOLO X QUADRO 497500	NR	1,000
007.5461	ROSETTA ASTA MOBILE SH 420 SE	NR	1,000
007.6202	PIASTRA FISSAGGIO ASTA MOBILE	NR	1,000
007.6321	ROSETTA BLOCCAGGIO ASTA MOBILE	NR	1,000
010.7932	VITE TCEI 10 X 110	NR	1,000
016.0235	ASTA MOBILE X CONSOLLE TI 370	NR	1,000
016.0307	QUADRO COMANDI MEP-E	NR	1,000
016.1484	STAFFA FISSAGGIO CONSOLLE SH 4	NR	1,000
022.0212	RACCORDO RAPIDO SEM PG 16	NR	1,000
022.0249	DADO POLIAM.HUMMEL 1.262.1600.	NR	1,000
031.2046	CONSOLLE PROGRAMMAZIONE	NR	1,000


Guard rail

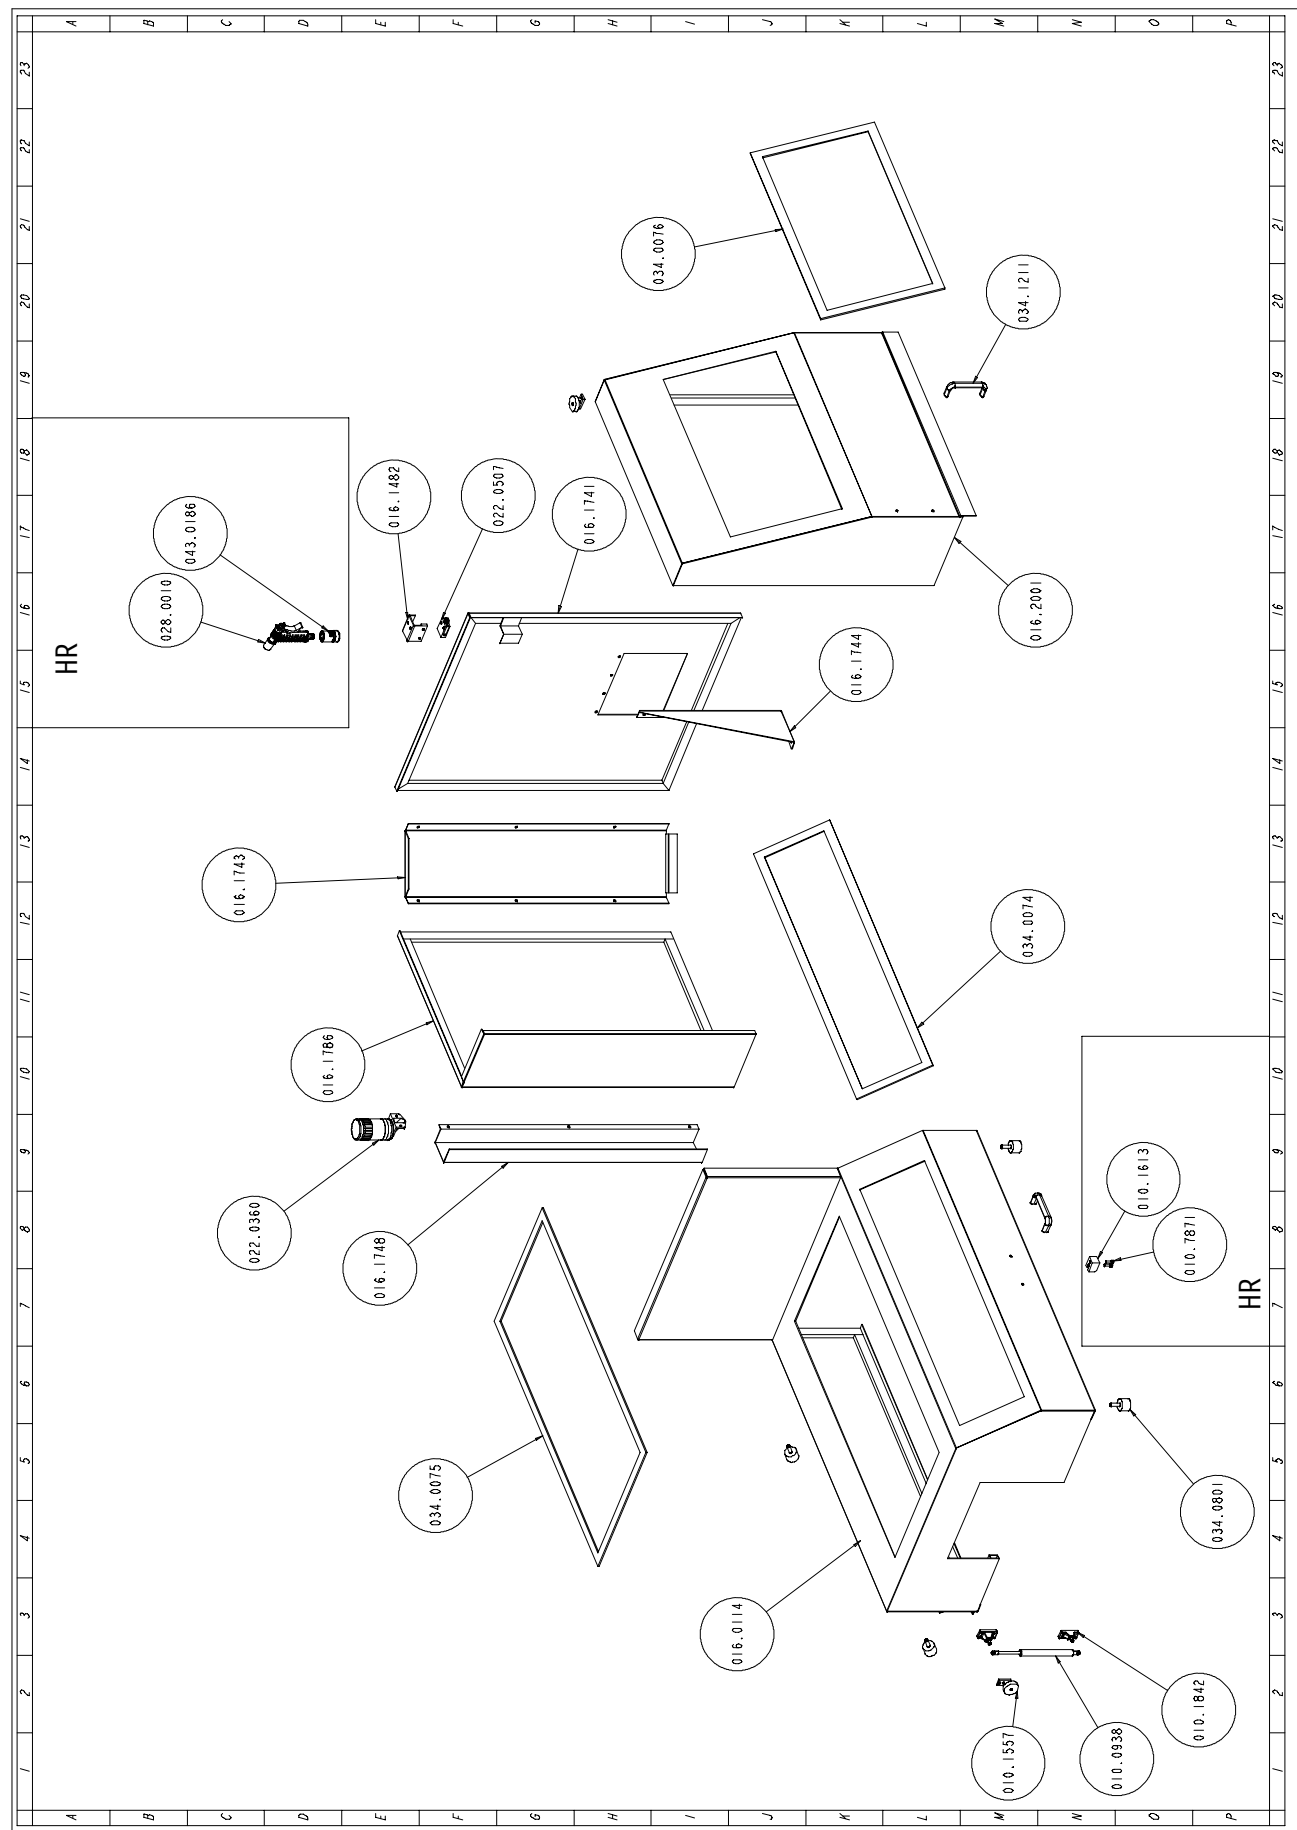



Code	Description	U. of M.	Quantity
010.0938	MOLLA GAS 120MM.	NR	1,000
010.1557	STAFFA COMANDO F.C.PROTEZIONE	NR	2,000
010.1613	TASSELLO X BLOCCAGGIO COPERCHI	NR	1,000
010.1842	SUPPORTO MASCHIO X MOLLA A GAS	NR	2,000
010.7871	VITE TCEI 6 X 20	NR	2,000
016.0114	CARTER ALIMENTATORE TI 370 N.T	NR	1,000
016.1482	STAFFA FISSAGGIO FINECORSO SPO	NR	1,000
016.1741	PROTEZIONE LATERALE TI 370	NR	1,000
016.1743	PROTEZIONE ANGOLO TI 370	NR	1,000
016.1744	RINFORZO PROTEZIONE LATERALE T	NR	1,000
016.1748	PROTEZIONE CAVI TI 370 CNC	NR	1,000
016.1786	PROTEZIONE POSTERIORE TI 370 C	NR	1,000
016.2001	SPORTELLLO PROTEZIONE MACCHINA	NR	1,000
022.0360	LAMPEGGIANTE	NR	1,000
022.0507	FINECORSO D4C-1G02 1M	NR	1,000
034.0074	PROTEZ.LEXAN CARTER ALIM.FRONT	NR	1,000
034.0075	PROTEZIONE LEXAN CARTER ALIMEN	NR	1,000
034.0076	PROTEZIONE LEXAN X SPORTELLLO M	NR	1,000
034.0801	ARRESTO ELASTICO P 40/30	NR	4,000
034.1211	MANIGLIA GN-565-20-128.SW	NR	2,000

# Adjustments

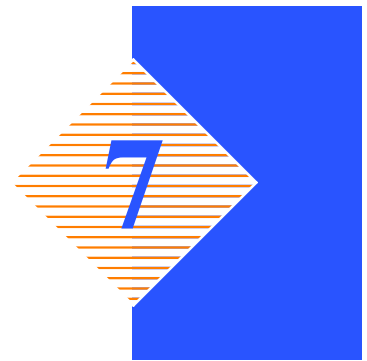


This chapter describes the adjustment operations of the electronic, mechanic and pneumatic systems. These indications will help you to customize your machine for the cut to be executed, thus improving operations.

## Displaying and editing the set-up parameters

The machine set-up parameters may be programmed directly from the control console. Set-up parameters vary according to the machine, an envelope containing all the standard set-up values can be found inside the control panel.

- ▶ Connect the power supply;
- ▶ press F1;
- ▶ enter the password by typing: 734533 (the numbers are displayed as black rectangles), press ENTER and the machine set-up page will be displayed on the screen.

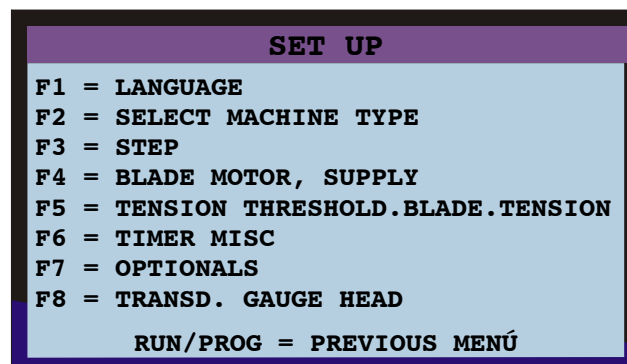

### Set language parameter


- ▶ Press F1 to access language SET UP, select relative number and press ENTER to confirm;



- ▶ press RUN/PROG to return to previous menu.

## Set parameter for machine type


- Press F2 to enter SET UP, select machine type, select relative number and press ENTER to confirm.

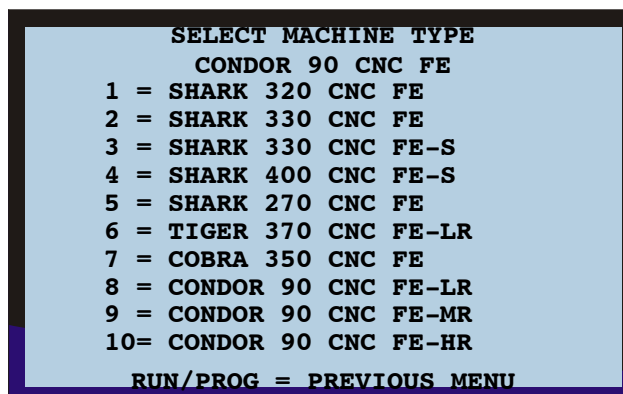


- Press RUN/PROG to return to PREVIOUS MENU.

## Set parameter for step motor

- Press F3 to enter step motor SET UP.

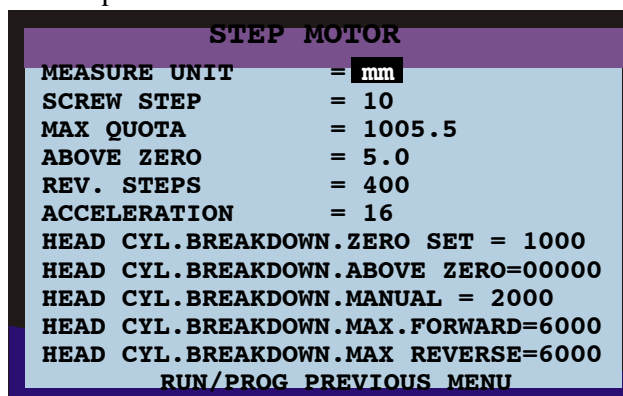

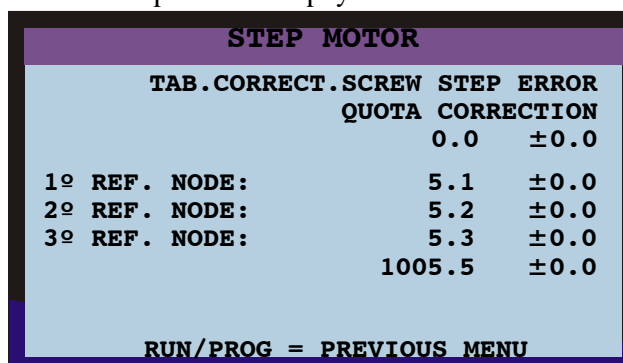

- Set parameters highlighted on display and press ENTER each time to confirm and change subject; use numerical keys to set numerical values and press F1 or F2 to set unit measures such as mm or inches.
- Press RUN/PROG. to return to PREVIOUS MENU. Or press ENTER, to enter second SET UP step motor display.



- We can now correct the measurement error of the fed material. This adjustment is to be carried out when the cut is longer or shorter than the value indicated by the machine. By increasing the screw step correction value (displayed on the right) we can compensate for any errors due to wearing of the screw in the following way:

- ▶ the cursor is automatically positioned on the first node, set the required quota and press ENTER;

STEP MOTOR			
TAB.CORRECT.SCREW STEP ERROR			
		QUOTA	CORRECTION
		0.0	±0.0
1º REF. NODE:		5.1	±0.0
2º REF. NODE:		5.2	±0.0
3º REF. NODE:		5.3	±0.0
		1005.5	±0.0
RUN/PROG = PREVIOUS MENU			

- ▶ the cursor then moves to the correction value: if the actual piece measurement is lower, press  and add the difference; if the measurement is higher, press  to subtract the correction value;

STEP MOTOR			
TAB.CORRECT.SCREW STEP ERROR			
	QUOTA	CORRECTION	
	0.0	±0.0	
1º REF. NODE:	5.1	±0.0	
2º REF. NODE:	5.2	±0.0	
3º REF. NODE:	5.3	±0.0	
	1005.5	±0.0	


- ▶ proceed in the same way for the other nodes. The machine automatically assumes the value of the last node and therefore the correction value must be added.

The machine may have the STEP–MOTOR screw at 5 or 10mm steps. To change the SCREW STEP which is set in the above screen at 5 mm (full step) with REV. STEP = 200, both the SET–UP screen and the STEP–MOTOR driver must be configured.

- ▶ For this adjustment, the machine must be on: identify the STEP MOTOR driver in the electric cabinet.



- The dip switches at the top are used for the configuration;

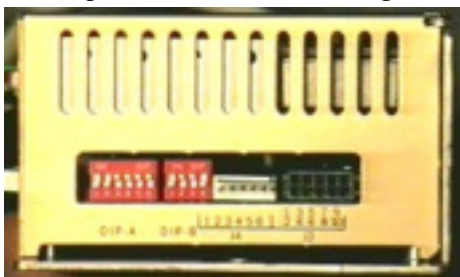

- The fourth dip-switch in the bench B, together with the RV6 potentiometer, determines the current values for the feeder step motor: set the dip-switch ON.
- Rotate the trimmer RV6 till displaying 0, which corresponds to a 10-A current.
- Set again the dip-switch B-4 OFF.



SURFACE B CONFIGURATION				
1	2	3	4	SCREW PITCH
OFF	ON	ON	OFF	5

**N.B.** Chapter 6 contains the tables which illustrate the allowable configurations of the driver.

- Set the current screw step values on the control console: e.g. SCREW-STEP = 10 (1/2 step) and REV. STEP = 400.
- The driver can now be carefully put back into its original position. Restore the machine.

STEP MOTOR	
MEASURE UNIT	= mm
SCREW STEP	= 10
MAX QUOTA	= 1005.5
ABOVE ZERO	= 5.0
REV. STEPS	= 400
ACCELERATION	= 16
HEAD CYL.BREAKDOWN.ZERO SET = 1000	
HEAD CYL.BREAKDOWN.ABOVE ZERO=00000	
HEAD CYL.BREAKDOWN.MANUAL = 2000	
HEAD CYL.BREAKDOWN.MAX.FORWARD=6000	
HEAD CYL.BREAKDOWN.MAX REVERSE=6000	
RUN/PROG = PREVIOUS MENU	

- Press RUN/PROG to return to PREVIOUS MENU.
- N.B.** The "MAX. UPSTROKE SPEED" parameter must be 2000 when the machine is connected to the bar store.

## Setting blade characteristics, head downstroke speed and bar initializing

These parameters are accessed by pressing F8 on the work video pages of the automatic cycle.

X =	<b>OPERATING CYCLE</b>		
θ =	<b>AUTOMATIC</b>		
W =	PGR. NO	MEASUR.	CUTS PROG.
F = 153	10	905,7	2343
S =	<b>SINGLE CYCLE</b>		
kg= 10	RUN/PROG=PROGRAMMING		
DL= 0	F0 = PGR. SINGLE		
SL= 3,8	F9 = MAIN MENU		
AM= 0.0	F8 = BLADE THICKNESS		
A = 0.1	F7 = SING/CONT CYCLE		
T = 0: 0	F6 = EXEC. STEP/CONT		
TT= 0:10			
F1= SMS NO			

- Press F8 to display the SET UP in order to set: the blade thickness expressed in millimeters, the programmed and residual life of the tool, the maximum current of the blade motor, the opening speed of the cutting head downstroke valve, the size of the bar initialization.

<b>BLADE THICKNESS</b>	<b>= 3,8</b>
<b>BLADE LIFE</b>	
<b>RESIDUAL</b>	<b>= 0 m</b>
<b>PROGRAMMED</b>	<b>= 0 m</b>
<b>MAXIMUM BLADE MOTOR CURRENT</b>	
<b>HARE 2ND SPEED AMP.</b>	<b>= 19.9</b>
<b>MOTOR RAMP TIME CPT</b>	<b>= 1</b>
<b>RUN/PROG = PREVIOUS MENU</b>	

- To enter data, move and confirm by pressing ENTER.
- Press RUN/PROG to return to PREVIOUS MENU.

## Blade motor and supply unit setting

The Blade Motor Stop parameter can be used to stop the blade in the FCTA (Head Forward Travel Limit) position, the FCTI (Head Back Travel Limit) position, or in no position at all. The Park Feeder parameter is used to stop the feeder carriage forward (near the cutting vice) or back (as during normal machine operation).

- From the SET UP menu press F4 to change:

<b>BLADE MOTOR STOP</b>	<b>= 2</b>
<b>(0 = FCTA, 1 = FCTI, 2 = NEVER)</b>	
<b>SUPPLY UNIT STOP</b>	<b>= 1</b>
<b>(0 = DOWN, 1 = UP)</b>	
<b>RUN/PROG = PREVIOUS MENU</b>	

- to enter data, move and confirm by pressing ENTER.
- Press RUN/PROG to return to PREVIOUS MENU.

### Set minimum blade tension threshold

- ▶ Press F6 to enter SET UP for cutting vice opening/closure timings, rotating tower lock and unlock, start and stop chip suction device, LCD lighting duration.

```

VICE OPENING/CLOSURE           = 4.5S
ROTATING TOWER LOCK/UNLOCK     = 3.0S
ON TIME CHIP SUCTION DEVICE    = 1 M
OFF TIME CHIP SUCTION DEVICE   = 5 M
LCD LIGHTING DURATION          = 3 M
(0 = INFINITE)

```

- ▶ To change the pre-set values, input the timings in seconds for the first two and in the minutes for the other three.
- ▶ Press RUN/PROG to return to PREVIOUS MENU.

### Optional settings

- ▶ Press F7 to enter optional settings SET UP.

```

INVERTER                       = YES
1a SPEED                      = NO
ROTATING TOWER                 = NO
MOTOR DRIVEN ROTATING TOWER    = NO
MOTOR DRIVEN BLADE GUIDE HEAD = NO
MOTOR DRIVEN BLADE TENSIONER  = NO

(0 =NO =ABSENT, 1 =YES =PRESENT)

RUN/PROG = PREVIOUS MENU

```

- ▶ Press 0 or key 1 to enable or disable each optional, press ENTER to go to the next up to the second visualised screen.

```

DEVIATION CONTROL. BLADE = NO
PIECE UNLOAD ROBOT       = NO
BAR MAGAZINE              = YES
GUEST BAR MAGAZINE        = NO

(0 =NO =ABSENT, 1 =YES =PRESENT)


RUN/PROG = PREVIOUS MENU

```

- ▶ Press RUN/PROG to return to PREVIOUS MENU. Press RUN/PROG to return to PREVIOUS MENU.

## Cutting head setting


The cutting head stroke is set from the machine control console. The following figure illustrates the console keys controlling the cutting head (marked Y+ and Y-) and memorisation of the cutting start position.(Blade Upstroke Limit) and cutting end position (Blade Downstroke Limit).

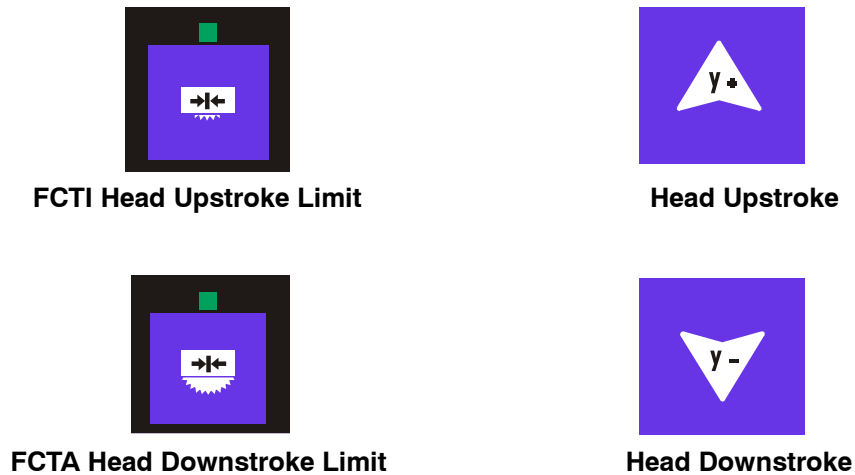

To set the cutting stroke in accordance with production requirements, refer to Chapter 5.

## Head transducer calibration Set-up

The cutting head travels the distance between the start and end cut positions within a measured range between 0÷254. Press F8 on the SET-UP menu, and RESET to start head movement and to access head transducer calibration set-up. The pre-set head movement parameters are shown below and are within the same range.

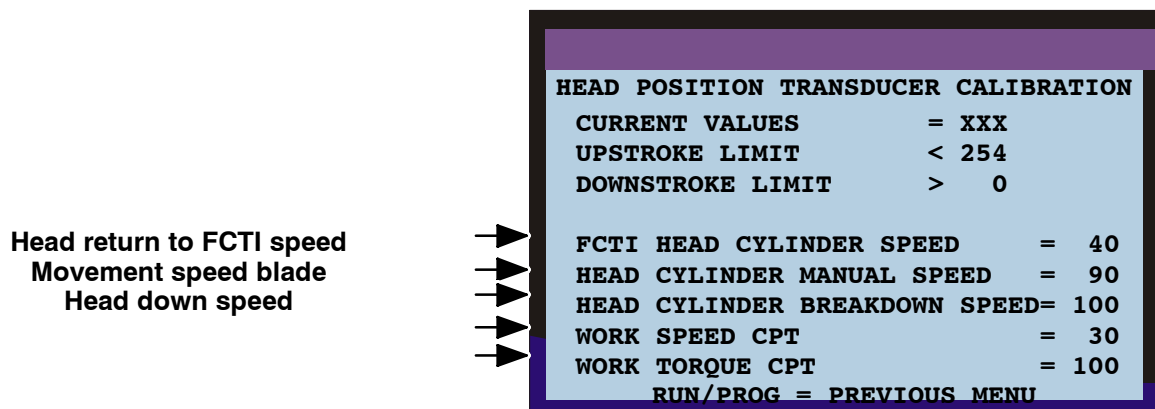


Make sure however, that the head really travels the full cutting width defined by the structural limits of the Head Upstroke and Head Downstroke Limits. The aim of regulation is that of setting the value of the real position of the head both to FCTI (backward limit stop 254) and to FCTA (forward limit stop 000). The following operations must be performed to obtain this result. Make sure however, that the head really travels the full cutting width defined by the structural limits of the Head Upstroke and Head Downstroke Limits.



The aim of regulation is that of setting the value of the real position of the head both to FCTI (backward limit stop 254) and to FCTA (forward limit stop 000). The following operations must be performed to obtain this result.

- Now, set the head upstroke limit by returning the head to its fully up position using the up button (Y+).
- Open the electrical cabinet and locate the IUD Card shown in the figure:



-

+


401

406

CPU	IUV	IUD3	IUD2	IUD1
81	401	101	101	101
82	402	302	202	NC
401	403	303	203	NC
407	404	304	NC	NC
68	405	305	205	105
69	406	306	206	106
PE		307	207	107
NC		308	NC	108
NC		101	209	NC
PE			101	101
	411			
	412			
	413			
	414			
	415			
	416			
①				
⑥				
②	421	NC	NC	NC
⑦	422	312	NC	NC
③	423	313	NC	113
⑧	424	NC	NC	216
④	425	315	NC	115
⑨	426	316	NC	116
⑤	427	NC	NC	117
	428	NC	NC	118
	429	NC	219	119
	430	120	120	120

↑

- two potentiometers are mounted under the IUD card terminal board. Using a screwdriver, turn the adjustment screw on the upper potentiometer (as shown in the figure) until you obtain a reading of between 254. This reading is displayed on the machine display.

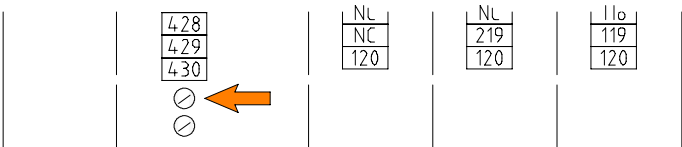


- Return the machine to normal operating conditions and test to make sure it is functioning correctly.

## Electronic systems

### Replacing the microchip C8 on the control console

To do this first disconnect the machine from the power supply and open the front panel on the control console which houses the console card. Microchip C8 is located at the front of the card (as indicated by the arrow). A label is affixed to the chip indicating the type and version of the software programme.

- Remove the old chip from its socket and replace with a new one, taking care to fit it the right way round. Follow the necessary precautions against electrostatic discharges to avoid damaging the chip (do not, for example, wear rubber-soled shoes or woollen clothing etc.). Close the control panel and test the machine.

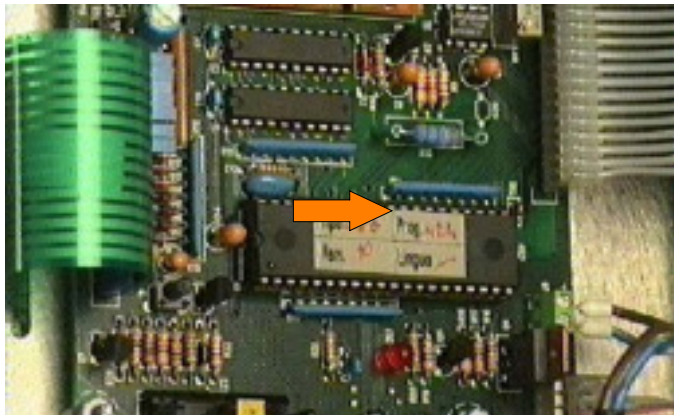

Assembly reference notch




#### Attention

Mak sure the chip is not inadvertently fitted back-to-front, as this could cause damage to the apparatus.

### Machine parameters Eeprom memory


If you have to replace the control console, transfer one of the EEPROMs from the old card to the new one in order to save all the machine parameters: the EEPROM memory is illustrated in the photo below.

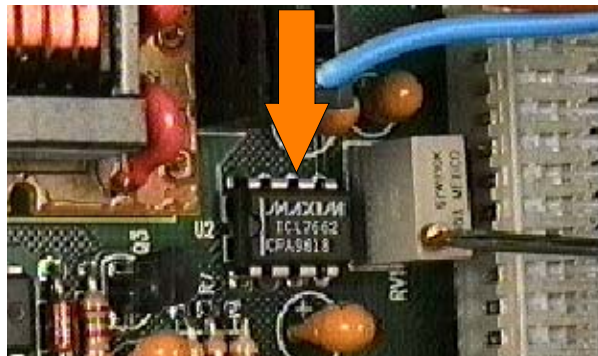


## Replacing the M24 controller Eprom

To do this, first disconnect the machine from the power supply, and open the front panel on the electrical cabinet which houses the M24 controller.

- ▶ Locate the M24 controller and unhook all the terminals relative to IUV CARD and CARDS 1-2-3.

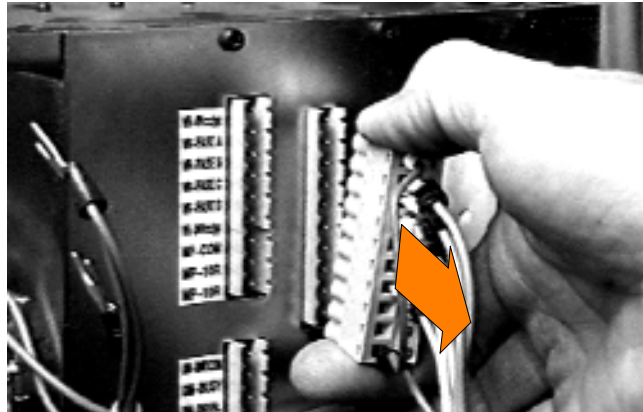


- ▶ Remove the front panel of the controller using a screwdriver to unscrew the screws which fix it to the controller.
- ▶ Slide out the IUD and IUV cards from their slots.

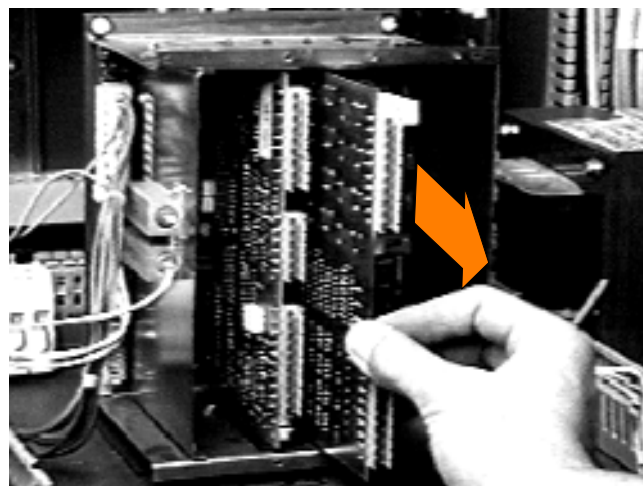

- ▶ The eprom is mounted on the lower section of the CPU card (as indicated by the arrow in the photo below).



- ▶ Follow the necessary precautions to protect against electro–static discharges to avoid damaging the chip (do not, for example, wear rubber–soled shoes or woollen clothing etc.).
- ▶ Remove the old eprom from its socket and replace with a new one, taking care to fit it correctly (see photo below).

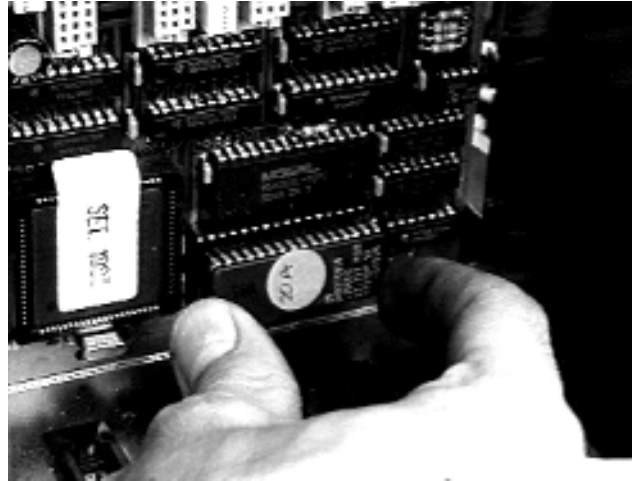

Assembly reference notch




- ▶ Refit the cards in their housings, close the controller with a guard panel and reinsert the terminals. Test the machine

### Adjusting the display brightness

If external factors like changing ambient lighting conditions in the machine installation site, affect visibility, adjust the brightness of the control and programming console display. This is very important since the operator must be able to clearly read the display messages at all times.

- ▶ To adjust the brightness, first remove the screws fixing the front console panel. The photo below illustrates the M24 controller card on which the brightness potentiometer is marked by an arrow.

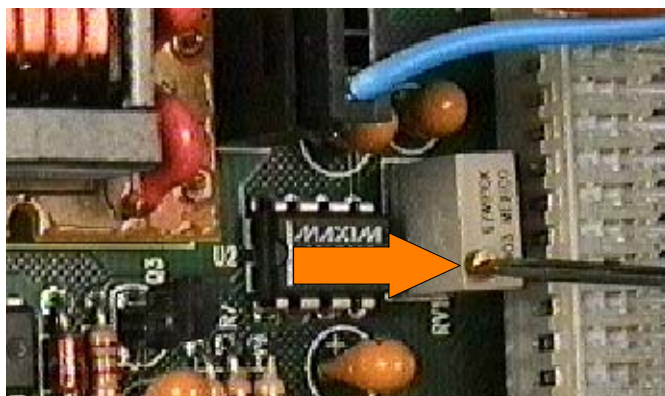


- ▶ Using a screwdriver, rotate the potentiometer until the required display brightness is obtained.

## Mechanical systems

### Cutting head stroke

The head cutting stroke is defined by the cut start position (Head Upstroke Limit) and cut end position (Head Downstroke Limit) which are electronically programmed by the control console. The cutting head is also equipped with a mechanical stop which defines the bottom limit of its stroke:


- to adjust this stop, use two hex wrenches, one to lock the nut and the other to tighten or slacken the stop screw.

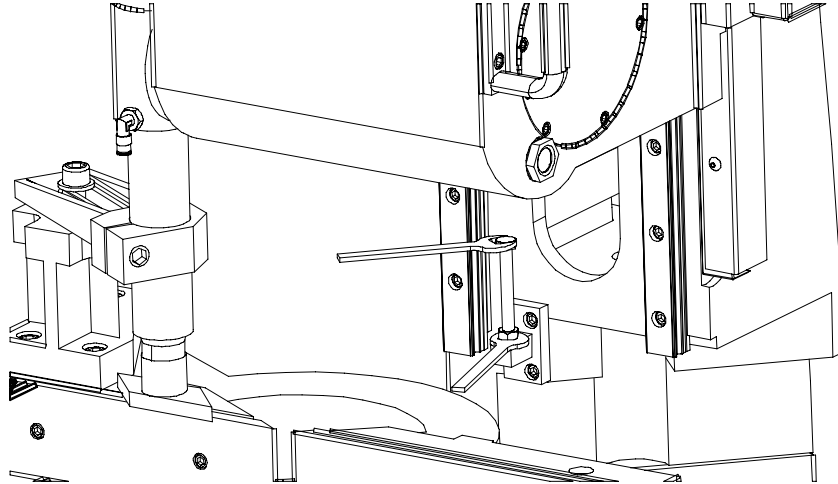


### Adjusting the position of the blade-cleaning brush

When the cutter disk is not clean enough, check the blade-cleaning brush for wear and if it's working correctly. The figure below illustrates how the brush should be adjusted if need be.

- Loosen the screw highlighted in the drawing, and remove the protection;

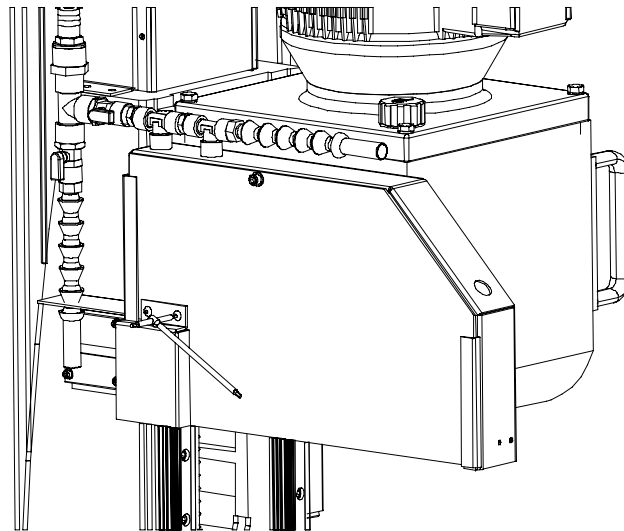


- 
- adjust the position of the blade in relation to the teeth, as shown;

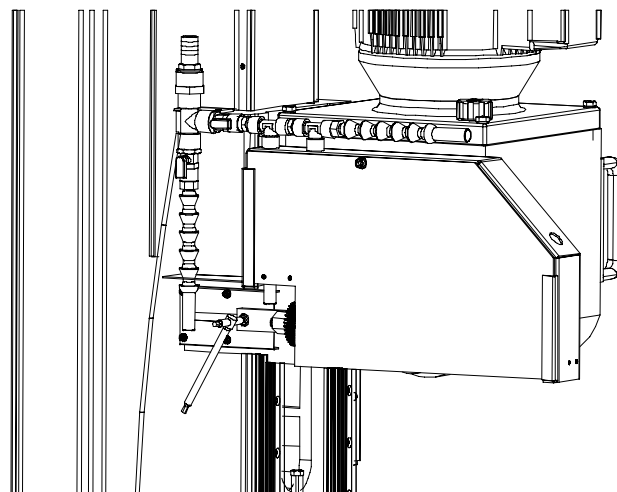


## Replacing tool

As we have already said, this machine uses different kinds of blades according to the material to be cut. The procedures described below, however, also apply in the event of wear or breakage of the blade. To replace the blade, proceed as follows:

- ▶ switch off the machine and position the head so that the disc is easily accessible;
- ▶ the machine is equipped with a vertical pneumatic vice that can be moved away from the guard by unfastening the screw fixing it to the support;
- ▶ remove the screw with knob to free the plexiglass guard cover and lift it off in a vertical direction;

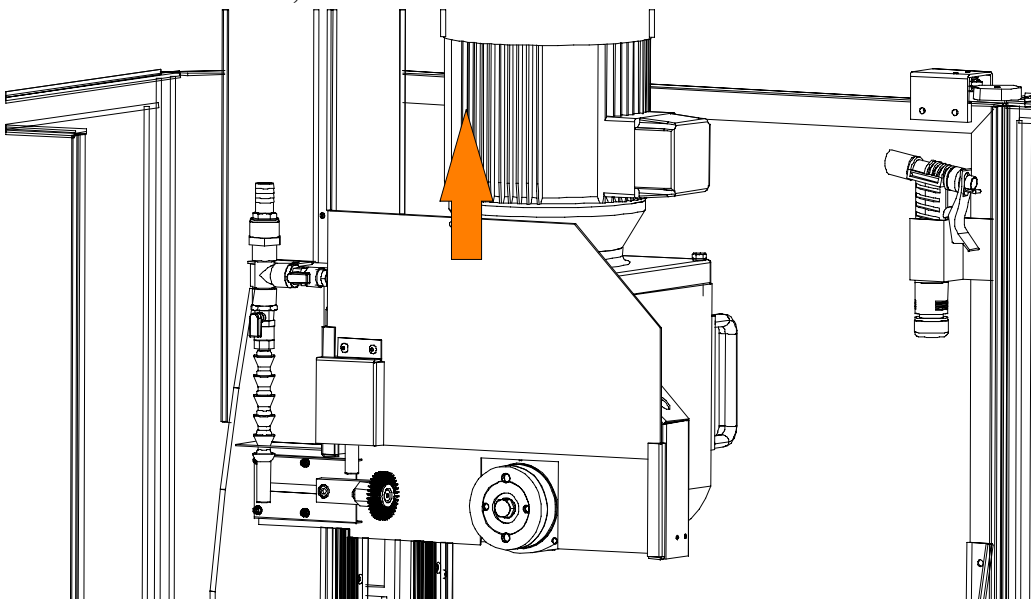


- ▶ use a 19 mm spanner to slacken the hexagonal screw that locks the disc, turning the spanner in the direction of rotation of the disc; remove the old disc and insert the new one, making sure that the centering pins fit correctly into the holes in the disc.

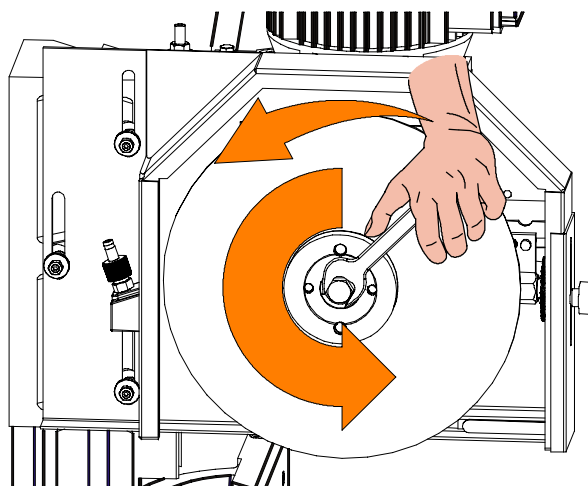


### Attention

Make sure that the teeth on the cutter blade are facing in the direction of rotation. When changing the tool, turn the cutter blade until drive is engaged to eliminate any backlash in the drive pins.



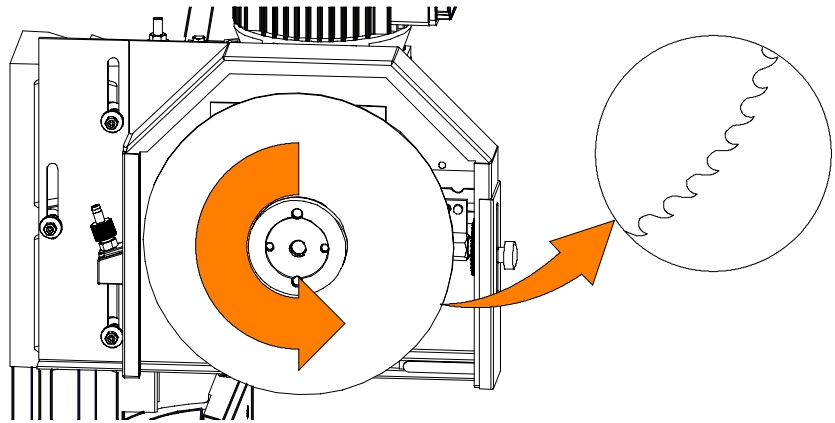

- Tighten the lock nut and refit all guards and any other components you may have removed to facilitate installation.

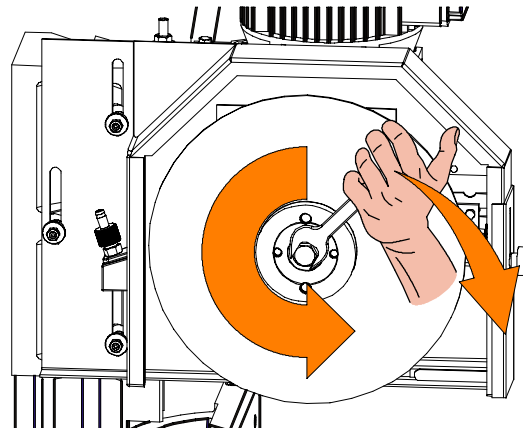

**N.B.** Adjust the position of the blade-cleaning brush, or replace it when worn.


#### Attention

If disks are fitted with diameters less than 370 mm, adjust the head mechanical stop screw as described above.

### Feeder


Should the feeder at a later stage in time become misaligned with the cutting table, then use the levelling devices located on the side of the machine and the loading table to restore. Misalignment can be measured using a workshop standard ruler or a straight bar section.

- Lower the rear guard rail.
- Place the ruler on top of the feeder to check that the feeder is parallel to the cutting table.

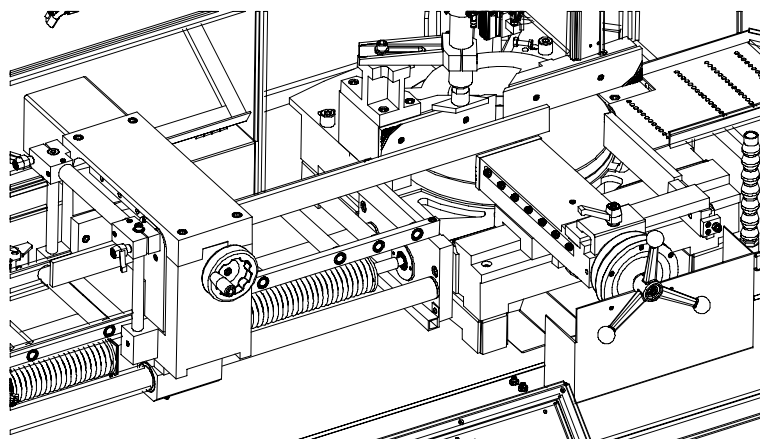





- If the feed table is not parallel to the cutting table, move the feed carriage away from the platform, then loosen the fixing TCEI screws on the feeder (A–B).

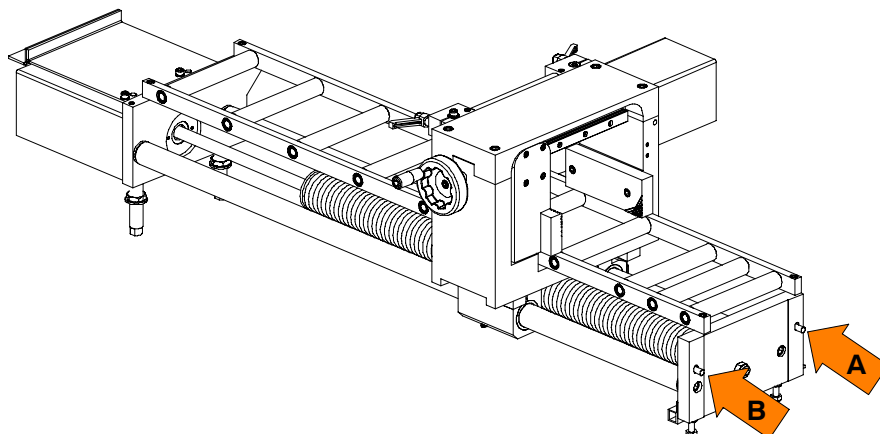

- Adjust the foot height (D–E), according to the measurement read on the ruler on the cutting table so as to obtain a difference in level of 0.5 mm between the two tables.

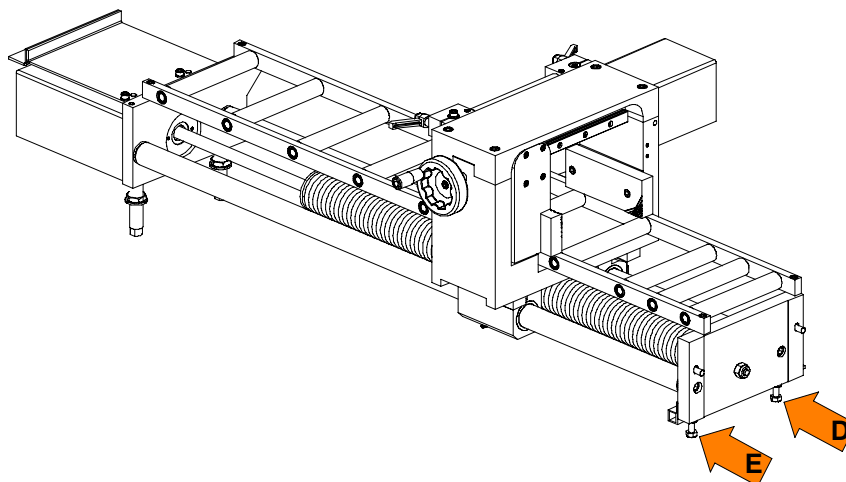

- Once the height has been set with a standard ruler near the fixed platform, line up the rest of the feeder using the support pins to adjust as shown in the figure;

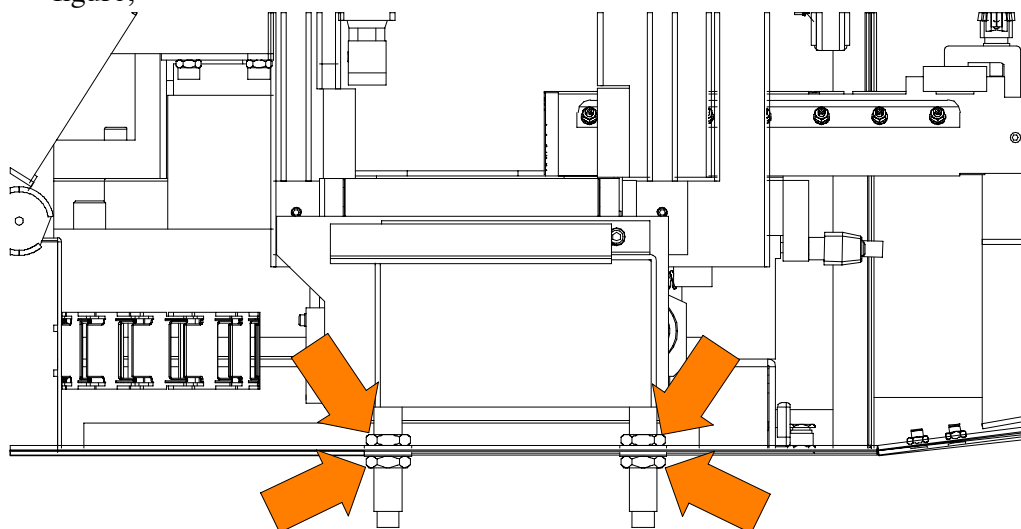

- open the left door panel on the base to access the adjustment nuts and the 4 support pins;


## Vice

The shearing vice, which is a standard fitting on the **CNF 400 CNC**, is equipped with an anti-chip device, adjustable cross positioning, and is driven by a pneumatic cylinder known as the volampress. These elements will be dealt with one by one in the following.


### Adjusting the vice play

Any play which develops between the slideway and the slide gibs on the vice must be compensated by adjusting the grub screws setting the distance between the gib and lead screw, proceeding as follows:

- ▶ slacken all the locknuts on the grub screws in the slide, holding the screws still using an Allen key.
- ▶ move the vice to its fully open position.

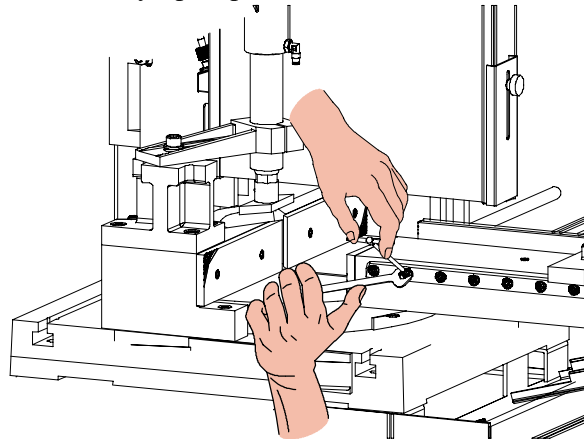

- ▶ adjust the slight pressure exerted by the grub screws on the gib, starting with the first two in contact with the lead screw.
- ▶ adjust these two grub screws and tighten the relative lock nuts, keeping the screws still with an Allen key.

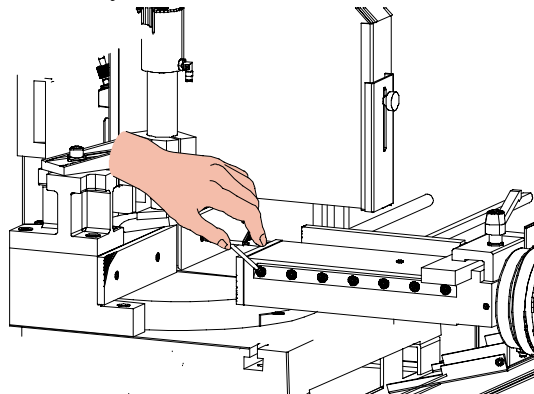


- ▶ close the vice until the other two grub screws coincide with the lead screw.
- ▶ repeat this adjustment on the gib grub screws for the entire length of the slideway
- ▶ at the end of the operation, use the handwheel to move the slide backwards and forwards, identifying the zones where the grub screws exert greater pressure on the gib.
- ▶ repeat the adjustments if necessary.
- ▶ tighten or loosen the upper nuts on the supports according to the reading obtained with the standard ruler on the machine work table.

### Adjusting the anti-chip device

The vice is fitted as standard with a rag prevention device that serves to support the material and prevent the formation of ragged edges at the end of the cut. To adjust the rag prevention device transversely:

- ▶ loosen the release lever (1) located above the vice slide;
- ▶ movement the rag prevention device arm to the right or left;
- ▶ tighten the release lever.

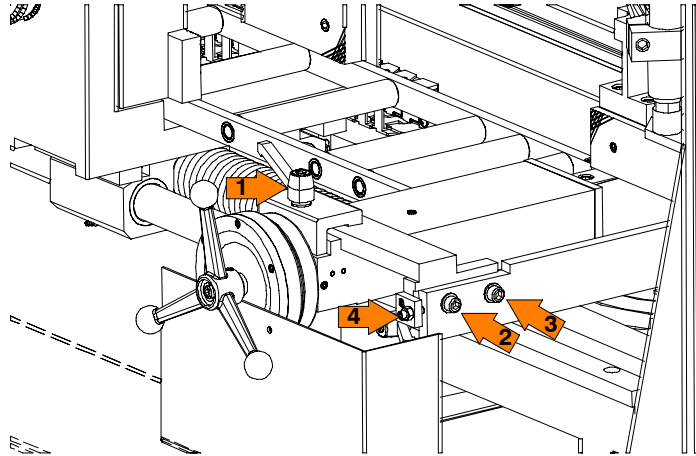


To adjust the longitudinal position of the vice jaw, proceed as follows:

- ▶ tighten the cutting vice completely;
- ▶ slacken the two screws located to the side of the rag prevention device (2–3);
- ▶ slacken the nut that locks the grub screw;
- ▶ adjust the longitudinal position of the rag prevention vice jaw by slackening or tightening the grub screw (4) until the position of the rag prevention jaw is aligned with that of the cutting jaw;
- ▶ hold the bolt still using the hexagonal key and tighten the blocking nut.

---

# Maintenance and choice of consumables

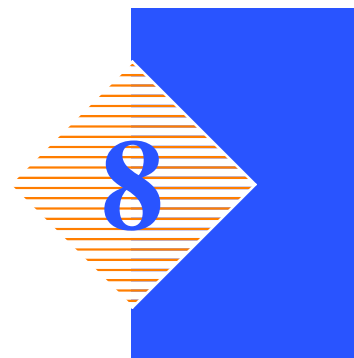

**CNF 400 CNC** is built to be sturdy and long-lasting. It has no need of any special maintenance, though, like all other tools, it needs adjusting from time to time, especially if not regularly looked over or used without due care.

This chapter, therefore, is intended as a guide for those who want to look after the machine and get the most out of it for as long as possible.

## The role of the operator

The person operating and maintaining the machine must follow these instructions for his own safety, as well as for the safety of other personnel, and in the interests of machine productivity:

- check that his own work and that of the other operators of the machine always complies with the relevant safety standards. Therefore, check that the safety devices are in position and work perfectly and that personal safety requirements are complied with.
- ensure that the working cycle is efficient and guarantees maximum productivity, checking:
  - ✓ the functions of the main components of the machine;
  - ✓ the sharpness of the blade and coolant flow;
  - ✓ the optimum working parameters for the type of material.
- check that the quality of the cut is that required and that the final product does not have any machining defects.

## Maintenance requirements

- All ordinary and extraordinary maintenance must be carried out with the power switched off and the machine in emergency condition.
- To guarantee perfect operation, all spare parts must be Hyd-Mech originals.
- On completion of maintenance works, ensure that the replaced parts or any tools used have been removed from the machine before starting it up.
- Any behaviour not in accordance with the instructions for using the machine may create risks for the operator.
- Therefore, read and follow all the instructions for use and maintenance of the machine and those on the product itself.

## General maintenance

### Daily

The daily maintenance operations to carry out on the machine are as follows:

- ▶ remove all swarf from the machine (using compressed air or preferably thread-free cloth;
- ▶ top up the lubricant/coolant fluid level;
- ▶ check the wear of the blade and change if necessary;

### Weekly

The weekly maintenance operations are as follows:

- ▶ remove all swarf from the machine;
- ▶ empty the chip drawer on the side of the pedestal;
- ▶ clean the vice and lubricate all the joints and sliding surfaces using a good quality oil;
- ▶ check the oil level in the drive box: if necessary top up through the filler cap;
- ▶ Check the cutting clamp slide, if it is not precise or there is sideways movement, regulate as indicated in chapter 7.

---

## Monthly

This section lists the operations to be carried out for the monthly maintenance of the machine.

- ▶ clean thoroughly the water tank and the electric pump filter;

## Maintenance of working parts

During maintenance work on the **CNF 400 CNC**, special attention should be paid to operating units such as the transmission box.

### Transmission box

After 100 work hours, empty the drive box using the following procedure:

- ▶ remove the outlet plug, collect oil in a container for used oils; to speed up the operation remove the inlet plug positioned on the top of the head;
- ▶ once the operation is complete, replace the outlet plug and fill with AGIP BLASIA 320 S oil, or equivalent, up to the point indicated by the level plug positioned on the right-hand side of the head;
- ▶ after every 2000 working hours repeat the oil change operation.

## Consumable materials

It is essential to use specific oils for the pneumatic and lubricant/coolant circuits. The oils suitable for each of these circuits are listed below.

### Oils for transmission box

The machine is supplied with AGIP BLASIA 320 S oil, ISO and UNI symbol CC320. However the following oils can be regarded as compatible or with equivalent characteristics:

SHELL TIVELA 320 SC

Transmission box:

– capacity Kg. 10

### Oils for lubrication/coolant liquid

The oil used for the lubrication/coolant fluid in the machine is CASTROL Syntolin TFX. Though there are no specific standards for these types of oils, Hyd–Mech considers that CASTROL Syntolin TFX is the best product available with regard to quality:price ratio. Nevertheless, the following oils of similar characteristics can be said to be compatible:

AGIP NB 200 – SHELL Lutem TT – IP Utens Fluid–F


Finally, one particular blade manufacturer (LENOX) recommends and supplies a coolant under the name of LENOX BAND–ADE SAWING FLUID.

Coolant tank:

– tank capacity 50 litres

– oil concentration 5–6%

# Cutting speed and choice of tools

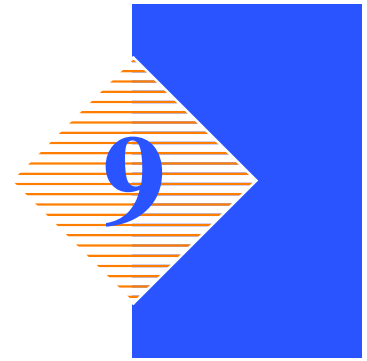

The cutting speed depends on the disk rotation speed and supply speed. This chapter illustrates the speed tolerance of the basic version of the machine.

## Cutting speed

### Basic version

The basic version, with 2/4–pole motor, is available with the following cutting speeds:

first speed (turtle) 1400 rpm and second speed (hare) 2800 rpm.

## Choice of blade

The different types of blade that can be used for the **CNF 400 CNC** must in any case respect the following general characteristics:





- “Fine tooth pitch”: for thin wall materials such as sheet steel, tubes and profiles;
- “Coarse tooth pitch”: for large cross-sections; for soft materials (aluminium alloys and soft alloys in general).

### Tooth pitch

The choice of the most suitable tooth pitch depends on various factors:

- the size of the section;
- the hardness of the material;
- wall thickness.

Solid sections call for discs with a coarse tooth pitch, while small cross-sections require blades with finer teeth. This is because when cutting walls of small cross-section (1 ÷ 7 mm) profiles, it is important that the number of teeth actually making the cut should not be too small, otherwise the effect obtained will be one of tearing rather than of swarf removal, leading to a large increase in shearing stress. On the other hand, when cutting thick materials or solid sections using an excessively fine tooth pitch, the swarf collects as a spiral inside the gullet, and since fine tooth pitches have small gullets, the accumulated swarf will exceed the gullet capacity and press against the walls of the workpieces, resulting in poor cutting (same situation with soft materials), greater shearing stress and hence breakage of the blade.

Choice of tooth pitch T as a function of cross-section to be cut for light alloy solid pieces and profiles			
 S 		 S  sp	
S in mm	Pitch T	S and sp in mm	Pitch T
10	4	10 sp = 0,5	3
30	6	30 sp = 1,5	4 – 5



**Choice of tooth pitch T as a function of cross-section to be cut for light alloy solid pieces and profiles**

50	8	50 sp = 2,5	5 – 6
70	10	70 sp = 3,5	6 – 7
90	12	90 sp = 4,5	7 – 8
130	16	130 sp = 6,5	8

**KEY:**

S = diameter or width of the solid piece to be cut in mm;

sp = thickness of the wall to be cut in mm;

T = tooth pitch in mm.

A larger pitch should be chosen when, as a result of the shape of the piece to be cut, the cross-section at any given point exceeds the average cross-section given above.

**Types of swarf:**

- Very fine or fragmented swarf indicates that the downstroke speed and/or cutting pressure is too low.



- Thick and/or blue swarf indicates that the blade is overloaded.



- Long coils of swarf indicate ideal cutting conditions.

**Cutting and feeding speed**

The cutting speed, in m/min, and the head feeding speed, in cm<sup>2</sup>/min, are limited by the amount of heat generated near to the points of the teeth. If the head feeding speed is too high, the cut will not be straight in either the vertical or the horizontal plane. As we have already said, the cutting speed depends on the

strength ( $\text{kg/mm}^2$ ) and hardness (HRC) of the material and the dimensions of the thickest section. The feeding speed depends on the cross-section of the material. Solid or thick-walled materials (thickness  $> 5 \text{ mm}$ ), can therefore be cut at high speed providing there is sufficient swarf removal by the blade, while thin-walled materials such as tubes or thin profiles must be cut with a low feeding speed. A new blade requires a wearing-in period, during which time a feeding speed of about half normal speed should be used.

### Lubricant/coolant

The lubricating/cooling fluid must ensure that the blade teeth and material in the area of the cut do not overheat. Furthermore, the quantity and pressure must be sufficient to remove the swarf from the cutting zone. The fluid must be an excellent lubricant, such that prevents abrasion of the teeth and welding of the swarf to the teeth themselves (seizing).

### Blade structure

The circular blades most frequently used for cutting-off machines are HSS–DMo5/M2 consisting of a single piece and characterised by a high level of toughness and a good cutting resistance. With non-ferrous materials it is normal to use circular blades with brazed hard metal (HM) cutting edges, which offer excellent resistance to wear but low resistance to impact, which in any case is not generally a problem with non-ferrous materials.

They consist in a disk made of alloy steel (71 Cr 1) with teeth and places for the plates, made of Widia K10.

Key									
Mo	Molybdenum	Ni	Nickel	Si	Silicon	V	Vanadium	W	Tungsten
Al	Aluminium	C	Carbon	Co	Cobalt	Cr	Chromium	Mn	Manganese

TYPE OF BLADE	C	Cr	W	Mo	V	Co	HRC
HSS-DMO 5/M2	0,47	1,00	6,37	1,00	0,12		45-50
HM ø 300x32x3,4	0,71 ÷ 0,78	0,20 ÷ 0,30					43 +/- 1

**N.B.** The numbers in the columns indicate the % content of the element in the steel.

Types of blades


The blades fitted to the **CNF 400 CNC** have dimensions 400x32x3,8 mm and are of HM hard steel type since the machine is to be used for cutting non–ferrous materials. In addition to the size and pitch of the teeth, however, the blades also have different geometric characteristics in accordance with their particular use:

- tooth sharpening, which in this case may be BW with alternate raked tooth or C with roughing tooth raked on both sides and non–raked finishing tooth;
- tooth pitch, the distance between the crests of two subsequent teeth (tooth pitch = T).

Tooth shape

“C” TYPE SHARPENING (HZ)

Coarse toothing with roughing tooth raked on both sides and non–raked finishing tooth. The roughing tooth is about 0.3 mm higher.

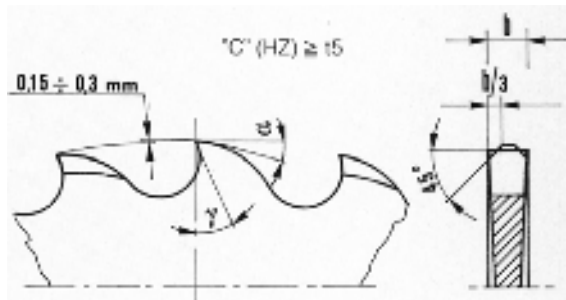


Coarse toothing with roughing tooth and finishing tooth. Used in saws with pitch greater than or equal to 5 mm for cutting ferrous and non–ferrous materials with solid or solid–profiled sections.



“BW” TYPE SHARPENING DIN 1838–UNI 4014

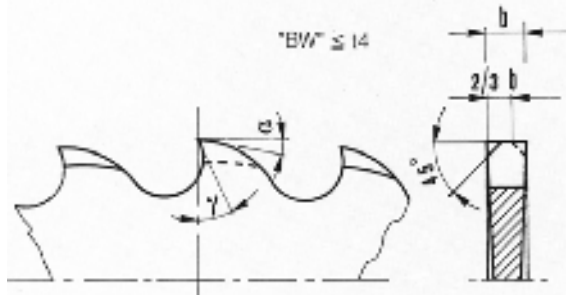


Coarse toothing with teeth alternately raked to the right and left.



Toothings generally used on cutting–off machines for cutting ferrous and alloy materials with tubular and profiled sections.




The disks for the **CNF 400 CNC** are Ø 400x32x3,8 with C–type sharpness; however, also the tooth pitch is important, as indicated in the table below.


								
D.	T	Z	D.	T	Z	D.	T	Z
300	5	180	275	5	180	250	8	120

## POSITIVE AND NEGATIVE CUTTING ANGLES


The cutting angle  $\gamma$  may vary from positive to negative depending on the cutting speed, the profile and the type of material to be cut.

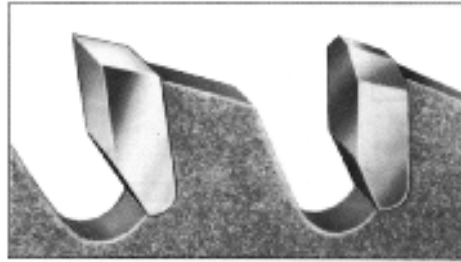


A positive angle  $\gamma$  determines better penetration of the tool and hence lower shear stress and greater ease of sliding for the swarf over the cutting edge. On the other hand, the cutting edge has lower mechanical resistance, so as the breaking load of the material to be cut increases, the cutting angle decreases from positive until it becomes negative so as to offer a cutting edge with a larger resistant section.

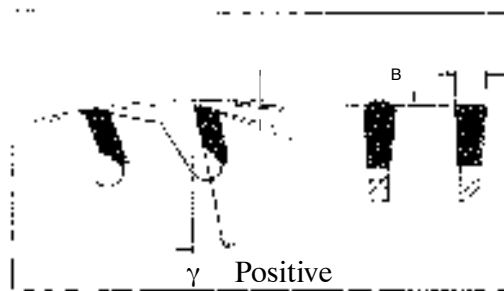

Short swarf material such as brass, bronze, aluminium and hard cast iron require smaller cutting angles because the swarf becomes crushed immediately and the rake angle has little effect during the cutting stage.

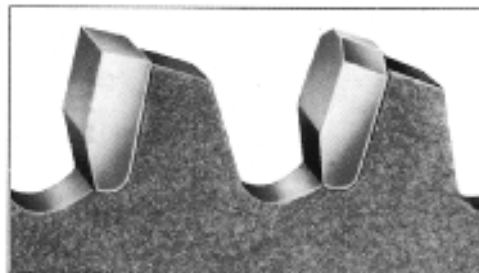

The **CNF 400 CNC** uses discs with positive cutting angles for cutting solid materials and with negative cutting angles for cutting hollow profiles. This is because, as a result of the high cutting speeds (2900 rpm), even with non-ferrous materials the tool "strikes" against the wall of the profile to be cut several times, thus requiring a cutting edge with a larger resistant section.

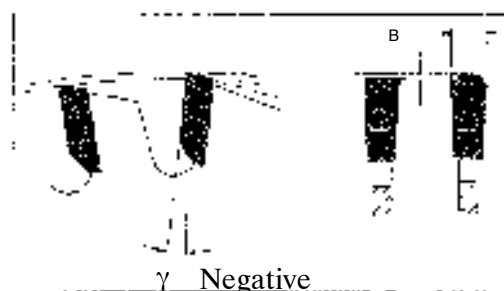


Circular saws can also be characterised by other parameters such as the whine reduction feature, which cuts down noise at high speeds, or expansion, which compensates for the pushing of swarf inside the cutting edge, thus reducing the thrust on the walls of the material to be cut.



Whine reduction feature

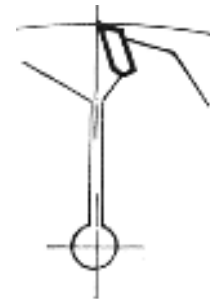

Expansion cut



This table can be used to facilitate the choice of toothing since it takes into account both the size of the material to be cut and the diameter of the disc to be used.

		D 200		225		250		275		300		315		350		370		400		425		450		500	
		S	t	t	t	t	t	t	t	t	t	t	t	t	t	t	t	t	t	t	t	t	t	t	t
Solid section		10	5	6	5	6	5	6	5	6	5	6	5	6	5	6	5	6	5	6	5	6	5	6	5
		30	6	8	6	8	6	8	6	8	6	8	6	8	6	8	6	8	6	8	6	8	6	8	6
		50	100	80	120	80	128	100	140	110	160	120	90	100	120	90	110	100	120	90	110	100	120	90	110
		70								10	12	10	12	10	12	10	12	10	12	10	12	10	12	10	12
		90								12	14	12	14	12	14	12	14	12	14	12	14	12	14	12	14
		110										12	14	12	14	12	14	12	14	12	14	12	14	12	14
		130												12	16	14	16	14	16	14	16	14	16	14	16
		150																14	16	14	16	14	16	14	16
		D																							
		10	3	3	3	3	3	3	3	3	3	3	3	3	3	3	3	3	3	3	3	3	3	3	3
Hollow section		30	4	5	4	5	4	5	4	5	4	5	4	5	4	5	4	5	4	5	4	5	4	5	4
		50			5	6	5	6	5	6	5	6	5	6	5	6	5	6	5	6	5	6	5	6	5
		70								6	8	6	8	6	8	6	8	6	8	6	8	6	8	6	8
		90								8	10	7	8	7	8	7	8	7	8	7	8	7	8	7	8
		110										8	10	10	120	160	140	160	140	160	140	160	140	160	140
		130												9	10	120	110	120	110	140	120	150	130	160	140
		150														9	10	120	110	140	120	150	130	160	140
		D																							

**Blade selection table with respect to cutting speed and downstroke speed**

RECOMMENDED CUTTING PARAMETERS																												
CUTTING ANGLE			α	20	18 <th>15<th>12<th>10<th>12<th>15<th>12<th>22<th>20<th>15<th>12<th>16<th>12<th>18<th>18<th>15</th></th></th></th></th></th></th></th></th></th></th></th></th></th></th>	15 <th>12<th>10<th>12<th>15<th>12<th>22<th>20<th>15<th>12<th>16<th>12<th>18<th>18<th>15</th></th></th></th></th></th></th></th></th></th></th></th></th></th>	12 <th>10<th>12<th>15<th>12<th>22<th>20<th>15<th>12<th>16<th>12<th>18<th>18<th>15</th></th></th></th></th></th></th></th></th></th></th></th></th>	10 <th>12<th>15<th>12<th>22<th>20<th>15<th>12<th>16<th>12<th>18<th>18<th>15</th></th></th></th></th></th></th></th></th></th></th></th>	12 <th>15<th>12<th>22<th>20<th>15<th>12<th>16<th>12<th>18<th>18<th>15</th></th></th></th></th></th></th></th></th></th></th>	15 <th>12<th>22<th>20<th>15<th>12<th>16<th>12<th>18<th>18<th>15</th></th></th></th></th></th></th></th></th></th>	12 <th>22<th>20<th>15<th>12<th>16<th>12<th>18<th>18<th>15</th></th></th></th></th></th></th></th></th>	22 <th>20<th>15<th>12<th>16<th>12<th>18<th>18<th>15</th></th></th></th></th></th></th></th>	20 <th>15<th>12<th>16<th>12<th>18<th>18<th>15</th></th></th></th></th></th></th>	15 <th>12<th>16<th>12<th>18<th>18<th>15</th></th></th></th></th></th>	12 <th>16<th>12<th>18<th>18<th>15</th></th></th></th></th>	16 <th>12<th>18<th>18<th>15</th></th></th></th>	12 <th>18<th>18<th>15</th></th></th>	18 <th>18<th>15</th></th>	18 <th>15</th>	15								
			γ	8	8	8	6	6	8	6	8	6	8	10	10	8	10	8	8	8	8							
Cutting section (in mm)			10-20			T mm	5	4	4	3	2	4	4	4	25	1100	200	400	400	120	600	500	50	19	35			
			10-20			Vt rpm	50	30	20	15	9	20	20	20	20	25	1100	200	400	400	120	600	500	160	130	130		
			20-40			T mm	7	6	6	4	3	6	6	6	6	6	6	8	7	8	7	8	6	7	4	4	3	
			20-40			Vt rpm	45	30	20	15	9	19	19	23	1000	180	400	350	400	110	600	400	110	600	400	45	18	33
			20-40			Av rpm	150	120	110	60	33	45	45	100	1700	400	600	700	150	1100	600	150	1100	600	150	120	120	
			40-60			T mm	10	9	8	6	4	8	8	8	12	10	11	10	8	10	8	10	10	6	5	4	4	
			40-60			Vt rpm	45	25	18	14	9	18	18	22	900	160	300	350	100	550	350	100	550	350	45	18	30	
			40-60			Av rpm	140	110	100	50	30	45	45	90	1600	350	550	700	140	1000	600	140	1000	600	140	110	110	
			60-90			T mm	12	12	11	9	6	11	11	11	16	12	14	12	10	12	10	12	10	12	10	6	5	
			60-90			Vt rpm	40	25	17	14	8	17	17	20	800	160	250	300	90	550	350	90	550	350	45	17	30	
			60-90			Av rpm	130	110	50	50	28	40	40	80	1400	300	550	600	130	900	500	130	900	500	130	110	110	
			90-110			T mm	14	14	14	12	8	14	14	14	18	14	17	14	12	16	16	12	16	16	12	6	5	
			90-110			Vt rpm	40	20	15	13	8	15	15	19	700	140	200	250	70	500	300	70	500	300	40	16	28	
			90-110			Av rpm	110	100	80	45	25	40	40	880	1300	300	500	600	110	900	500	110	900	500	110	100	100	
			110-130			T mm	16	16	16	14	10	16	16	16	20	16	18	16	14	18	18	14	18	18	14	8	6	
			110-130			Vt rpm	35	20	14	13	7	14	14	17	600	130	150	200	60	500	300	60	500	300	35	16	26	
			110-130			Av rpm	100	90	70	45	25	35	35	70	1100	250	500	500	100	800	400	100	800	400	100	90	90	
			130-150			T mm	18	16	16	14	12	16	16	16	20	16	20	18	16	18	18	16	18	18	16	10	6	
			130-150			Vt rpm	30	15	12	12	7	12	12	16	500	130	120	150	50	450	200	30	450	200	30	15	24	
			130-150			Av rpm	90	80	60	40	22	35	35	60	900	250	400	400	90	800	400	90	800	400	90	80	80	
Recommended lubricants			Emulsion – cutting oil										Emulsion				Cutting oil				Emulsion							

## Classification of steels

The tables on this page provide users with information on materials to cut, enabling their classification with respect to hardness and consequently the correct blade to use.

Types of steel				Hardness		
UNI	DIN	BS	AISI	Brinell HB	HRB	Kg/mm <sup>2</sup>
C 22 - C 35	CK 22 - CK 3	En 2 C - En 6	1022 - 1035	160 - 170	34 - 87	55 - 59
C 45	CK 45	En 8	1040	160 - 180	84 - 89	55 - 61
C 10 - C 15	CK 10 - CK 15	En 32 A - En 328	1010 - 1015	150 - 175	81 - 87	51 - 59
C 60	CK 60	En 9	1060	160 - 180	84 - 89	55 - 61
		4360 - 50 A		160 - 180	84 - 89	55 - 61
	17100	3706 - 1.2.3.	ASTMA - 36/68	160 - 180	84 - 89	55 - 61
45 Cr Si 9	17115	4360		160 - 180	84 - 89	55 - 61
	En 20 A			190 - 215	91 - 97	64 - 73
34 Cr Mo 5	17221	970 - 1955	1065	180 - 205	89 - 94	61 - 69
	En 18 B		5135 - 5145	180 - 200	89 - 93	61 - 67
35 Cr Mo 4	34 Cr Mo	En 19 B	4135	200 - 230	93 - 99	67 - 77
	36 Ni Cr 6	En 111	3135	190 - 230	91 - 99	64 - 77
	En 36		3310 - 3315	200 - 230	93 - 99	67 - 77
20 Nc Cr Mo 2	En 362		4315	200 - 225	93 - 98	67 - 75
	En 100 D		8645	190 - 220	91 - 97	64 - 74
	1880 X C 95	DX	W 1	150 - 190	80 - 91	51 - 64
100 Cr 6	100 Cr 6	En 31	52100	210 - 230	96 - 99	71 - 77
	B 2		L 6	190 - 230	91 - 99	64 - 77
52 Nc Cr Mo KU	56 Ni Cr Mo V 7			217 - 248	97 - 102	73 - 83
	2750 (280W18)	18 % W	T 1	217 - 248	97 - 102	73 - 83
		1507 - 825	1310	160 - 220	84 - 91	55 - 64
	A 2		M 13	200 - 230	93 - 99	67 - 77
	210 Cr 46	A 1	D 3	215 - 240	97 - 101	73 - 81
	4845	En 58 G	309 S	150 - 200	80 - 93	51 - 67
X 12 Cr 13	4001	En 56 A	410	150 - 200	80 - 93	51 - 67
X 6 Cr Ni 1810	4301	En 58 E	304	130 - 170	74 - 86	45 - 58
X Cr Ni 1910						
X 8 Cr Ni Mo 1713	4401	1501 - 845	316	160 - 200	84 - 93	55 - 67
Phosphor bronze				60 - 100	56,5	36
Aluminium bronze				70 - 90	49	32
Manganese bronze				95 - 120	51 - 69	34 - 42
Silicon bronze				70 - 100	56,5	36

## Classification of steels

Material	SS Sweden	AISI U.S.A.	DIN Germany	BS Great Britain	UNI Italy	AFNOR France
Carbon steels	1311	1015 - 1035	C 22 - C 35	050 A 20	C 15 - C 35	XC 18
	1572		20 Mn 5 - 28 Mn 6 CK 22 - CK 50	080 M 46 - 50 120 M 19 150 M 28	C 22 Mn C 28 Mn	XC 38 H 1 20 M 5
Carbon steels	1650	1040 - 1064 1770 - 1880	CK 60 - CK 101 36 Mn 5	060 A 40 - 060 A 96 070 M 55	C 45 - C 60	XC 60 - XC 75 40 M 5
	1880		Cm 45 - Cm 55	080 A 40 - 080 A 62		XC 42 H 1 XC 55 H 1
Alloy steel	2120	1335 - 1345 4130 - 4140	25 Cr Mo 4 - 42 Cr Mo 4	1717 CDS 110	25 Cr Mo 4 - 42 Cr Mo 4	25 CD 4
	2255			708 A 37 708 M 40		42 CD 4
Alloy steels	2541	4337 - 4340	40 Ni Cr Mo 6	735 A 50, 534 A 99	40 Ni Cr Mo 2 - 40 Ni Cr Mo 7	35 NCD 6
	2230	50100 - 52100	40 Ni Cr Mo 73	817 M 40	30 Ni Cr Mo 8 - 35 Ni Cr Mo 6 KB	50 CV 4
	2258	6145 - 6152 8630 - 8645	34 Cr Ni Mo 6, 100 Cr 6	311 tipo 6 e 7	50 Cr V 4, 100 Cr 6	100 C 6
Tool steels	2310 - 12	D - 2, D - 3	X 210 Cr 12	BD 2, BD 3	X 205 Cr 12 KU	Z 160 CVD 12
	2754 - 55		X 155 Cr V Mo 121		X 155 Cr V Mo 121 KU	Z 200 C 12
Tool steel	2550	S - 1	60 W Cr V 7	BS 1	55 W Cr V 8 Ku	55 NCVD 7
	2710		55 Ni Cr Mo V 6		55 Ni Cr Mo V 6	
Stainless steels	2324	201, 202 302, 304	X 2 Cr Ni 189	304 S 15	X 2 Cr Ni 18.11	Z 2 CN 18.10
	2333		X 5 Cr Ni 189	304 C 12	X 5 Cr Ni 18.10	Z 6 CN 18.09
			G - X 2 Cr Ni 189	304 S 12	G - X 2 Cr Ni 19.10	Z 3 CN 19.10
Stainless steel	2343	314, 316 317	X 15 Cr Ni Si 2520	316 S 16 317 S 16	X 16 Cr Ni Si 2520	Z 12 CNS 25.20
	2353		X 5 Cr Ni Mo 1812 X 5 Cr Ni Mo 1713		X 5 Cr Ni Mo 1713 X 5 Cr Ni Mo 1815	Z 6 CND 17.12







# Troubleshooting



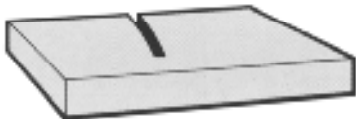

This chapter describes the inspection and troubleshooting procedures for the **CNF 400 CNC**. Regular inspections and efficient maintenance are essential to ensure your machine gives you a long, trouble-free service life. The chapter is divided into two sections: the first being dedicated specifically to **TROUBLESHOOTING BLADE AND CUTTING PROBLEMS**, while the second **TROUBLESHOOTING** section concerns troubleshooting general machine operating faults. Taken together they form a comprehensive troubleshooting guide which will enable you to follow a methodical procedure for solving any problem.

## Troubleshooting blade and cutting problems

PROBLEM	PROBABLE CAUSE	SOLUTION
<b>Cuts not at 90 degrees or angled</b> 	▶ Head speed too high	☞ Reduce head speed
	▶ Disc with worn teeth	☞ Replace disc
	▶ Perpendicularity of disc to work surface	☞ If this is not the case, contact our technical service department
	▶ Cutting speed too low	☞ Increase cutting speed.
	▶ Broken teeth	☞ Check the hardness of the material being cut.
<b>Teeth breaking</b> 	▶ Incorrect lubricant/coolant fluid	☞ Check the water and oil emulsion; check that the holes and hoses are not blocked; direct the nozzles correctly.
	▶ Material too hard	☞ Check the cutting speed, feed speed and disc pressure parameters and the type of disc you are using.

PROBLEM	PROBABLE CAUSE	SOLUTION
<b>Teeth breaking</b> 	<p>▶ Disc not worn-in correctly</p>	<p>☞ With a new disc it is necessary to start cutting at half feeding speed. After the wearing-in period (a cutting surface of about 300 cm<sup>2</sup> for hard materials and about 1000 cm<sup>2</sup> for soft materials) the cutting and feed speeds can be brought up to normal values.</p>
	<p>▶ Disc with excessively fine tooth pitch</p>	<p>☞ The swarf wedges into the bottom of the teeth causing excessive pressure on the teeth themselves.</p>
	<p>▶ New blade inserted in a partially completed cut.</p>	<p>☞ The surface of the cut may have undergone local thermal alteration, making it harder: when starting work again, use a lower cutting speed and head feed speed. A tooth from the old blade may be left in the cut: check and remove before starting work again.</p>
	<p>▶ Workpiece not clamped firmly in place</p>	<p>☞ Any movement of the workpiece during cutting can cause broken teeth: check the vice, jaws and clamping pressure.</p>
	<p>▶ Vibration</p>	<p>☞ Workpiece vibrates in the vice: check that the slide has been adjusted correctly; check the clamping pressure and if necessary increase.</p>
<b>Rapid tooth wear</b> 	<p>▶ Head speed too slow</p>	<p>☞ The blade runs over the material without removing it: increase head speed.</p>
	<p>▶ Cutting pressure too high</p>	<p>☞ Reduce cutting pressure.</p>
	<p>▶ Cutting speed too high</p>	<p>☞ The teeth slide over the material without cutting it: reduce the cutting speed.</p>
	<p>▶ Insufficient coolant</p>	<p>☞ Check the coolant level and clean piping and nozzles.</p>
	<p>▶ Incorrect fluid concentration</p>	<p>☞ Check and use the correct concentration.</p>

PROBLEM	PROBABLE CAUSE	SOLUTION
<b>Rapid tooth wear</b> 	♦ Material defective	☞ The materials may present altered zones either on the surface, such as oxides or sand, or in section, such as under-cooled inclusions. These zones, which are much harder than the blade, cause the teeth to break: discard or clean these materials.
<b>Broken blade</b> 	♦ Head speed too high	☞ Reduce head speed.
	♦ Teeth in contact with material before starting the cut	☞ Always check the position of the blade before starting a new job.
	♦ Insufficient coolant	☞ Check the coolant level and clean piping and nozzles.
	♦ Vibrations	☞ Workpiece vibrates in the vice: check that the slide is regulated correctly; check the clamping pressure and if necessary increase.

Troubleshooting (control console diagnostics)


This section deals with problems which may occur during machine operation. The M24 controller allows you to test all the machine electrical and electronic devices by checking the status of the input and output signals on the IUD/IUV card.

Displaying the diagnostics menu

- ▶ Power up the machine as per the instructions in Chapter 5;
- ▶ press F6 to access machine diagnostics;
- ▶ press RESET to enable the digital outputs.

**N.B.** Should access to the diagnostics menu prove impossible, then press F3 immediately after powering up the machine;


The diagram below shows the inputs and outputs, both digital and analog, of the machine:

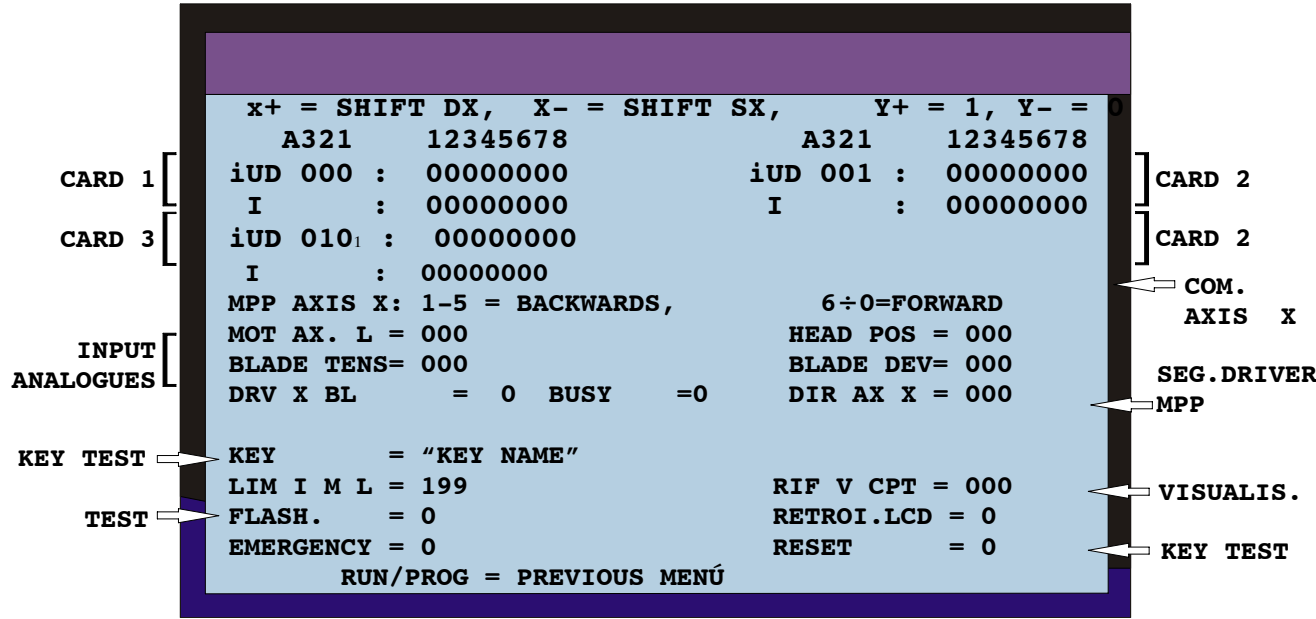


Diagnostics

Once you have opened the diagnostics menu, a set of characters, each corresponding to INPUT and OUT PUT signals on the M24 controller are displayed. For further information, refer to the electrical and electronic diagrams illustrated in chapter 6 of this manual. The IUD–IUV card are mounted inside the M24 controller.


Legend of navigation and reading keys

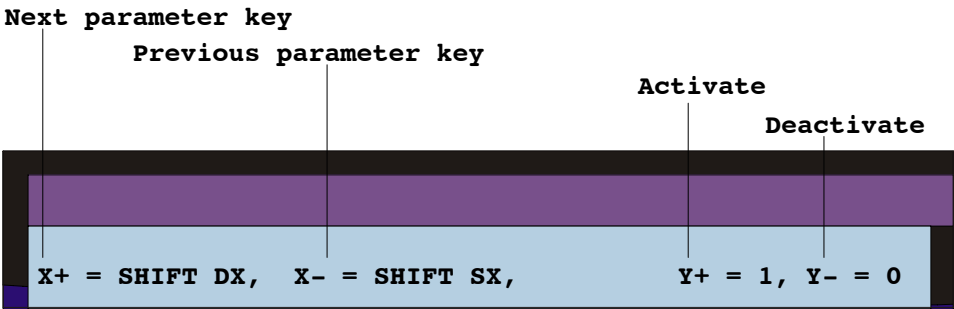

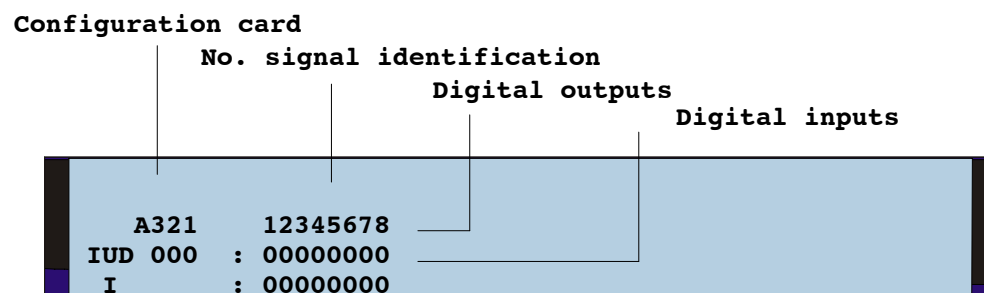


### Digital outputs CARD IUD 1

Digits 0 and 1 on the top line of the display indicate the OFF (0) or ON (1) status of each output; press relative activation (y+) or deactivation keys (y-), to check functioning; but press Reset beforehand to enable output:

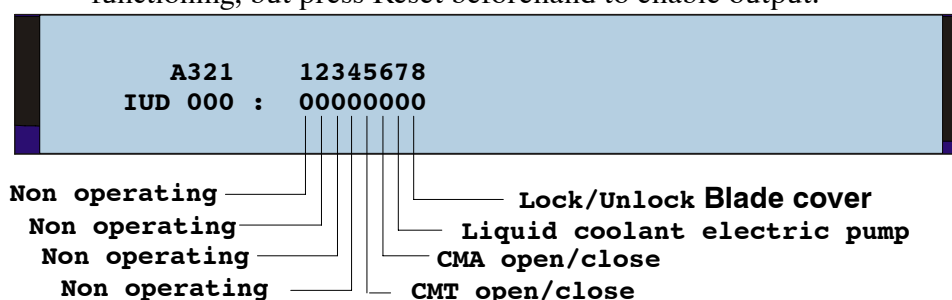


### IUD card 1 digital inputs

The numbers 0 and 1 shown on the bottom line of the display, indicate whether the OFF (0) or ON (1) status of each input; pressing the relative activating (y+) or deactivating (y-) buttons, it is possible to check their operation;

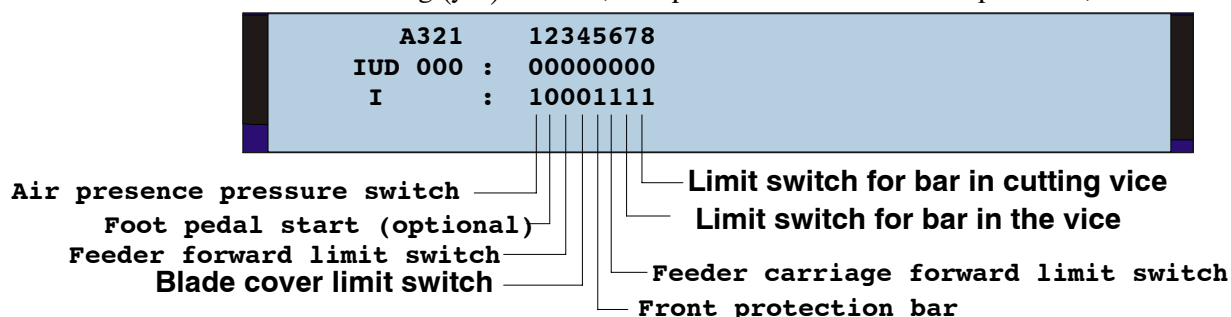


### Digital outputs CARD IUD 2

Digits 0 and 1 on the top line of the display indicate the OFF (0) or ON (1) status of each output; press relative activation (y+) or deactivation keys (y-), to check functioning; but press Reset beforehand to enable output:

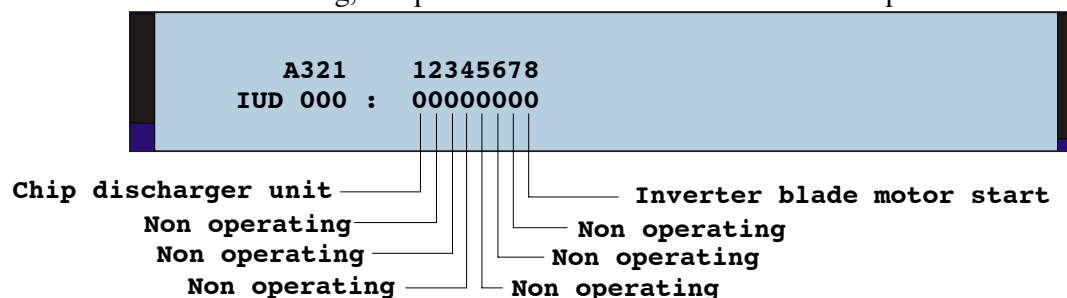


### IUD card 2 digital inputs

The numbers 0 and 1 shown on the bottom line of the display, indicate whether the OFF (0) or ON (1) status of each input; pressing the relative activating (y+) or deactivating (y-) buttons, it is possible to check their operation;

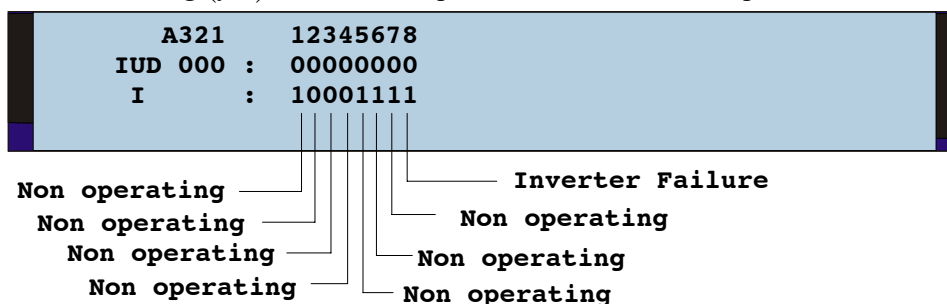


### Input card IUV

Forward and reverse speed of the feed step motor can be controlled in the following way: digits 1 to 5 reverses the feed carriage at progressive speed, in the same way, digits 6 to 0 for forwarding;

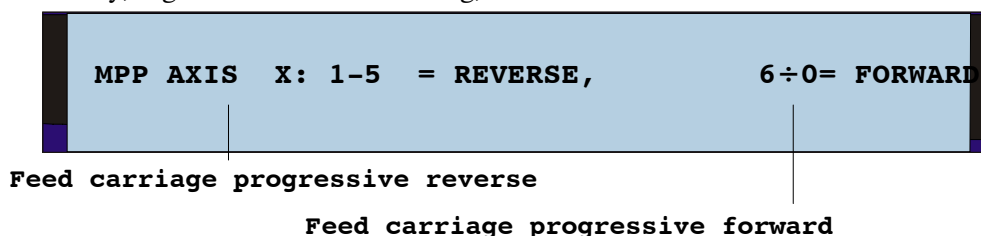


Blade motor absorption appears expressed in Ampers once blade inverter motor start has been activated in CARD no. 2. The head position visualises the cutting value transmitted by the cylinder head transducer which is between 1 and 255 and represents the current head height.

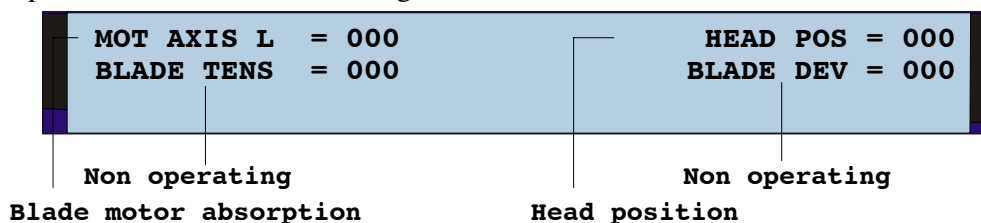

The blade motor maximum absorption visualises the cutting force value between 1 and 199 which is transmitted by the inverter by means of the potentiometer rotation on the control board.

The vertical CPT (Head cylinder) visualises the value between 1 and 199 transmitted by the cylinder head step motor.

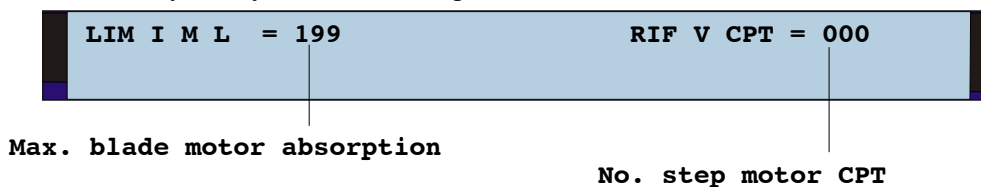


### Input card CNSL (control console)

Each key on the console has a name which appears on the diagnostic menu after the sign "=", when pressed. For example, if we press key "start" to start up the cycle, alongside the sign "=" we see "START";

If, however, the name doesn't appear after the sign "=", it follows that malfunctioning is probably due to the key on the console which does not conduct electricity when turned off.

<b>KEY</b>	<b>= "KEY NAME"</b>
------------	---------------------

The values indicated in the following prospectus visualise activation or deactivation of the devices commanded by the CARD Console.

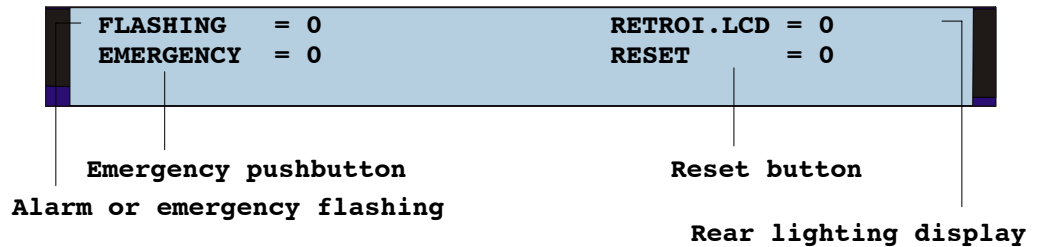


## Error messages, alarm and emergency

The machine's M24 controller notifies the operator of any alarm or emergency condition which may occur during production by way of acoustic and visual signals.




This message is displayed at each emergency initialisation.

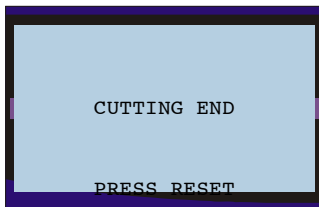


This message is displayed when the machine has carried out a full automatic cutting cycle. It advises the operator that the cycle is finished.  
 ► Press RESET to restore manual command control.



This message is displayed when the bar load is terminated during normal, automatic cutting cycle.  
 ► Press RESET to restore manual command control.

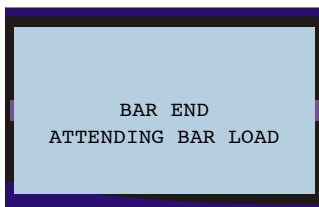

This message is when the bar load is terminated during normal, automatic cutting cycle. It advises the operator that the cycle is finished.  
 ► Press RESET to restore manual command control. After inserting the new bar press START, the machine will register the material and continue the programme from where it was interrupted.

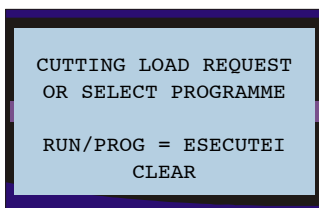


This message is displayed when an automatic cycle has been started without selecting the programme or setting the programme number.  
 ► Press RUN/PROG once the number of cuts has been set or the programme selected to return to automatic cycle display.  
 ► Press CLEAR to cancel data.




This message is displayed when tool reaches its duration in hours which is pre-set in the submenu (F8 = blade thickness) of the automatic cycle, the maximum limit is 9999 min

► Press RESET to return to manual command control.

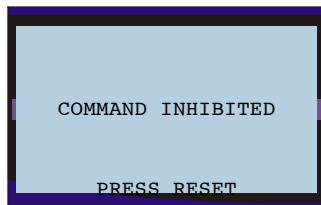


This alarm indicates a conflicting machine setting.

► Press RESET to return to manual command control.

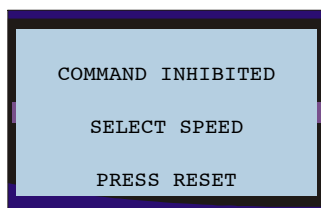


This message is displayed if the cycle has been started without having selected the cutting speed or the inverter range. Select speed.

► Press RESET to return to manual command control.

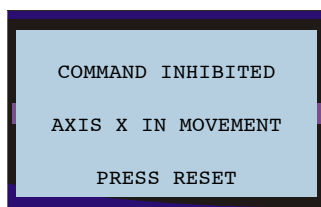


This message is displayed when a further command is given to the carriage feed.

► Press RESET, operation will follow and appear on the display.

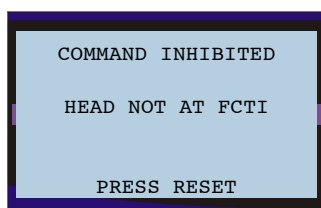


This message is displayed when a START cycle command is given and the head is not at FCTI position.

► Press RESET, to return to manual command control.

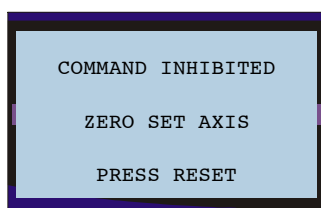


This message may appear if the ZERO SETTING cycle has been skipped because machine was initially intended for semi-automatic cycle.

► Press RESET to return to work display then proceed to "ZERO SETTING"

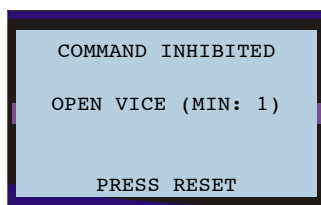

This message is displayed when trying to move feed with manual buttons and both vices were previously closed.

► Press RESET, to return to manual command control.

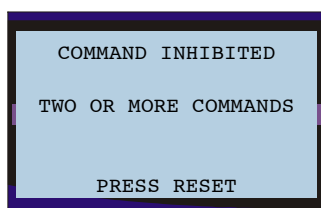

This message is displayed when "PLAYING" with the keyboard i.e. when a command has been given and keys continue to be pressed.

► Press RESET, to return to manual command control



COMMAND INHIBITED  
CUTTING CYCLE IN PRO-  
GRESS  
  
PRESS RESET

This message may appear when cutting cycle has been started and the machine has been requested to carry out other operations.  
► Press RESET, to return to work display.

ALARM  
ATTEMPTING MEMORISA-  
TION  
CUTTING LIMIT ERROR  
  
PRESS RESET

This message is displayed when the cutting limit has been changed. New cutting start position could be lower than previous position saved for cutting end position.  
► Save FCTI and FCTA positions again and press RESET to return to manual command control.

EMERGENCY  
EMERGENCY STOP BUTTON  
PRESSED  
  
PRESS RESET

This message is displayed if an operation is activated before releasing the HEAD EMERGENCY STOP button.  
► Release the emergency stop button and press RESET to return to manual command control.

EMERGENCY  
FEED BAR JAMMED  
  
PRESS RESET

The causes of this problem could be of mechanical, electrical or electronic nature.  
► Press RESET to return to manual command control

EMERGENCY  
INVERTER FAILURE  
  
PRESS RESET

This message is always on line when the system is in use.  
► Press RESET, to restore manual command control.

EMERGENCY  
HEAD JAMMED  
  
PRESS RESET


This message is always on line when the system is in use.  
► Press RESET, to restore manual command control.

EMERGENCY  
FEED REQUESTED WITH  
FCTI ERROR  
  
PRESS RESET

This message may appear during automatic cycle when the head returns to FCTI position and then loses its positioning.  
► Press RESET to restore manual command control.

EMERGENCY  
DRIVER MPP AXISX IN  
BLOCO  
  
PRESS RESET


This messages derives from an anomaly in AXIS X control and may be due to over-heating or electronic breakdown.  
► Press RESET to restore manual command control.

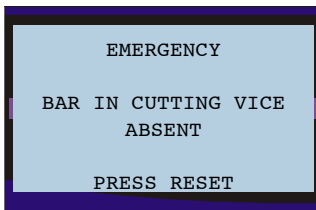

This message is displayed when no material has been loaded in the cutting vice or when the cutting vice hasn't been manually positioned at a distance of  $2 \div 3$  mm before being automatically closed

► Press RESET to restore manual command control.


This message is displayed each time the controller software transmits an error, it is identified as (XX). Here follows a list of error codes which may occur during working.

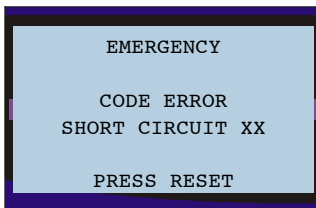

- 0 = INCORRECT RESET OR INTERRUPTS
- 1 = DIGITAL INPUTS CARD 3 UNSTABLE
- 2 = DIGITAL INPUTS CARD 4 UNSTABLE
- 3 = NO STATUS OR SCREEN
- 4 = DIGITAL INPUTS CARD 1 UNSTABLE
- 5 = DIGITAL INPUTS CARD 2 UNSTABLE
- 6 = ANALOGUE INPUT BLADE TENSION (#9) UNSTABLE
- 7 = INP. ANALOGIC AXIS BLADE MOTOR (#3,4) UNSTABLE
- 8 = INP. ANALOGIC POWER TABLE CENTRE HEAD (#6) UNSTAB.
- 9 = OUTS 1st AND 2nd OUTS REQUEST SPEED. SIMULT.
- 10 = REQ. OUTS 1st AND CEN. STAR 2nd SPEED. SIMULT.
- 11 = REQ. OUTS 1st, CEN. STAR AND 2nd SPEED. SIMULT.
- 12 = EEPROM UNAVAILABLE
- 13 = IU V FAILURE
- 14 = TEST RAM FAILED
- 15 = TEST ROM FAILED
- 16 = UNDEFINED EMERGENCY
- 17 = NO CUTTING CYCLE PHASE
- 18 = INP. ANALOGIC POWER TABLE CENTRE. HEAD (#6) UNSTAB.

► Press RESET to restore manual command control

# Optional

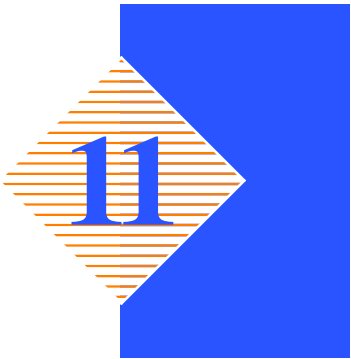

This chapter provides a list of the available accessories that can be fitted to this machine, along with assembly instructions.

## Accessories available on request


These optional extras must be fitted in the manufacturer's factory, inasmuch as they could be difficult for the user to mount by himself. A list of these parts is provided below.





 

### Chute type bar loader CB 6001

This accessory delivers all the bars on the loader chute in order, giving long autonomy to the saw even when unattended.

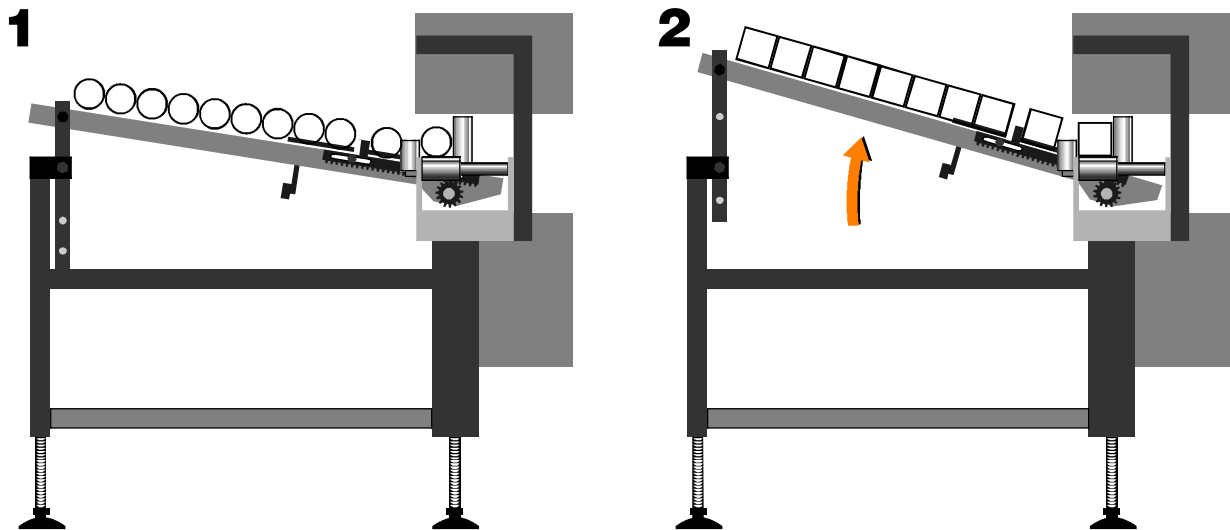
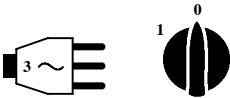

**N.B.** CB 6001 must be ordered with the saw, as it is necessary to enhance the controller and to test it carefully before delivery.

It has a surface of 80 cm with adjustable tilt feature, can be loaded entirely with circular bars (1) or square bars (2), solid or tubular, in the dimensions indicated in the table below:




LOAD TABLE						
Sections						
mm	20 ÷ 80	20 ÷ 100	20 ÷ 80	20 ÷ 100	130 x h 10 ÷ 35	130 x h 10 ÷ 100

It must be connected to a 6 Bar pneumatic power supply and the motor is fed by the saw control.


CHARACTERISTICS		
		
<b>BAR</b>	<b>kw</b>	<b>kg</b>
6	0.37	485

#### Installation:

- ▶ fit the adaptor, which is together with the motor unit, on the loading side of the machine;
- ▶ position the motor unit on the loading side (left) and connect it to the machine adaptor;

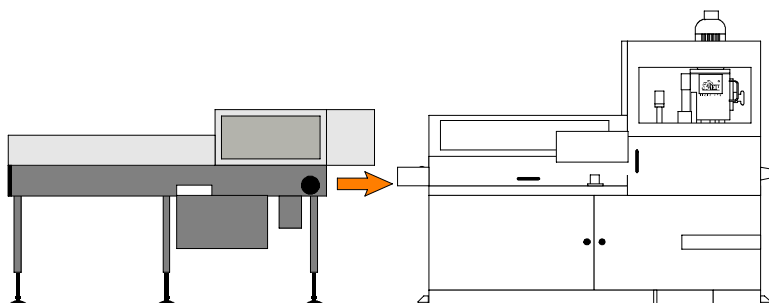

- ▶ before tightening the screws, use a ground bar and place the first module level with the working surface, adjusting the feet;
- ▶ fit the other two modules, by inserting the male tubes into the female ones;

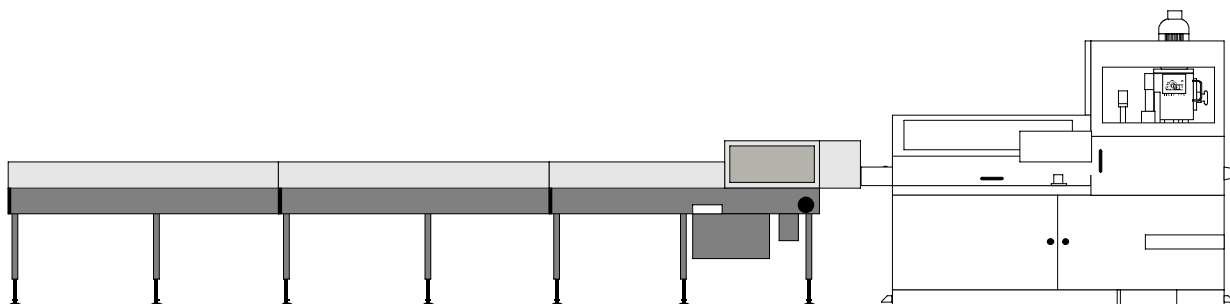


- ▶ open the rollers that determine the load section entirely; then insert the drive connection coupling in the crown gear of modules 1 and 2, then of modules 2 and 3;
- ▶ fix the modules using screws and bolts in the tube holes;
- ▶ unwind the emergency winding, located on the first module, until the device reaches the last module; fix it using screws in an easily accessible place;
- ▶ take the emergency mushroom, located on the first module, to the end of the last module which is set for fixing and connecting the cables;
- ▶ insert the power supply plug into the socket on the left-hand side of the machine;
- ▶ connect the male terminals of the signal cables to the controller card, making them pass through the hole in the electric cabinet with sheath and fitting, then connect the male terminals with the female terminals inside the cabinet.

## Optional

### Blade


The disk for the **CNF 400 CNC** is:

- circular blade HM Ø 400x32x3,8.

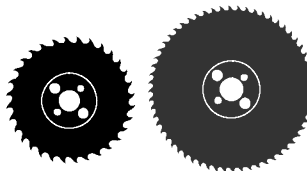

### Roller table

- K40 roller table module for feed side, 1500 mm;

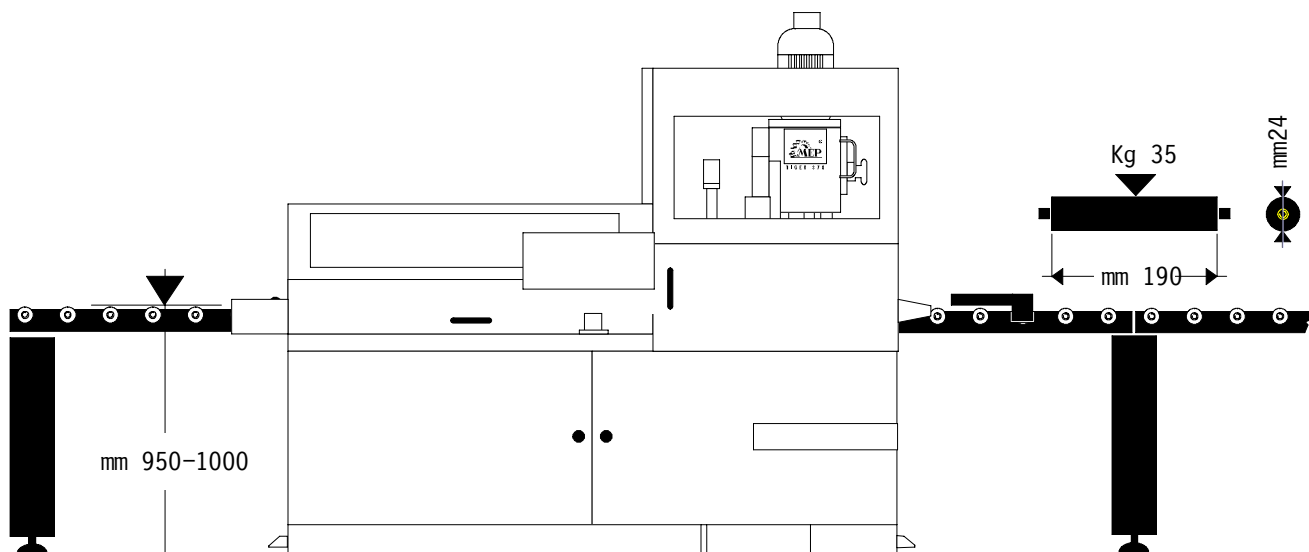

- K40 roller table module for discharge side, 1500 mm.


### Can of emulsible oil

5 l can of emulsible oil.

### Adattatore pianale a rulli lato scarico

This device is used to attach the discharge roller table to the machine, and instructions are supplied below for how to assemble it:

- ▶ remove the chute from the right-hand side of the fixed platform;
- ▶ attach the adapter and secure it in place with the screws removed previously.

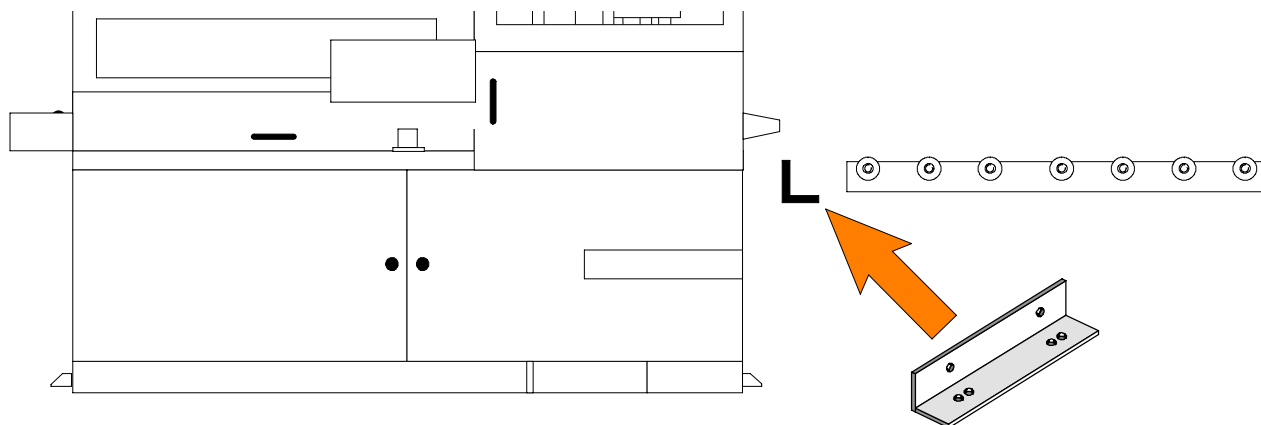


- ▶ Attach the outfeed rolling deck by fixing it with the screws supplied.

### Feed side roller table support

This device is used to increase the load-bearing strength of the roller table, both during feeding and discharge. The steps which should be followed to assemble it are illustrated below.

- ▶ Disconnect the table from the adapter (on the discharge side, for example);

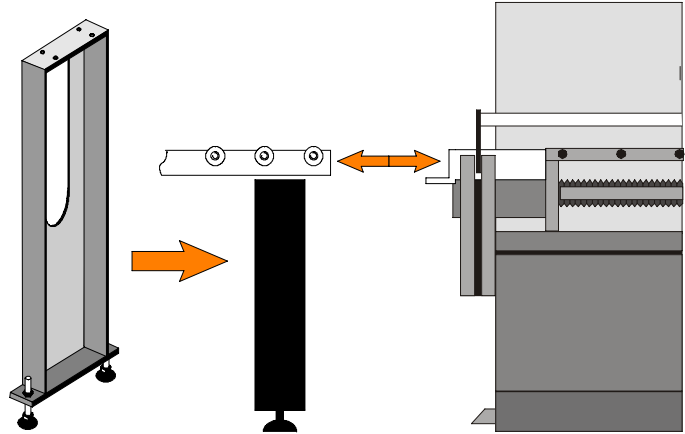

### Minimal lubrication system

This device was designed to improve lubrication of the tool during cutting.

- ▶ An instruction book is supplied with the kit to explain how to install this optional unit.
- ▶ position the support to correspond with the holes on the base of the trailer and reconnect to the adapter.

# Warranty

---

Hyd-Mech Group warrants each new sawing machine to be free from failure resulting from defective material and workmanship under proper use and service for a period of one year following the date of shipment to the user. Hyd-Mech's sole obligation under this warranty is limited to the repair or replacement without charge, at Hyd-Mech's factory, warehouse, or approved repair shop, of any part or parts which Hyd-Mech's inspection shall disclose to be defective. Return freight must be prepaid by the user.

This warranty, in its entirety, does not cover maintenance items, including but not limited to lubricating grease and oils, filters, V-belts, saw blades, etc, nor any items herein which show sign of neglect, overloading, abuse, accident, inadequate maintenance or unauthorized altering.

Liability or obligation on the part of Hyd-Mech for damages, whether general, special or for negligence and expressly including any incidental and consequential damages is hereby disclaimed. Hyd-Mech's obligation to repair or replace shall be the limit of its liability under this warranty and the sole and exclusive right and remedy of the user.

THIS WARRANTY IS EXPRESSLY IN LIEU OF ALL OTHER WARRANTIES, EXPRESSED OR IMPLIED, WRITTEN OR ORAL, INCLUDING WITHOUT LIMITATION ANY IMPLIED WARRANTIES OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE.

This warranty may be not changed, altered, or modified in any way except in writing by Hyd-Mech Group.

---

HYD-MECH GROUP LIMITED  
1079 Parkinson Road  
P.O. BOX 1030  
Woodstock, Ontario  
N4S 8A4

Sales Toll Free: 1-877-276-SAWS (7297)  
Phone: (519) 539-6341  
Fax: (519) 539-5126  
Website: [www.hydmech.com](http://www.hydmech.com)  
e-mail: [info@hydmech.com](mailto:info@hydmech.com)



*The Rock Solid Solution*

Through its twinned distribution channel of authorized dealers and factory representatives, HYD•MECH services worldwide network of customers from its two state-of-the-art manufacturing facilities in Houston, Texas, USA and Woodstock, Ontario, Canada. Check out the full range of Rock Solid Sawing Solutions at [www.hydmech.com](http://www.hydmech.com)

HYD - MECH GROUP LIMITED  
1079 Parkinson Road, P.O. BOX 1030  
Woodstock, Ontario, Canada N4S 8A4  
Sales toll free: 1-877-276-SAWS (7297)  
Telephone: (519) 539-6341  
Fax: (519) 539-5126

Customer service toll free: 1-877-237-0914 - PARTS FAX: (519) 539-5099 - WEBSITE: [www.hydmech.com](http://www.hydmech.com) - E-MAIL: [info@hydmech.com](mailto:info@hydmech.com)